 
## **Assembly Instructions-C26b BNC**

## **ORIGINAL CRIMP PLUGS**




ferrule


boot

ferrule clamp plug body assembly nut assembly

Amphenol Number	Connector Type	Cable RG-/U	Hex Crimp Data			Stripping Dimensions, inches (mm)		
			Cavity for Contact	Cavity for Outer Ferrule	Die Set for Tool 227-944*	а	b	с
31-351	BNC Plug	58, 141	—	.213(5.4)	227-1221-11	.922(23.4)	.516(13.1)	.250(6.3)
31-359	BNC Plug	59, 62, 140	—	.255(6.5)	227-1221-13	.922(23.4)	.516(13.1)	.250(6.3)
31-371	BNC Plug	174, 179, 187, 188, 316	—	.128(3.2)	227-1221-3	.797(20.2)	.516(13.1)	.250(6.3)

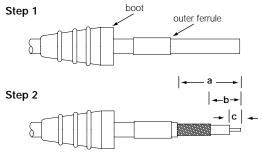

 Step 3









cable dielectric must

 butt insulator as shown



Step 5

 Step 6



lip of boot must be firmly posi-Step 7 tioned in body groove

- Step 1 Install boot and slide outer ferrule onto cable as shown prior to stripping cable.
- Step 2 Strip cable jacket, braid and dielectric to dimensions shown. See attached table for dimensions. All cuts are to be sharp and square. Important: DO NOT nick braid, dielectric, and center conductor when cutting. Tin center conductor using soft solder per QQ-S-571 comp Sn 60. Avoid excessive heat while tinning to prevent swelling of cable dielectric.
- **Step 3** Slightly flare out end of cable braid as so as to facilitate insertion onto ferrule clamp nut assembly. Important: DO NOT comb out braid.
- Step 4 Install ferrule clamp nut assembly onto cable so that ferrule portion slides under braid and insulator butts flush against cable dielectric. Slide outer ferrule over braid and up against nut. Make sure no slack exists in braid. Crimp outer ferrule with tool specified in table above, keeping cable dielectric bottomed against insulator.
- Step 5 Soft solder center conductor to contact using rosin core per QQ-S-571 comp Sn 60. DO NOT get any solder on outside surfaces of contact.
- Step 6 Screw connector body onto prepared cable termination . Wrench tighten by holding the cable nut assembly STATIONĂRY while ROTĂTING the connector body.
- Step 7 Push body forward and into position as shown to complete assembly.

\* for pneumatic crimp tool 227-60, use die sets indicated in this column

## **X-ON Electronics**

Largest Supplier of Electrical and Electronic Components

Click to view similar products for RF Connectors / Coaxial Connectors category:

Click to view products by Amphenol manufacturer:

Other Similar products are found below :

 8915-1511-000
 89674-0827
 6001-7071-019
 6002-7051-003
 6002-7551-202
 6059674-1
 619550-1
 630059-000
 M39030/3-01N
 M3933/25 

 36N
 6500-7071-046
 6769
 CX050L2AQ
 7002-1542-011
 7004-1512-000
 7009-1511-004
 7010-1511-000
 7029-1511-060
 7101-1541-010

 7101-1571-002
 7105-1521-002
 7145-1521-002
 7203-1571-003
 7209-1511-011
 7210-1511-015
 7210-1511-019
 73137-5015
 73216-2241

 7325-1512-000
 73404-2300
 7405-1521-005
 7405-1521-005
 7406-1521-005
 8527
 8547
 FS11V
 8808-1511-001
 9049-9513-000
 9074-9513 

 000
 9101-9573-002
 910A205F
 9130-9573-002
 PL11SC-026
 PL375-33
 PL40-5
 PL71-9
 PL74C-221
 PL75MC-217
 PL803-7
 980-8666-005