

Cautions for soldering

1. Recommended solder

Flux cored solder (Lead-free: Sn-3Ag-0.5Cu)

Micro coaxial cable · · · 0.15 mm dia. Length 10.5 mm

1 Deleted


If you consider using additional flux, please pay enough attention not to have flux wicking to the contact area. Flux wicking to the contact area will cause contact failure.

2. Setting the cable

Set the conductors as each conductor is placed at the center of the cantact.

In case of micro coaxial cable, set it as the metal bar fits in the guide on the connector.

⚠ Deleted

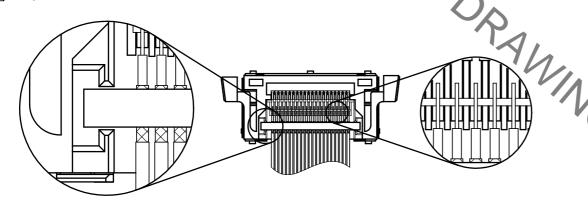

⚠ Deleted

- 3. Place the cable to the connector and check the below points before soldering by pulse heat.
 - Transformation of conductor
 - · Misalignment of conductor to the terminals in pitch direction
 - Excessive floating of conductor

 
The above could cause soldering failure and/or solder bridge.

⚠ Deleted

Transformation of conductor



Misalignment in pitch direction






4. Follow the recommended temperature profile shown below for the soldering.

The optimum condition could vary depending on various factors including type of cable and its length, solder type. Therefore refer to the recommended temperature profile and optimize the condition if necessary.


Solder tip pressurization	13 ~ 17 N

heating	Micro coaxial cable
Temperature (Y)	275± 5 ℃
Duration (X)	2± 0.5 sec


⚠ Deleted

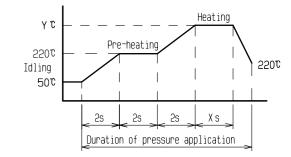


5. After soldering, check that no defect is found at soldered area. Examples of correct soldered and defective soldered state are shown below.

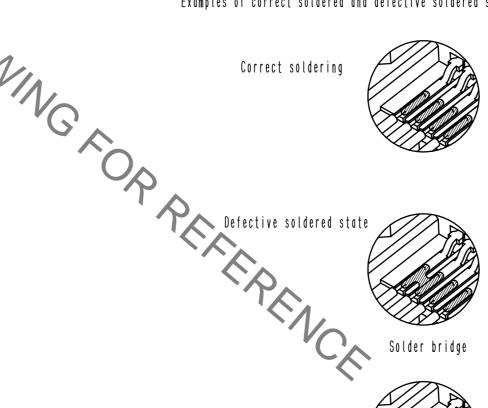

Conductors are placed at the center of the contact, and whole area is equally wetted.

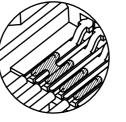





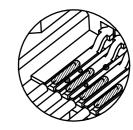


Solder shortage

 Solder ball dispersion

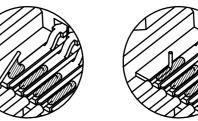



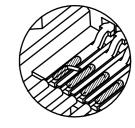

Floating

Conductor sticking out The conductor approaches

to the adjacent contact

*Note: The figures shown in this page are solely for the instruction purpose. Therefore, the appearance could differ from the actual connectors. Refer to the drawing for the actual design (sheet 1).

$\begin{bmatrix} \end{bmatrix}_{N0}^{CODE}$ CL575-3321-4-00	1 4
CODE CLEZE 2224 4 00	A .
FX16-21P-0.5SDL	
DRAWING EDC3-158269-01	

FORM HC0011-5-8


FORM HC0011-5-8 1

Cautions for potting process

1. Protect the soldered area by UV cured resin or any equivalent (referred to as 'potting' hereafter). In order to prevent insulating failure caused by metal adhering, cable breakage during cabling and other troubles.

Exercise extreme caution during the process so that no resin flows or adheres to the contact area.

- 2. Apply 3033 manufactured by THREEBOND CO., LTD. or any equivalent product for potting. Follow the instruction of potting manufacture's for the condition of UV exposure.
- 3. Refer to the following conditions for the potting area.

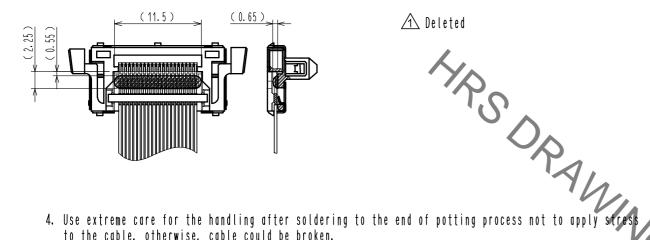


⚠ Deleted

Cautions for cover shell assembly

to the cable, otherwise, cable could be broken.

- 1. Attach a cover shell separately provided after the cable assembly process. For micro coaxial cabla : FX16-21P-GNDL ⚠ Deleted
- 2. Place the cover shell onto the connector horizontally and pinch two components from top and bottom with fingers.

3. Check the five fitting points after assembly and make sure that they are all correctly fitted together.

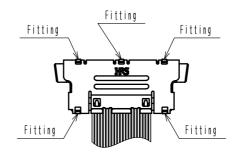


How to check fitting points (Cut section of fitting points)

Ground plate hooks the protrusion of connector housing

Ground plate does not hook the protrusion of connector housing

Soldering to ground plate

1. Solder down the metal bar of the cable and ground plate after the assembly of ground plate in order to enhance the grounding performance and robustness against cable stroke to up and down direction.

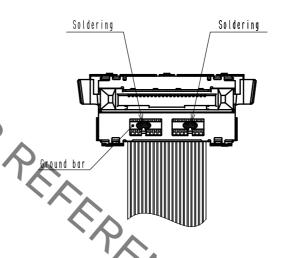



⚠ Deleted

2. Excess solder and/or excess heating could cause cable and connector deformation and/or melt.

Cable assembly process is completed.

Ε

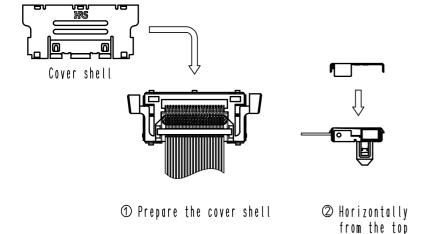

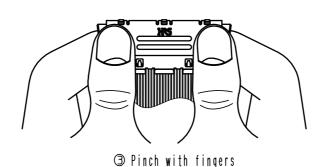


*Note: The figures shown in this page are solely for the instruction purpose. Therefore, the appearance could differ from the actual connectors. Refer to the drawing for the actual design (sheet 1).

		DRAWING NO.	EDC3-158269-01		
		PART NO.	FX16-21P-0.5SDL		
		CODE NO.	CL575-3321-4-00	\triangle	5/
		7			

Handling instructions

1. Insertion to on-board connector

The connector mating is keyed. Align the marks as shown in the figure for mating. Insert the connector completely until they are locked at both ends.

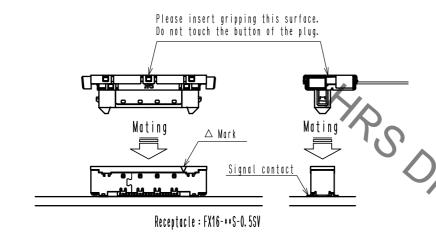


The connectors have a reverse-insertion prevention structure, however, the connectors may be damaged when inserted reversely with the force of 25 N or more. Avoid a forceful insertion, and make sure to confirm that the connectors are aligned with the marks before the mating operation.


2. After mating

Carefully wire cables, so that excessive force will not be applied to the mated connectors. Pulling the cable with the force of 20 N or more may damage the connectors. It may also cause cable breakage. Take a caution to avoid pulling the cables.

Repetitive cable strokes could also cause cable breakage as well. Do not use the connector under the environment of repetitive cable strokes.

Take enough bend radius and/or distance from the connector for the cable not to apply stress to the connector base when the application requires cable bend back.

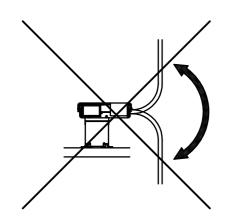

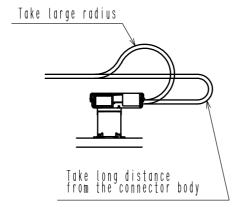

Repetitive cable strokes

Application of cable bend back

*Note: The connectors shown in this page are drawn for the instruction purpose, therefore, the appearance differs from the actual connectors.


Please confirm the connector configuration on the connector drawing (SHEET 1).


3. Withdrawal from on-board connector


The connectors are locked while they are mated. In order to unmate the connectors, pull out straight, with the button pushed to release the lock. At this time, do not pull the cable. Also, avoid the withdrawal in angle, which may damage the connectors.


<Correct withdrawal>

3 Pull out straight, with the button pushed.

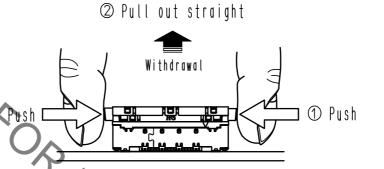

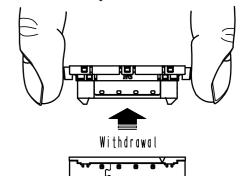

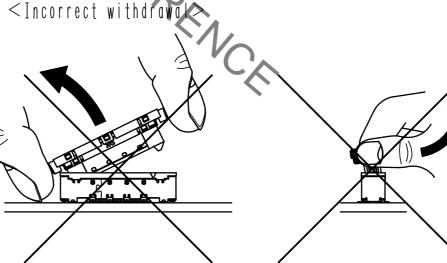

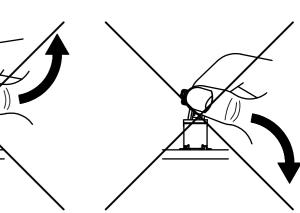

PART | CODE | NO. | CL575-3321-4-00 | 16

FORM HC0011-5-8 1 2 3 4 5

X-ON Electronics

Largest Supplier of Electrical and Electronic Components

Click to view similar products for FFC & FPC Connectors category:

Click to view products by Hirose manufacturer:

Other Similar products are found below:

K-FC20 FH29B-80S-0.2SHW(99) FPH-2022G AYF332735 52610-1075 52610-1275 52610-1934 501864-3091-TR225 086222026001800 52610-0675 62684-36210E9ALF 52746-1671-TR250 10051922-2810EHLF 6-520415-9 SFV6R-1STE9HLF XF3M-2915-1B-R100 1658549-1 46214008010800 AYF534065TA AYF351525 086212040340800+ AYF530365TA 67000-014LF 67000-004LF 006207341915000+ DS1020-19RT1D 67000-003LF 67000-011LF 67000-016LF HFW14R-2STE9LF SFV32R-2STBE9HLF SFW12R-5STE9LF SFW18R-1STAE9LF SFW4R-5STE9LF 52807-0430 046283021002868+ THD1015-8CL-SN 67000-006LF 502250-8027 104267-9617 66987-011LF AYF362535 F0501-T-50-20T-R HFW8S-2STAE1HLF 67000-008LF 67000-012LF ECC576069EU F1002-B-20-20T-R HFW15S-2STAE1HLF 0781271110