

Pro'sKit®

MT-4606

INFRARED THERMOMETER

FDA FC CE  **RoHS
COMPLIANT**



User's Manual
1st Edition,

©2020 Copyright by Prokit's Industries Co., Ltd.

1. Specifications

Temperature Range	-50~550°C (-58~1022°F)
Accuracy	≤100°C±2°C, > 100°C ±2%
Unit	°C / °F
Resolution	0.1°C (0.1°F)
Response Time	≤0.5S
Emissivity	Adjustable (0.1 to 1.0)
Distance to Spot Ratio	12 : 1
Laser class	Class II <1mW
Storage Temperature	-20 to 50°C (-4~122°F)
Operating Temperature	0 to 50°C (32~122°F)
Operating Humidity	10~95%RH (Non-condensing)
Power	9V battery (not included)

Warning!

Do not point laser directly or indirectly (through reflective surfaces) at eye.

2. Operation

1) Turn on:

Install the battery and press the measurement button, then the thermometer will be turned on and show the temperature reading automatically.

2) LCD display:

The LCD will display the signal of functions (as in diagram 3)

3) Measurement:

Aim at target with thermometer head, and press the measurement trigger, then release the button (need to press the button for at least 0.5 second), the display will show the current temperature, or press and hold the button for continuous testing with more temperature results

4) Turn off

The thermometer will turn off automatically after 15 seconds of no operation

5) Laser on

Turn on Laser during measurement, the instrument will irradiate with a multi-point laser, The region shown by multi-point laser can only

be used as a reference for the measured area, which cannot be equivalent to the measured area.

3. Distance Spot Ratio

The farther the target, the larger the testing spot area, it means: As the distance from thermometer to the object increases, the spot size of measuring area becomes larger, (as in diagram 1) it is named as "D:S" (Distance Spot Ratio). The diameter of the target spot area is 3.0cm when you test from distance 36cm, and the thermometers will show the average temperature of target spot area with diameter 3.0cm.

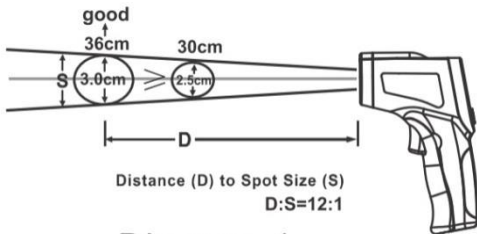


Diagram 1

NOTE:

If the laser is turned on at the time of the measurement, the instrument irradiated a multi-point laser, The region shown by multi-point laser can only be used as a reference for the measured area, which cannot be equivalent to the measured area.

4. Emissivity

Most organic materials, painted or oxidized surfaces have an emissivity of 0.95 (pre-set in the unit). Inaccurate readings will occur if the surface to be measured is shiny or polished such as stainless steel or aluminum. To obtain better accuracy, please cover the surface with masking tape or flat black paint before measuring. Measure the tape or painted surface when the tape or painted reach the same temperature of the material underneath. Please kindly note: thermometer cannot measure the temperature of target objects through the surface of glass. And steam, dust, smog will lower the accuracy.

5. Detailed function

- 1: LCD
- 2: Laser /up button
- 3: Function button
- 4: °C/°F / down button

- 5: Measurement trigger
- 6: Battery compartment
- 7: Laser hole
- 8: Infrared Sensor



Diagram 2

Button function:

After power on

- 1) Press button 4 (°C/°F button), switch the °C/°F
- 2) Press button 2 (laser button), test with laser
- 3) Press button 3 (function button) to get into the emissivity adjust, and then press button 2 or 4 to adjust emissivity

Display

1. Remaining battery-power
2. Laser Sign: test with laser
3. Backlight sign
4. Scan Mode: shows on LCD when testing
5. °C/°F Symbol
6. Current temperature.
7. Max temperature or Emissivity reading
8. Max temperature sign
9. Adjustable emissivity sign

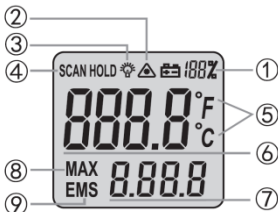


Diagram 3

6. Infrared thermometer should be protected in the following:

- EMF (electro-magnetic fields) from arc welders, induction heaters.
- Thermal shock (caused by large or abrupt ambient temperature changes, it allows 30 minutes for unit to stabilize before use).
- Do not leave the unit on or near objects of high temperature.

7. Battery:

If the battery shows less than 10%, replace the battery in time.
If not used for a long time, take out the battery to prevent damage to the product due to battery leakage

8. Maintenance

1. Lens cleaning: use clean compressed air to blow off loose particles, use a soft brush to remove debris, at last clean it with damp cotton cloth.
2. Case cleaning: clean the case with a damp sponge/cloth and mild soap.

NOTE:

1. Do not use solvent to clean lens.
2. Do not submerge the unit in water

Emissivity of Articles

Material	Feature	Emissivity	Material	Feature	Emissivity
Aluminum	Oxidized	0.3	Limestone		0.98
	Polished	0.02-0.04	Paint		0.93
Brass	Oxidized	0.5	Human skin		0.98
	Polished	0.02-0.05	Graphite	Oxidized	0.20-0.60
Gold		0.01-0.10	Rubber		0.95
Iron	Oxidized	0.7	Plastic cement		0.85-0.95
Steel	Oxidized	0.70-0.90	Concrete		0.95
Asbestos		0.95	Cement		0.96
Plaster		0.80-0.90	Soil		0.90-0.98
Asphalt		0.95	Mortar		0.89-0.91
Rock		0.7	Brick		0.90-0.96
Wood		0.90-0.95	Marble		0.94
Charcoal	Powdered	0.96	Textile		0.95
Carbon		0.85	Paper		0.95

Lacquer work	lackluster	0.97	Sand		0.90
Carbon Cement		0.90	Clay		0.92-0.96
Soap Bubble		0.75-0.80	Glass		0.85-0.92
Water		0.93	Heated food		0.95
Snow		0.83-0.90	Oil		0.94
Ice		0.96-0.98	Steel and iron		0.80
Frozen Foods		0.95	Wool	Natural	0.94
Ceramics		0.95	Lead	Oxidized	0.5

Pro'sKit® MT-4606 紅外線測溫槍使用說明書

一、概述

紅外線測溫儀採用非接觸紅外線傳感技術對目標進行安全、準確、快速、可靠的測量。廣泛適用於測量機械、化工、陶瓷、輕工、食品、冶金、電力、熱處理等行業高溫、危險及難以接近物體表面的溫度。

二、工作原理

任何溫度大於絕對零度的物體都會輻射紅外能量，此能量以光速向四周傳輸。紅外線測溫儀的透鏡收集並彙集紅外能量到感測器上，感測器產生一個低電壓輸出，此電壓與目標物體的溫度成正比，電壓輸出經過處理後顯示為溫度值。

三、操作說明

測溫儀基本外觀由幾個部分組成，使用時請按以下說明進行操作：

1、開機

按下“測量”鍵，儀器開機自檢並自動測量顯示溫度值。

2、液晶顯示

紅外線測溫儀開機後，螢幕上顯示詳細功能說明符號。(如圖2)

3、測量

將探頭對準目標，按下“測量”鍵進行單次測量，或按住“測量”鍵進行連續測量。(註：進行測量時，按住“測量”鍵時間不能少於約 0.5 秒)。

4、關機

開機後，如超過15秒未操作紅外線測溫儀，儀器將自動關機。

5、鐳射指示

測量時開啟鐳射，儀器照射出多點鐳射，多點鐳射顯示的區域作為被測量區域範圍參考（但不能等同於被測量區域）。

外觀介紹：

- 1.顯示螢幕
- 2.鐳射開關/up 鍵
- 3.MAX/EMS 功能鍵
- 4.°C/°F/Down 鍵
- 5.測量鍵
- 6.電池倉蓋
- 7.鐳射孔
- 8.溫度傳感器

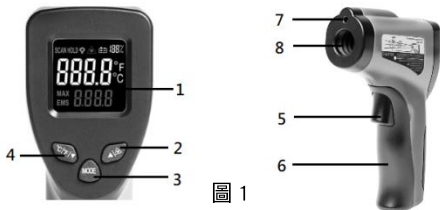


圖 1

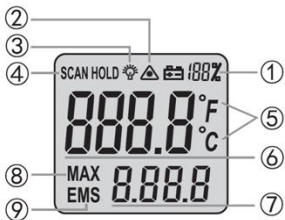


圖 2

螢幕顯示：

1. 電池剩餘電量顯示
2. 鐳射開啟狀態指示
3. 背光指示 (不可關閉)
4. 掃描、保持鎖定
5. °C/°F 溫度單位
6. 測量溫度值
7. 最大值/發射率顯示
8. 最大值顯示狀態
9. 發射率可調狀態

主要功能指示：

- 1、電池剩餘電量顯示，當剩餘電量低於 10%時，請及時更換電池
- 2、鐳射開啟狀態
- 3、SCAN 顯示：測量進行中。
- 4、HOLD 顯示：測量溫度值鎖定保持狀態。
- 5、MAX 顯示：顯示本次測量過程中的溫度最大值。
- 7、EMS 顯示：顯示當前發射率，可進行發射率調整模式

按鍵操作功能說明(如圖 1)

- 1) 開機後，按4號鍵(°C/°F 轉換鍵)，溫度單位轉換(攝氏與華氏)
- 2) 開機後，按2號鍵(鐳射開關鍵)，鐳射開關轉換
- 3) 開機後按3號鍵(功能鍵)，進入發射率調整介面，按2、4號鍵進行調節

四、規格

溫度測試範圍	-50-550°C (-58-1022°F)
測量精度	≤100°C ±2°C，>100°C ±2%
單位	°C / °F 切換
分辨率	0.1°C (0.1°F)
測試回應時間	≤0.5 秒
發射率	可調 (0.1-1.0)
距離系數比	12:1
鐳射等級	Class II < 1mW
儲存溫度	-20 to 50°C(-4-122°F)
操作溫度	0 to 50°C(32-122°F)
操作濕度	10-95%RH (無凝結)
電源	9V 電池

五、發射率

大多數有機材料和塗有油漆或氧化的表面具有 0.1 - 1.0 的發射率，測溫儀中發射率為 0.1 - 1.0 可調，測量光亮或拋光的金屬表面將導致讀數不準。解決方法是用黑膠帶或黑色油漆蓋住測試表面，當膠帶達到與覆蓋材料相同的度後，測量膠帶或油漆的表面溫度

****注意**** 不要測試光亮的金屬表面(如不鏽鋼或鋁)，本產品無法隔著玻璃測試，測試到的溫度為玻璃表面的溫度，蒸氣、煙霧，灰塵會影響測量的精準度。

六、距離系數比

測量目標越遠，測試的範圍越大，距離與測量範圍的比值常用 D:S 來表示。當測量距離為 36cm 時，測量範圍的直徑為 3.0cm，測溫槍量測的是量測範圍的平均溫度。(如圖 3)

****注意****：測量時開啟鐳射瞄準，儀器照射出多點鐳射光，多點鐳射光顯示的區域作為被測量區域範圍參考(但不能等同於被測量區域)。

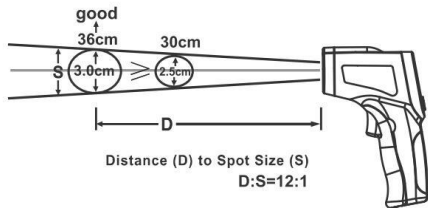


圖 3

七、保養

鏡頭清洗方法：

使用乾淨的壓縮空氣或吹塵球吹掉鬆散的顆粒，再用柔軟毛刷輕輕地去除殘留碎屑後，用沾濕的棉花球小心擦拭。注意！不可使用溶劑清洗鏡頭。

外殼清洗方法：

用沾有肥皂水的軟布擦拭，不可將產品浸泡水中。

八、安全須知

！警告：為避免對人體造成傷害，請嚴守下列指示

1. 請勿將鐳射直接對準人的眼睛或是從反射面間按照射眼睛
2. 使用前請先檢查機殼是否完整，請勿使用損壞的產品
3. 電池剩餘電量低於 10% 時，請立刻更換電池；長時間不用，請取出電池，以免電池漏液，造成儀器損壞
4. 若產品異常請勿使用，產品的保護功能可能已經損壞，若有疑問應將產品送修

5. 請勿在有爆炸氣體、蒸氣或灰塵的地方使用
6. 為避免灼傷，請記得發射率高的物體上所測得的溫度要低於實際溫度
7. 若未按照本說明書規定使用，產品提供的保護功能可能會失效
8. 為避免損害測溫儀或被測之設備，請保護它們免受以下影響：
 - 弧焊機或感應式加熱器等產生電磁場。
 - 熱衝擊(如環境溫度發生較大變化或突然有較大改變，在使用前要等待 2 0 ~ 3 0 分鐘使測溫儀達到穩定狀態)。
 - 請勿將測溫儀靠近或放在高溫物體上。

常見名稱物體發射率對照表					
材料	規格	發射率	材料	規格	發射率
鋁	氧化	0.3	石灰		0.98
	拋光	0.02-0.04	油漆		0.93
黃銅	氧化	0.5	人體皮膚		0.98
	拋光	0.02-0.05	石墨	氧化	0.20-0.60
黃金		0.01-0.10	橡膠		0.95
鐵	氧化	0.7	塑膠		0.85-0.95
鋼	氧化	0.70-0.90	混凝土		0.95
石棉		0.95	水泥		0.96
石膏		0.80-0.90	土壤		0.90-0.98
瀝青		0.95	灰泥		0.89-0.91
岩石		0.7	磚		0.90-0.96
木材		0.90-0.95	大理石		0.94
木炭	粉末	0.96	紡織品		0.95
碳		0.85	紙		0.95
漆器	無光澤	0.97	沙子		0.90
碳膠		0.90	泥土		0.92-0.96
肥皂泡		0.75-0.80	玻璃		0.85-0.92
水		0.93	熱食物		0.95
雪		0.83-0.90	油		0.94
冰		0.96-0.98	鋼鐵		0.80
冷凍食品		0.95	羊毛	自然的	0.94
陶瓷		0.95	鉛	氧化	0.5

Pro'sKit[®] MT-4606 红外线测温枪使用说明书

一、概述

红外线测温仪采用非接触红外线传感技术对目标进行安全、准确、快速、可靠的测量。广泛适用于测量机械、化工、陶瓷、轻工、食品、冶金、电力、热处理等行业高温、危险及难以接近物体表面的温度。

二、工作原理

任何温度大于绝对零度的物体都会辐射红外能量，此能量以光速向四周传输。红外线测温仪的透镜收集并汇集红外能量到传感器上，传感器产生一个低电压输出，此电压与目标物体的温度成正比，电压输出经过处理后显示为温度值。


三、操作说明

测温仪基本外观由几个部分组成，使用时请按以下说明进行操作：

1. **开机**：按下“测量”键，仪器开机自检并自动测量显示温度值。
2. **液晶显示**：仪器开机后，屏幕上显示详细功能说明符号（如图2）。
3. **测量**：将探头对准目标，按下“测量”键进行单次测量，或按住“测量”键进行连续测量。（注：进行测量时，按住“测量”键时间不能少于0.5秒。）
4. **关机**：开机后，如超过15秒未操作红外线测温仪，仪器将自动关机。
5. **激光开启**：测量时开启激光瞄准，仪器照射出多点激光，多点激光显示的区域作为被测量区域范围参考（但不能等同于被测量区域）。

外观介绍：

1. 显示屏幕
2. 激光开关/up 键
3. MAX/EMS 功能键
4. °C/°F/Down 键
5. 测量按键
6. 电池仓盖
7. 激光灯孔
8. 温度传感器

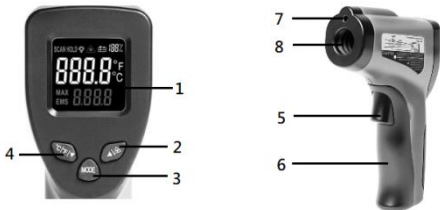

屏幕显示：

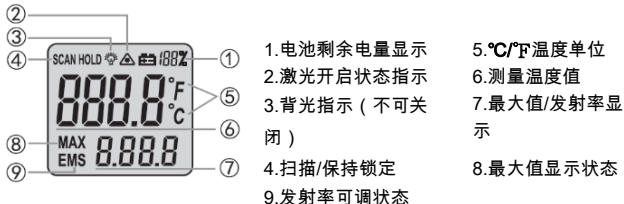


图 2

主要功能指示

1. 电池剩余电量显示，当剩余电量低于 10%时，请及时更换电池。
2. 激光开启状态。
3. SCAN 显示：测量进行中。
4. HOLD 显示：测量温度值锁定保持状态。
5. MAX 显示：显示本次测量过程中的温度最大值。
6. EMS 显示：显示当前发射率，可进行发射率调整模式。

按键功能说明(如图 1)

1. 开机后，按4号键(°C/°F转换键)，温度单位转换(摄氏与华氏)。
2. 开机后，按2号键(激光开关键)，激光开关转换。
3. 开机后按3号键(Mode键),进入发射率调整,按2、4号键进行调节。

四、规格

温度测试范围	-50~550°C (-58~1022°F)
测量精度	≤100°C ±2°C, >100°C ±2%
单位	°C / °F切换
分辨率	0.1°C (0.1°F)
测试响应时间	≤0.5 秒
发射率	可调 (0.1~1.0)
距离系数比	12:1
激光等级	Class II < 1mW
储存温度	-20 to 50°C(-4~122°F)
操作温度	0 to 50°C(32~122°F)
操作湿度	10~95%RH (无凝结)
电源	9V 电池

五、发射率

大多数有机材料和涂有油漆或氧化的表面具有 0.1 - 1.0 的发射率，测温仪中发射率为 0.1 - 1.0 可调，测量光亮或抛光的金属表面将导致读数不准。解决方法是用黑胶带或黑色油漆盖住测试表面，当胶带达到与覆盖材料相同的温度后，测量胶带或油漆的表面温度

****注意****

不要测试光亮的金属表面(如不锈钢或铝)，本产品无法隔着玻璃测试，测试到的温度为玻璃表面的温度，蒸气、烟雾，灰尘会影响测量的精度。

六、距离系数比

测量目标越远，测试的范围越大，距离与测量范围的比值常用 D:S 来表示。当测量距离为 36cm 时，测量范围的直径为 3.0cm，测温枪测量的是测量范围的平均温度。(如图 3)

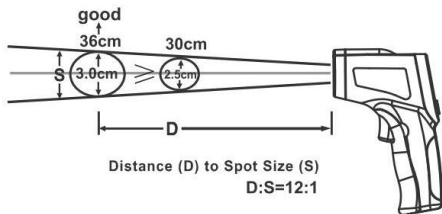


图 3

****注意****：测量时开启激光瞄准，仪器照射出多点激光，多点激光显示的区域作为被测量区域范围参考(但不能等同于被测量区域)。

七、保养

镜头清洗方法：

使用干净的压缩空气或吹尘球吹掉松散的颗粒，再用柔软毛刷轻轻地去去除残留碎屑后，用沾湿的棉花球小心擦拭。注意！不可使用溶剂清洗镜头。

外壳清洗方法：

用沾有肥皂水的软布擦拭，不可将产品浸泡水中。

八、安全须知

！警告：为避免对人体造成伤害，请严守下列指示

1. 请勿将激光直接对准人的眼睛或是从反射面间接照射眼睛
2. 使用前请先检查机壳是否完整，请勿使用损坏的产品
3. 电池剩余电量显示少于 10% 时，请立刻更换电池；如长时间不使用本产品，请取出电池，以免电池漏液造成仪器损坏
4. 若产品异常请勿使用，产品的保护功能可能已经损坏，若有疑问应将产品送

修

5. 请勿在有爆炸气体、蒸气或灰尘的地方使用
6. 为避免灼伤，请记得发射率高的物体上所测得的温度要低于实际温度
7. 若未按照本说明书规定使用，产品提供的保护功能可能会失效
8. 为避免损坏测温仪或被测之设备，请保护它们免受以下影响：
 - 弧焊机或感应式加热器等产生电磁磁场。
 - 热冲击(如环境温度发生较大变化或突然有较大改变，在使用前要等待 20 ~ 30 分钟使测温仪达到稳定状态)。
 - 请勿将测温仪靠近或放在高温物体上。

常见名称物体发射率对照表

材料	规格	发射率	材料	规格	发射率
铝	氧化	0.3	石灰		0.98
	抛光	0.02-0.04	油漆		0.93
黄铜	氧化	0.5	人体皮肤		0.98
	抛光	0.02-0.05	石墨	氧化	0.20-0.60
黄金		0.01-0.10	橡胶		0.95
铁	氧化	0.7	塑料		0.85-0.95
钢	氧化	0.70-0.90	混凝土		0.95
石棉		0.95	水泥		0.96
石膏		0.80-0.90	土壤		0.90-0.98
沥青		0.95	灰泥		0.89-0.91
岩石		0.7	砖		0.90-0.96
木材		0.90-0.95	大理石		0.94
木炭	粉末	0.96	纺织品		0.95
碳		0.85	纸		0.95
漆器	无光泽	0.97	沙子		0.90
碳胶		0.90	泥土		0.92-0.96
肥皂泡		0.75-0.80	玻璃		0.85-0.92
水		0.93	热食物		0.95
雪		0.83-0.90	油		0.94
冰		0.96-0.98	钢铁		0.80
冷冻食品		0.95	羊毛	自然的	0.94
陶瓷		0.95	铅	氧化	0.5

中国地区产品保固卡

购买日期		店章
公司名称		
联络电话		
电子邮箱		
联络地址		
产品型号	□ MT-4606-C	

- ※ 在正常使用情况下,自原购买日起 12 个月免费维修保证(不含耗材、消耗品)。
- ※ 产品保固卡需盖上店章、日期章,其保固效力始生效。
- ※ 本卡请妥善保存,如需维修服务时,请出示本卡证明。
- ※ 保固期满后,属调整、保养或是维修性质之服务,则酌收检修工时费用。若有零件需更换,则零件费另计。

产品保固说明

- ※ 保固期限内,如有下列情况者,维修中心则得酌收材料成本或修理费(由本公司维修人员判定):
 - 对产品表面的损伤,包括外壳裂缝或刮痕
 - 因误用、疏忽、不当安装或测量,未经授权打开产品修理,修改产品或者任何其它超出预期使用范围的原因所造成的损害
 - 因事故、火灾、电力变化、其它危害,或自然灾害所造成的损害。
- ※ 非服务保证内容:
 - 本体外之消耗品:如电池...等消耗品
 - 超过保证期限之检修或服务,虽未更换零件,将依公司保固维修政策酌收服务费。

制造商：宝工实业股份有限公司

地址：台湾新北市新店区民权路130巷7号5楼

电话：886-2-22183233

E-mail：pk@mail.prokits.com.tw

销售/生产商：上海宝工工具有限公司

地址：上海市浦东新区康桥东路1365弄25号

原产地：中国.上海

服务热线：021-68183050

Pro'sKit®

寶工實業股份有限公司
PROKIT'S INDUSTRIES CO., LTD.

<http://www.prokits.com.tw>

E-mail: pk@mail.prokits.com.tw



PROKIT'S INDUSTRIES CO., LTD.

<http://www.prokits.com.tw>

E-mail: pk@mail.prokits.com.tw

©2020 Copyright by Prokit's Industries Co., Ltd(C). All right reserved.

X-ON Electronics

Largest Supplier of Electrical and Electronic Components

Click to view similar products for [Digital Multimeters](#) category:

Click to view products by [Proskit](#) manufacturer:

Other Similar products are found below :

[2727795](#) [2727486](#) [6111-517](#) [FS881](#) [40705X](#) [3026976](#) [P 8100](#) [UT39C](#) [208107](#) [DM5](#) [DT-8807H](#) [DT-8806H](#) [DT-812](#) [DT-820V](#) [DT-811](#)
[DT-5505](#) [DT-8980D](#) [DT-660B](#) [DT-9810](#) [OW16B](#) [B33+](#) [OW18D](#) [OW18E](#) [NDM2041](#) [OW18B](#) [XDM1041-U](#) [XDM1041-R](#) [UT89XE](#)
[UT122](#) [58X](#) [MT-1508-C](#) [MT-1220-C](#) [MT-1225-C](#) [3021](#) [03026](#) [03032](#) [UT300A+](#) [UT123](#) [UT61D+](#) [UT117C](#) [UT39A+](#) [UT89XD](#) [UT15B](#)
[PRO](#) [UT58B](#) [UT139E](#) [VC9808+](#) [VICTOR 86E](#) [UT121A](#) [UT121B](#) [UT17B](#) [MAX](#)