

Pro'sKit®

MT-7601 Optical Power Meter

用户手册
USER'S GUIDE

English

繁體中文

简体中文

USER'S GUIDE
Optical Power Meter
MT-7601

Optical Power Meter

WARNING

You are cautioned that changes or modifications not expressly approved in this document could void your authority to operate this equipment.
To reduce the risk of fire or electric shock, do not expose this apparatus to rain or moisture.
To avoid electrical shock, do not open the cabinet. Refer servicing to qualified personnel only.

Precautions for Use

Use batteries

At the same time, can not use different style or different capacitance batteries. And only charge the rechargeable batteries.


Avoiding condensation problems

As much as possible, avoid sudden temperature changes. Do not attempt to use the drive immediately after moving it from a cold to a warm location, to raising the room temperature suddenly, as condensation may form with in the drive. If the temperature changes suddenly while using the drive, stop using it and take out batteries for at least an hour.

Storage

When long time no use, must take out the batteries to avoid destroying the device.

Description

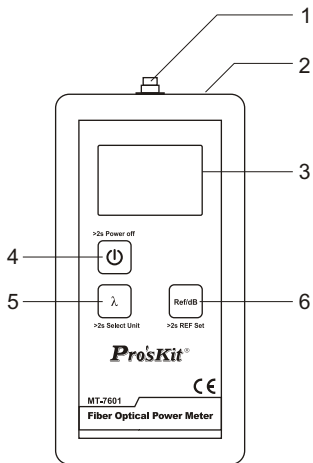

1 InGaAs detector

2 Charging Socket


3 LCD

4 Power Button

5 Wavelength/Unit Select Button

6 REF setting Button


Installing the battery

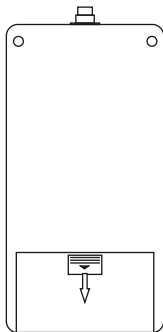

1.Pull the battery cover



2.Installing the battery

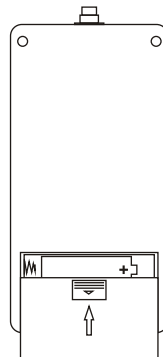

3.Push the battery cover




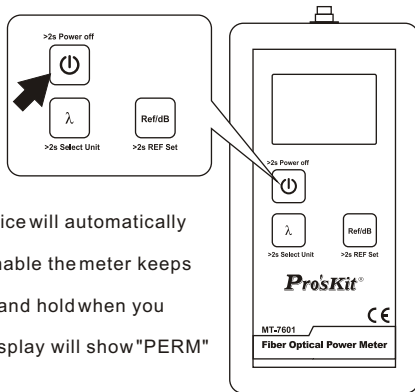
4.Complete

On/Off and Permanent On


Press “  ” button will turn on the meter.


Press button again for two seconds or more will turn off the meter.

This meter has a power-saving function, normal boot and ten minutes without any operation, the device will automatically shut down. If you need to shield this function and enable the meter keeps on working, only need to press the “  ” button and hold when you boot the instrument. After two seconds, the meter display will show "PERM" which means permanent power on.




Backlight Function

Under boot status, short press the “  ” button, you can control the backlight function on or off. The backlight function is used when you want to use the meter at night or darker occasions.

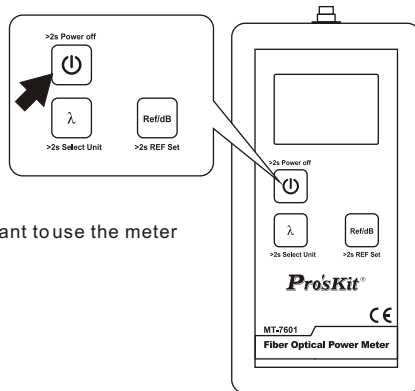

Wavelengths

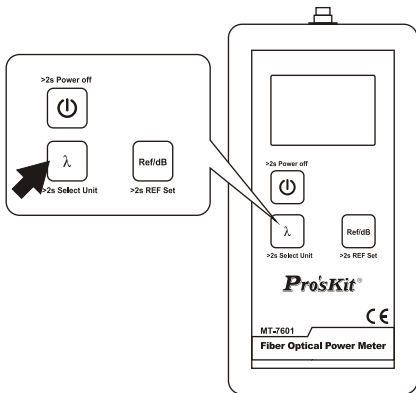


According to the project, we need to measure optical signals of different wavelengths. Then we need to select a corresponding wavelength to measure the optical power. If the wavelength needs to be measured does not match with the wavelength we select on the optical power meter, it will lead to the measuring values meaningless.

Press “ λ ” button after booting, the meter will switch to the measure status of a corresponding wavelength successively, and show on the display.

This series of optical power meter calibration measured wavelength are: 850nm, 1300nm, 1310nm, 1490nm, 1550nm, 1625nm.


Wavelengths

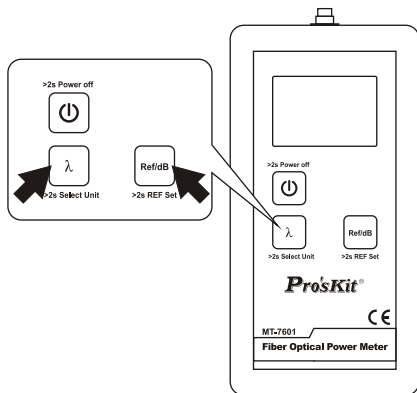

The instrument has been equipped with activated wavelength identification function by the factory, and users can manually turn on or off this function. In the boot mode, please press the combination key " λ " and "RefdB", if the center of the screen shows NO, which means the wavelength identification function has been turned off; but if the center of the screen shows EN, which means it turned on. When the wavelength identification function starts, and connects with laser source which has wavelength identification function, the optical power meter can identify the current output wavelength and automatically switch to the wavelength to measure.

Unit


“ λ ” button can be used to change the display unit of the measurement data to meet the different requirement. When press and hold this button for two seconds, the display will successively show the dBm value and mW/uW value .

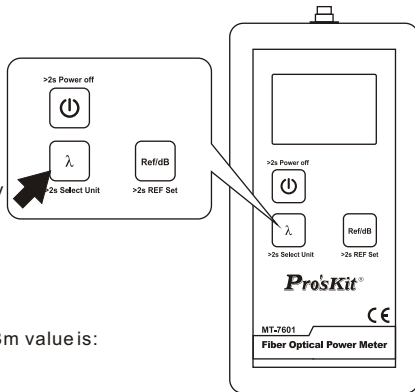

The numeric relationship between mW value and dBm value is:

$$10\lg(\text{mW})=(\text{dBm})$$


Reference

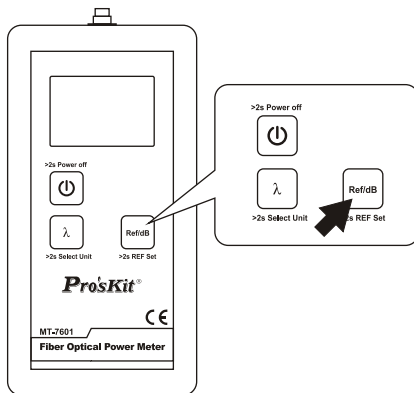

“ **Ref/dB** ” Button is used to set or check the reference value. Shortpress this button, the display will show 'REF' and the dBm value which has been set up. When long press for two seconds or more, the device will use the current measurements to overwrite the original setting value and set it as a new preference value. Meanwhile the 'REF' sign will flash three times on the display. After that will show the difference(dB).

(Each wavelength can set their own reference value)

Power Indicator

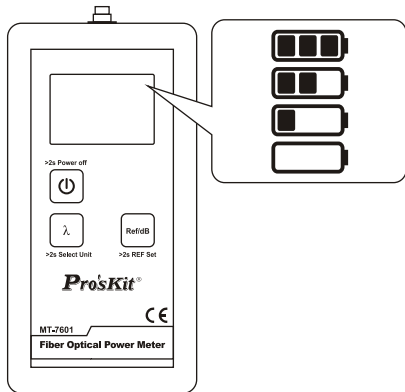

Four levels indication of power detection



Represents the remaining 80%---100% electricity




Represents the remaining 40%---80% electricity



Represents the remaining 20%---40% electricity



Represents the remaining electricity less than 20%

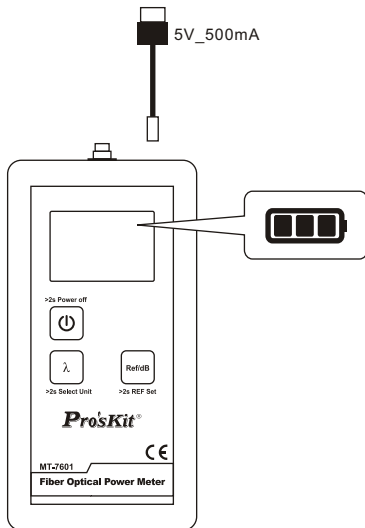

Charge

The instrument has a charging function. When use rechargeable batteries and a low battery indication shows on the instrument, you should promptly shut down it and recharge. Long time undervoltage will shorten the lifetime of the rechargeable battery.

Connect the AC adapter to the device correctly, it can charge automatically. Besides, computer USB port can also be used for charging. The battery remaining indicator keeps flashing during charging. It will stop when the charging is finished. The battery has finished the fast recharge and can be used directly. If you do not stop recharging at this time, the instrument will continue the trickle charge state, using small current to supply natural discharge. But this process is not more than 48 hours.

The instrument can still be used while charging. But do not plug in the AC adapter when it is not rechargeable battery inside, or it will cause a high temperature and combustion, even explosion.

Meter Maintenance

General maintenance

Optical fiber connect the adapter should avoid contacting with hard objects and keep clean.

Should be stored in a dry and ventilated place to avoid moisture.

When un use for long time, should remove the batteries before storage.

Fault and solution

| Failure name | Failure Cause | Solution |
|---|--|---|
| Cannot boot | Check the battery has power or not | Check the batteries are installed correctly |
| Immediately shutdown after booting | Check the battery has power or not | Replace or recharge the batteries |
| Can display, but all operations are valid | The instrument program is disordered | Reboot |
| Cannot charge | Using did not use rechargeable batteries | Reinstall the rechargeable batteries |
| Garbled | Incorrect reset | Reboot |

Detail Parameters

| | |
|------------------------|--|
| | MT-7601 |
| Measurement Range | +6~-70dBm |
| Wavelength cal. | 850nm,1300nm,1310nm,1490nm,1550nm,1625nm |
| Resolution | +6~-60dBm(0.01dB), -60~-70dBm(0.1dB) |
| Accuracy | (1550nm,1310nm)±0.2dB/(1490nm,1625nm)±0.3dB/(850nm,1300nm)±0.4dB * |
| Linearity | ±2% |
| Detector type | InGaAs |
| Fiber optic adapter | FC/SC/ST & 2.5mm Universal |
| Application fiber type | 9/125 μm~62.5/125 μm |
| Power Display Units | dBm,mW,uW |
| Response range | 700~1700nm |
| Freq. Identification | 270Hz/1KHz/2KHz(Optic power>-30dBm) |
| Ref | Yes |
| Battery Type | AA/LR6 1.5Vx2 pcs |
| Battery lifetime | >100H |
| Key tone | Yes |
| Backlight | Yes |
| Automatic power off | 10 min.(Can be cancelled) |
| Waterproof | Can prevent small splash |
| Operate temp. | -10℃~+60℃ |
| Storage temp. | -20℃~+70℃ |
| Relative humidity | <90% No dew |
| Size | 165mm*80mm*35mm |
| Weight | 180g(W/O battery) |

Test conditions: -10dBm@1550nm ± 2 degrees Celsius, 40%~60% humidity using standard test fiber
 * +10~+5 dBm and -62~-70dBm measurement data for reference

用户手册

光功率計

Optical Power Meter

MT-7601

光功率計

警告

進行任何本手冊未明確允許的改變或改裝將使您喪失操作本設備的權利。

要減少火災或電擊的危險,切勿將此設備暴露在雨中或潮濕的環境中。

為防止觸電,請不要打開外殼,必須由有資格的人員進行維修。

使用注意事項

使用電池

本設備可以使用一次性鹼性電池或可充電電池,不能混用不同型號或不同容量的電池。祇可對可充電電池進行充電。


避免結露

應盡可能避免溫度的突然變化。將設備從冷的地方搬移到熱的地方後,或房間內突然升溫後,不要立即使用,因為設備內可能結露。使用設備時如果溫度突然變化,立即停止使用,並取出電池,待至少一小時後才可接通電源。

存放


當設備長期存放而不使用時,應將電池取出存放,避免電池漏液造成設備損壞。

描述

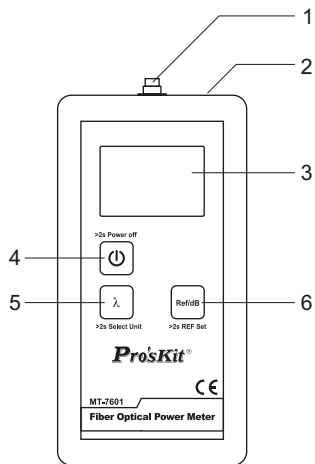


- 1 光功率探測器
- 2 充電插座孔
- 3 液晶顯示窗口
- 4 電源開關鍵
- 5 波長切換鍵,單位選擇鍵
- 6 參考值設定鍵


安裝電池

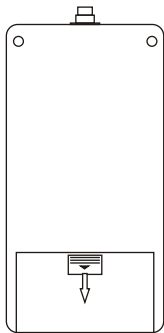


1.向下滑出電池蓋

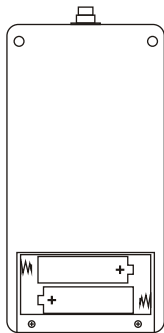

2.按要求正確放置電池

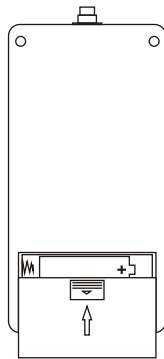

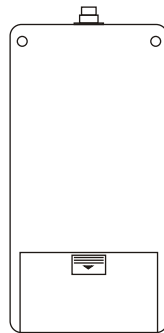

3.向上滑上電池蓋




4.電池安裝完畢


開機，省電功能


按下 “” 鍵後儀表將開啓。再次按下此鍵兩秒以上儀表關閉。

本儀表具有省電功能，正常開機後沒有任何操作十分鐘左右，設備將自動關閉。如果需要屏蔽此功能使儀表一直保持在工作狀態，祇需要在開機時按住 “” 鍵不放，兩秒後儀表顯示屏右下方會顯示 “PERM” 表示永久開機。

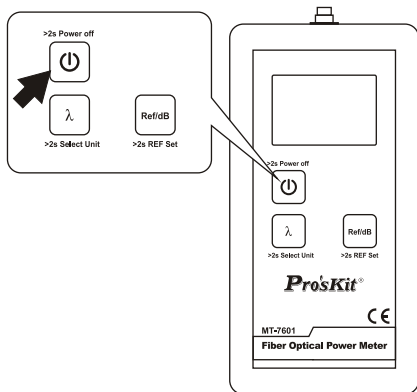


背光及可視故障探測儀控制

開機狀態下，短按“”鍵，可控制背光的開或者關，背光用以在夜間或者較暗的場合使用儀表。

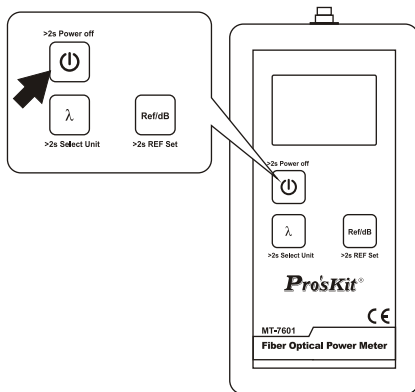

測量波長

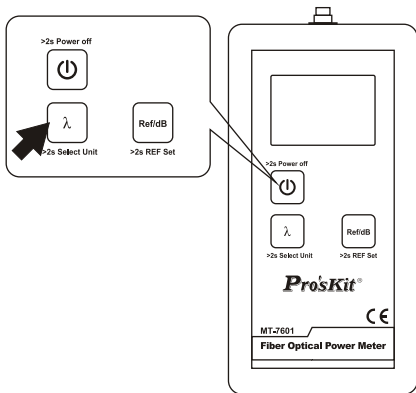


根據工程的需要,我們需要測量不同波長的光信號,此時需要選擇對應波長來測量光功率,如果被測光波長和光功率計選擇的波長不符,將導致測量值無意義。

儀表開啓後按“ λ ”鍵,光功率計將依次切换到對應波長的測量狀態,并在顯示屏上顯示出。

本系列的光功率計標定測量波長為:

850nm,1300nm,1310nm,1490nm,1550nm,1625nm。

開啓/關閉波長識別

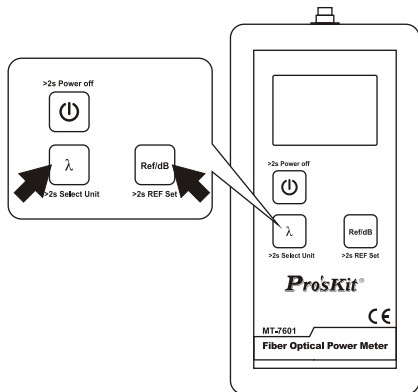

對於出廠已選配激活波長識別功能的儀表，用戶可手動開啓或關閉波長識別功能。在開機狀態下，長按組合鍵“ λ ”與“Ref/dB”時，屏幕中央顯示NO，代表已關閉波長識別功能；屏幕中央顯示EN，代表已開啓波長識別功能。

開啓波長識別功能時，和配套帶有波長識別功能的光源鏈接，光功率計可得知光源當前輸出波長，并自動切換到該波長進行測量。

顯示單位

“ λ ” 鍵可用于改變測量數據的顯示

>2s Select Unit


單位，來適應不同的需要。每當按住此鍵兩秒，
將依次輪循顯示dBm值、mW/uW值。

dBm 表示測得實際功率的對數值。


mW/uW 表示測得實際功率的絕對值。

1mW=1000uW, 1uW=1000nW

mW值與dBm值之間的關係是 $10 \lg(mW) = (dBm)$

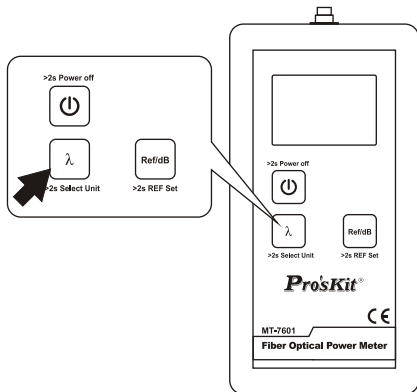

參考測量

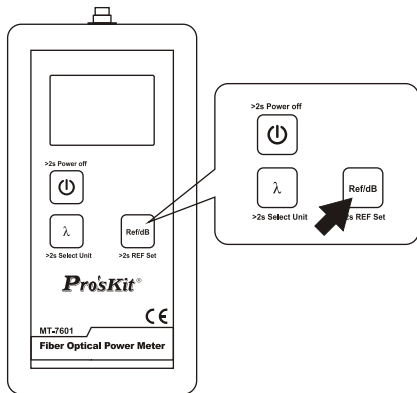


參考值的設定一般用于測量實際綫路前，預先去除了不計算在實際綫路損耗中的衰減值，或用于比對與設定標準功率的差異。

“ RefidB ” 鍵用于設定或查看參考值。短按此鍵屏幕將顯示“REF”和所設定的dBm值。當長按此鍵達2秒或以上時，設備會將當前測量值覆蓋原來的設定值，并作為新的參考值。同時“REF”標志將在顯示屏上閃爍三次，之後將顯示實際測量的相對差值（dB）。

(每個波長都可以設定自己的參考值)

電量指示

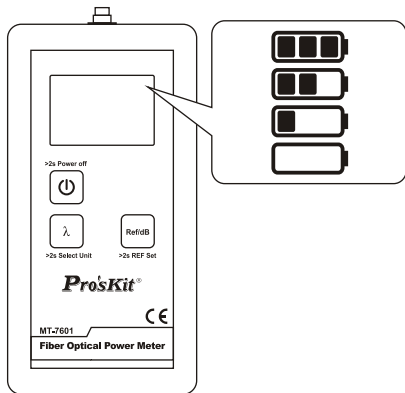


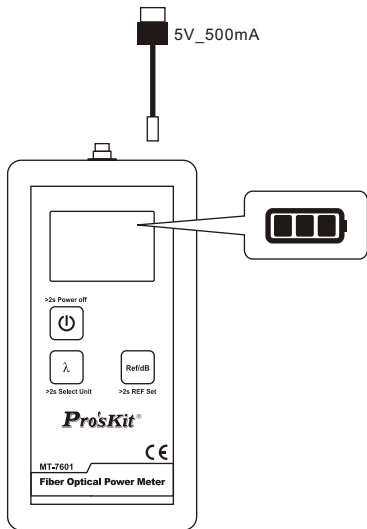
電量檢測有四級指示

 表示剩餘80%----100%的電量

 表示剩餘40%----80%的電量

 表示剩餘20%----40%的電量

 表示剩餘的電量不足20%



充電

本儀表具有充電功能, 當您使用可充電電池且儀表上指示電量不足時, 應及時關機并進行充電。長時間欠壓將會導致充電電池的壽命縮短。

充電祇要將交流適配器正確的連接到設備上就可以自動進行, 也可採用電腦USB接口進行充電。充電時電池餘量指示會閃爍, 當充電結束後, 電池餘量指示停止閃爍。此時, 電池已經結束快速充電, 可以直接使用。若此時不停止充電, 設備將繼續進入涓流充電狀態, 以小電流補充自然放電的電量, 但不宜超過48小時。

充電時仍可使用儀表, 切勿在不使用充電電池時插入交流適配器, 這將導致設備溫度升高而燃燒, 甚至爆炸。

儀表維護

一般維護

光纖連接適配器應避免與硬物接觸，并保持清潔。

存放時因通風乾燥，避免受潮。

長期不使用時，應取出電池後存放。

用戶可處理的故障

| 故障名 | 故障原因 | 處理辦法 |
|-----------|----------|-----------|
| 不能開機 | 檢查電池是否有電 | 檢查電池是否安裝好 |
| 開機後馬上關機 | 檢查電池是否有電 | 更換電池或充電 |
| 有顯示，操作均無效 | 設備程序紊亂 | 重新開機 |
| 不能充電 | 沒有使用充電電池 | 重新安裝充電電池 |
| 顯示亂碼 | 復位不正確 | 重新開機 |

詳細參數

| | |
|--------|--|
| | MT-7601 |
| 測量範圍 | +6~-70dBm |
| 校準波長 | 850nm,1300nm,1310nm,1490nm,1550nm,1625nm |
| 分辨率 | +6~-60dBm(0.01dB), -60~-70dBm(0.1dB) |
| 精確度 | (1550nm,1310nm)±0.2dB/(1490nm,1625nm)±0.3dB/(850nm,1300nm)±0.4dB * |
| 綫性度 | ±2% |
| 探測器類型 | InGaAs |
| 光纖適配器 | FC/SC/ST & 2.5mm 通用 |
| 適用光纖 | 9/125 μm~62.5/125 μm |
| 功率顯示單位 | dBm, mW, uW |
| 波長響應範圍 | 700~1700nm |
| 自動頻率識別 | 270Hz/1KHz/2KHz(光功率>-30dBm) |
| 比較參考值 | 有 |
| 電池類型 | AA/LR6 1.5Vx2 pcs |
| 電池壽命 | >100H |
| 操作提示音 | 有 |
| 背光功能 | 有 |
| 自動關機 | 10min.(可取消) |
| 防水 | 可防少量潑濺 |
| 使用溫度 | -10°C~+60°C |
| 存儲溫度 | -20°C~+70°C |
| 相對濕度 | <90%不結露 |
| 外觀 | 165mm*80mm*35mm |
| 重量 | 180g(不含電池) |

測試條件: -10dBm@1550nm 23±2攝氏度, 40%~60%濕度, 使用標準測試線

* +10~+5 dBm和-62~-70 dBm測量數據僅供參考

用户手册

光功率计

Optical Power Meter

MT-7601

光功率计

警告

进行任何本手册未明确允许的改变或改装将使您丧失操作本设备的权利。

要减少火灾或电击的危险,切勿将此设备暴露在雨中或潮湿的环境中。

为防止触电,请不要打开外壳,必须由有资格的人员进行维修。



警告! 为降低伤害风险, 用户必须阅读使用手册。

使用注意事项

使用电池

本设备可以使用一次性碱性电池或可充电电池, 不能混用不同型号或不同容量的电池。只可对可充电电池进行充电。


避免结露

应尽可能避免温度的突然变化。将设备从冷的地方搬移到热的地方后, 或房间内突然升温后, 不要立即使用, 因为设备内可能结露。使用设备时如果温度突然变化, 立即停止使用, 并取出电池, 待至少一小时后才可接通电源。

存放

当设备长期存放而不使用时, 应将电池取出存放, 避免电池漏液造成设备损坏。

描述

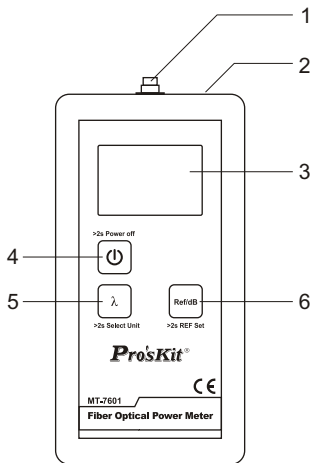

1 光功率探测器

2 充电插座孔


3 液晶显示窗口

4 电源开关键


5 波长切换键,单位选择键

6 参考值设定键


安装电池

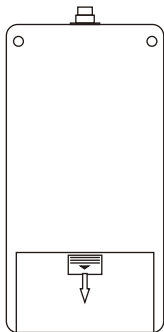

1. 向下滑出电池盖

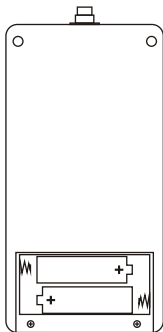

2. 按要求正确放置电池

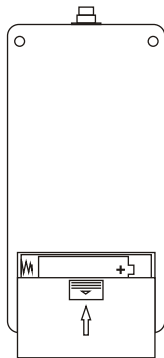



3. 向上滑上电池盖




4. 电池安装完毕


开机，省电功能


按下 “” 键后仪表将开启。再次按下此键两秒以上仪表关闭。

本仪表具有省电功能，正常开机后没有任何操作十分钟左右，设备将自动关闭。如果需要屏蔽此功能使仪表一直保持在工作状态，只需要在开机时按住 “” 键不放，两秒后仪表显示屏右下方会显示 “PERM” 表示永久开机。

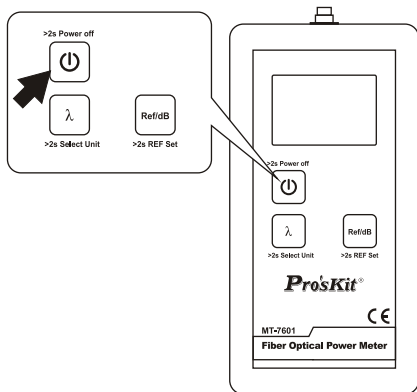


背光及可视故障探测仪控制

开机状态下，短按“”键，可控制背光的开或者关，背光用以在夜间或者较暗的场合使用仪表。

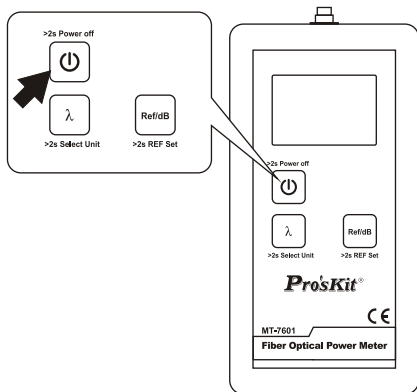

测量波长

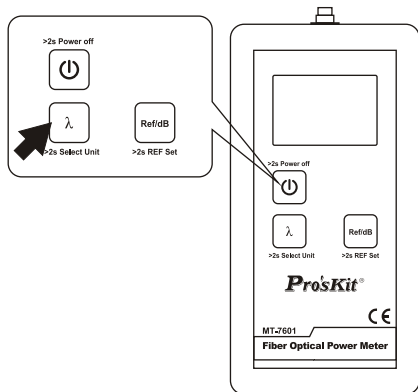


根据工程的需要,我们需要测量不同波长的光信号,此时需要选择对应波长来测量光功率,如果被测光波长和光功率计选择的波长不符,将导致测量值无意义。

仪表开启后按“ λ ”键,光功率计将依次切换到对应波长的测量状态,并在显示屏上显示出。

本系列的光功率计标定测量波长为:
850nm,1300nm,1310nm,1490nm,1550nm,1625nm。

开启/关闭波长识别

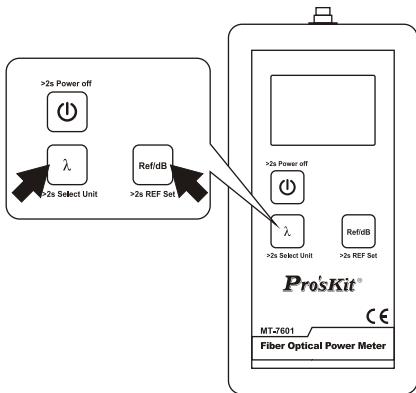

对于出厂已选配激活波长识别功能的仪表，用户可手动开启或关闭波长识别功能。在开机状态下，长按组合键“λ”与“Ref/dB”时，屏幕中央显示NO，代表已关闭波长识别功能；屏幕中央显示EN，代表已开启波长识别功能。

开启波长识别功能时，和配套带有波长识别功能的光源链接，光功率计可得知光源当前输出波长，并自动切换到该波长进行测量。

显示单位


“ λ ”键可用于改变测量数据的显示单位，来适应不同的需要。每当按住此键两秒，将依次轮循显示dBm值、mW/uW值。

dBm 表示测得实际功率的对数值。


mW/uW 表示测得实际功率的绝对值。

1mW=1000uW, 1uW=1000nW

mW值与dBm值之间的关系是 $10 \lg(mW)=(dBm)$

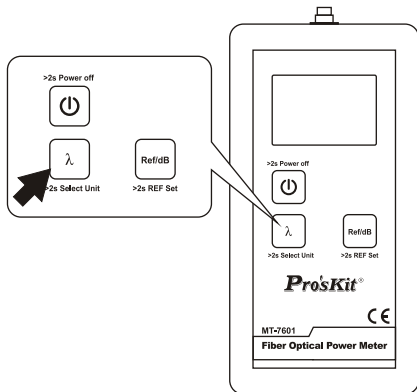

参考测量

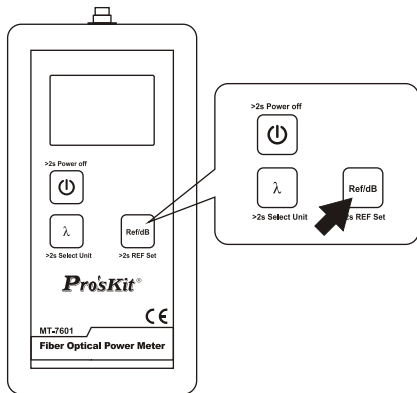


参考值的设定一般用于测量实际线路前，预先去除不计算在实际线路损耗中的衰减值，或用于比对与设定标准功率的差异。

“**RefdB**”键用于设定或查看参考值。短按此键屏幕将显示“REF”和所设定的dBm值。当长按此键达2秒或以上时，设备会将当前测量值覆盖原来的设定值，并作为新的参考值。同时“REF”标志将在显示屏上闪烁三次，之后将显示实际测量的相对差值（dB）。


（每个波长都可以设定自己的参考值）


电量指示

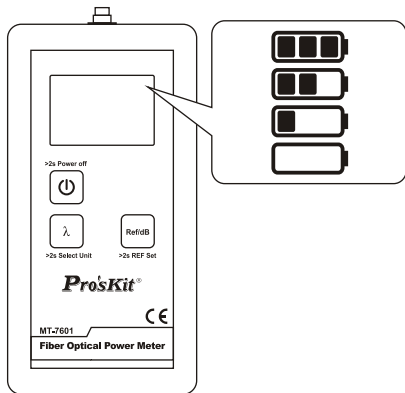


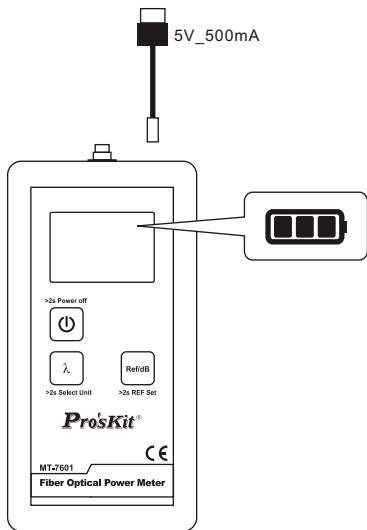
电量检测有四级指示

 表示剩余80%---100%的电量

 表示剩余40%---80%的电量

 表示剩余20%---40%的电量

 表示剩余的电量不足20%



充电

本仪表具有充电功能,当您使用可充电电池且仪表上指示电量不足时,应及时关机并进行充电。长时间欠压将会导致充电电池的寿命缩短。

充电只要将交流适配器正确的连接到设备上就可以自动进行,也可采用电脑USB接口进行充电。充电时电池余量指示会闪烁,当充电结束后,电池余量指示停止闪烁。此时,电池已经结束快速充电,可以直接使用。若此时不停止充电,设备将继续进入涓流充电状态,以小电流补充自然放电的电量,但不宜超过48小时。

充电时仍可使用仪表,切勿在不使用充电电池时插入交流适配器,这将导致设备温度升高而燃烧,甚至爆炸。

仪表维护

一般维护

光纤连接适配器应避免与硬物接触，并保持清洁。

存放时因通风干燥，避免受潮。

长期不使用时，应取出电池后存放。

用户可处理的故障

| 故障名 | 故障原因 | 处理办法 |
|-----------|----------|-----------|
| 不能开机 | 检查电池是否有电 | 检查电池是否安装好 |
| 开机后马上关机 | 检查电池是否有电 | 更换电池或充电 |
| 有显示，操作均无效 | 设备程序紊乱 | 重新开机 |
| 不能充电 | 没有使用充电电池 | 重新安装充电电池 |
| 显示乱码 | 复位不正确 | 重新开机 |

详细参数

| | |
|--------|--|
| | MT-7601 |
| 测量范围 | +6~-70dBm |
| 校准波长 | 850nm,1300nm,1310nm,1490nm,1550nm,1625nm |
| 分辨率 | +6~-60dBm(0.01dB), -60~-70dBm(0.1dB) |
| 精确度 | (1550nm,1310nm)±0.2dB/(1490nm,1625nm)±0.3dB/(850nm,1300nm)±0.4dB * |
| 线性度 | ±2% |
| 探测器类型 | InGaAs |
| 光纤适配器 | FC/SC/ST & 2.5mm 通用 |
| 适用光纤 | 9/125 μm~62.5/125 μm |
| 功率显示单位 | dBm, mW, uW |
| 波长响应范围 | 700~1700nm |
| 自动频率识别 | 270Hz/1KHz/2KHz(光功率>-30dBm) |
| 比较参考值 | 有 |
| 电池类型 | AA/LR6 1.5Vx2 pcs |
| 电池寿命 | >100H |
| 操作提示音 | 有 |
| 背光功能 | 有 |
| 自动关机 | 10min.(可取消) |
| 防水 | 可防少量泼溅 |
| 使用温度 | -10℃~+60℃ |
| 存储温度 | -20℃~+70℃ |
| 相对湿度 | <90%不结露 |
| 外观 | 165mm*80mm*35mm |
| 重量 | 180g(不含电池) |

测试条件: -10dBm@1550nm 23±2摄氏度, 40%~60%湿度, 使用标准测试纤
* +10~+5 dBm和-62~-70 dBm测量数据供参考

产品保固卡

| | | |
|------|---------|----|
| 购买日期 | | 店章 |
| 公司名称 | | |
| 联络电话 | | |
| 电子邮箱 | | |
| 联络地址 | | |
| 产品型号 | MT-7601 | |

※在正常使用情况下，自原购买日起主机保修一年(不含配件、易耗品)。

※产品保固卡需盖上店章、日期章并填写产品序号，其保固效力始生效。

※本卡请妥善保存，如需维修服务时，请同时出示本保固卡，如无法出示，视为自动放弃。

※我司产品实行计算机编码，它将作为我司产品保固的依据，每抬产品均有独立的编码，为了您能得到最好的服务，请勿损坏撕毁该编码。

※保固期满后，如需维修之性质，则酌收检修工时费用。若有零件需更换，则零件费另计。

保修说明

一、保固期限内，如发生下列情况，本公司需依实际状况酌收材料成本或修理费(由本公司维修人员判定)：

- 产品表面的损伤，包括外壳的破裂或刮痕。
- 因误用、疏忽、不当安装或测试，未经授权私自打开产品修理，修改产品或者任何其它超出预期使用范围的原因所造成的损害。

- 因意外因素或人为因素(包括搬运、挤压、碰撞、高温、输入不合适电压、腐蚀等不可抗力因素)导致的故障或损坏。
- 因使用非宝工导致的故障及损坏。

二、非服务保证内容

- 本机主体外之配件：如接头、面板、护套、包包等配件。
- 任何因自然磨损、超负荷工作而引起的损坏。

三、超过保固期限仍需检修，虽未更换零件，将依本公司保固条款酌收工时服务费用。

制造商：

宝工实业股份有限公司

销售/生产商：

上海宝工工具有限公司

上海市浦东新区康桥东路1365弄25号

服务热线：021-68183050

网址：www.prokits.com.tw

Pro'sKit®



寶工實業股份有限公司

PROKIT'S INDUSTRIES CO.,LTD

<https://www.prokits.com.tw>

Email: pk@mail.prokits.com.tw

2020 Prokit's Industries Co., LTD. All rights reserved 2020001

X-ON Electronics

Largest Supplier of Electrical and Electronic Components

Click to view similar products for [Proskit](#) manufacturer:

Other Similar products are found below :

[103-132D](#) [19400-M3](#) [19400-M3.5](#) [19400-M4](#) [19400-M4.5](#) [19400-M5](#) [1PK-201](#) [1PK-212](#) [1PK-3171](#) [1PK-317N](#) [1PK-390G](#) [203-132F](#) [203-132I](#) [22-10810](#) [22-10815](#) [22-10820](#) [22-11050](#) [22-11065](#) [22-11620](#) [22-11650](#) [22-14670](#) [22-21745](#) [22-3745](#) [22-3750](#) [22-3775](#) [22-3830](#) [22-3990](#) [22-8602](#) [22-8618](#) [22-9110](#) [22-9482](#) [5SI-129-40H](#) [5SI-129-60H](#) [5SS-331N1-H](#) [5SS-331N-PAD-B](#) [5SS-331N-PAD-W](#) [5SS-552-H](#) [5SS-553-H](#) [5SS-554-H](#) [5SS-988-NZ1](#) [5SS-988-NZ2](#) [5SS-988-NZ3](#) [72-8740](#) [89400-H1.5](#) [89400-H3](#) [8PK-022](#) [8PK-2062](#) [8PK-2063](#) [8PK-610](#) [8PK-H081](#)