

I N S T R U C T I O N S

PLEASE NOTE STEPS (4) & (5). IF THESE INSTRUCTIONS ARE NOT FOLLOWED THE DIE WILL BREAK. THERE IS NO WARRANTY PROVIDED FOR THIS MISUSE.

(1) MOUNT the adhesive backed template at the location you wish to make a connector installation. (Caution: be sure there will be sufficient clearance to use both punch & die at this spot.) Surface must be clean & dry so the template will adhere.




(2) CENTER PUNCH at the points marked "+" on the template. Drill the two outer holes with a 9/64 inch drill; drill the center hole with a 1/4 inch drill. It is wise to remove the template before the actual drilling.

(3) CLEAN and LUBRICATE the area to be punched. Any oil (or even vegetable shortening) will allow the punch to work easier.

(4) NOTE the template has tapered ends; so do the punch and die. When the punch & die are installed to make the hole they must be aligned properly with each other.

(5) INSERT these three draw screws into their holes on the punch, through the 3 holes you drilled in the panel and thread them into their tapped holes in the die. You will note there is a groove on the end of the punch; there is a corresponding mark on the end of the die. These marks must BOTH be on the same end, as shown in the sketch. If you install the Punch/Die wrong, the die will break and the punch will be distorted. THERE IS NO WARRANTY AGAINST BREAKAGE OR DISTORTION DUE TO SUCH MISUSE.

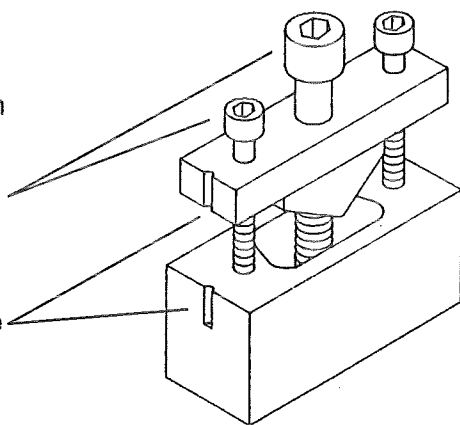



(6) AFTER properly aligning punch to die and snugging the 3 draw screws hand tight, use the large hex key to tighten the draw screws, alternately if necessary, and thus cut the hole. Most times the entire hole can be made by use of the center draw screw only and the screws on either side are used to correct any tilting of the punch as related to the die.

(7) REMOVE the 3 draw screws and die.

(8) REMOVE the punch from the panel. By gripping the punch with vise grip pliers in the center of the flange and applying slight up-and-down motion the punch should release. Do NOT pry the punch out with a screwdriver.

(9) REMOVE the slug. The slug is readily removed by threading the 2 ejector screws into the die.

(10) STORE the tool after applying a light oil coating.

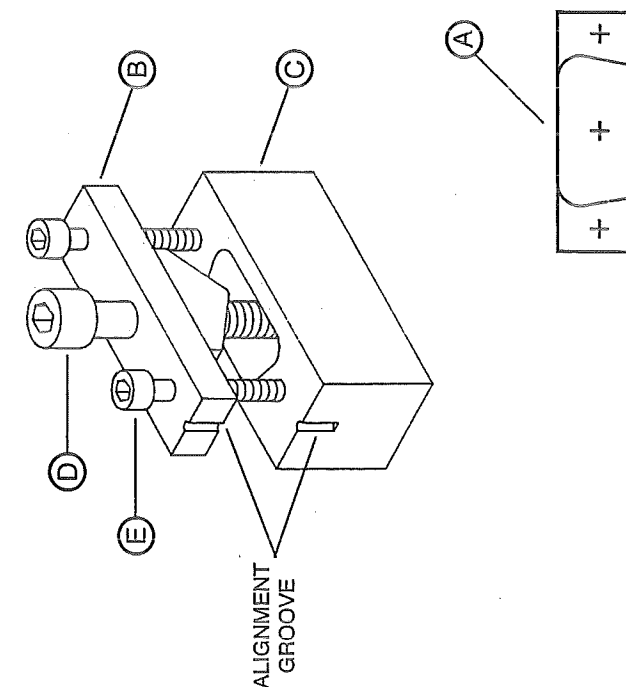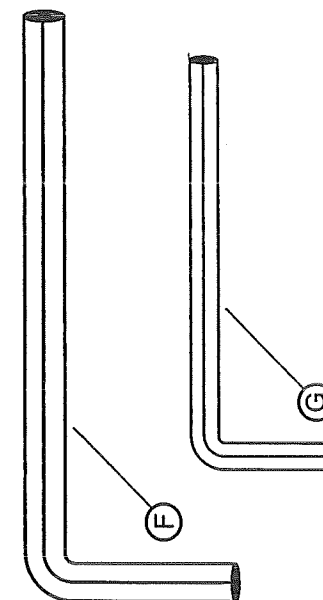

ITEM	QUANTITY	PART NO.	DESCRIPTION
A	25	AT-9	Template
B	1	HP-9	Punch
C	1	D-9	Die
D	1	CS-2	Draw Screw
E	2	D/E-9	Draw/Eject Screw
F	1	AW-D	Hex Key
G	1	AW-D/E-9	Hex Key

I N S T R U C T I O N S

PLEASE NOTE STEPS (5) & (6). IF THESE INSTRUCTIONS ARE NOT FOLLOWED THE DIE WILL BREAK. THERE IS NO WARRANTY PROVIDED FOR THIS MISUSE.

(1) MOUNT the adhesive backed template at the location you wish to make a connector installation. (Caution: be sure there will be sufficient clearance to use both punch and die at this spot.) Surface must be clean and dry so the template will adhere.



(2) CENTER PUNCH and drill three 1/4 inch holes at the points marked "+" on the template. It is wise to remove the template before the actual drilling.

(3) CLEAN and LUBRICATE the area to be punched. Any oil (or even vegetable shortening) will allow the punch to work easier.

(4) THREAD the 2 hard point screws into their holes so the points do not project beyond the face of the punch flange. IF THEY PROJECT BEYOND THE FLANGE FACE EXCESSIVE LOAD WILL CAUSE THE PUNCH TO BREAK.

(5) NOTE the template has tapered ends; so do the punch and die. When the punch and die are installed to make the hole they must be aligned properly with each other.

(6) INSERT the three draw screws into their holes on the punch, through the 3 holes you drilled in the panel and thread them into their tapped holes in the die. You will note there is an arrow on the end of the punch; there is a corresponding arrow on the end of the die. These marks must BOTH be on the same end, as shown in the sketch. If you install the Punch/Die incorrectly, the die will break and the punch will be distorted. THERE IS NO WARRANTY AGAINST BREAKAGE OR DISTORTION DUE TO SUCH MISUSE.

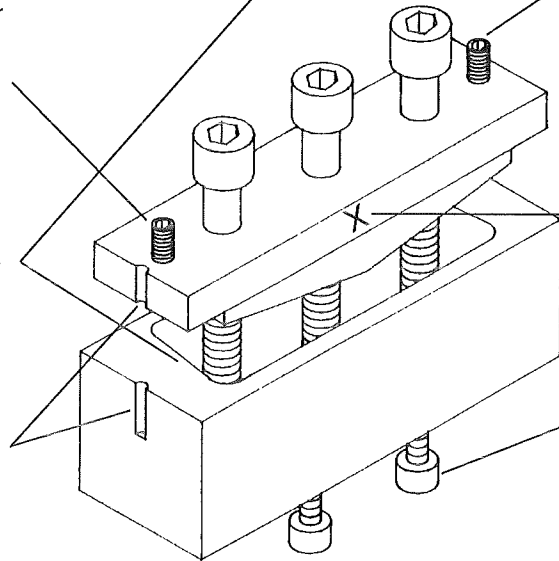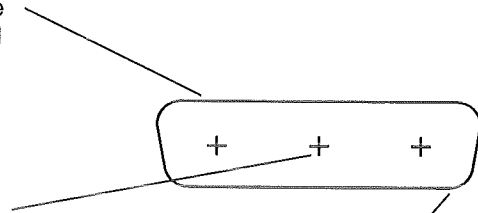

(7) AFTER properly aligning punch to die and snugging the 3 draw screws hand tight, use the large hex key to tighten the draw screws, alternately if necessary, and thus cut the hole. Most times the entire hole can be made by use of the center draw screw only and the screws on either side are used to correct any tilting of the punch as related to the die.


(8) AFTER the hole is punched and before the 3 draw screws are loosened the two hard point set screws are tightened sufficiently to mark the locations of the mounting holes for the connector. (After removal of the punch unit you can then center punch and drill the holes at these locations.) Then, BACK THESE 2 SCREWS CLEAR (as per step 4).

(9) REMOVE the 3 draw screws and die.


(10) REMOVE the punch from the panel. By gripping the punch with vise grip pliers in the center of the flange and applying slight up-and-down motion the punch should release. Do NOT pry the punch out with a screwdriver.

(11) REMOVE the slug. The slug is readily removed by threading the 2 ejector screws into the die.

(12) STORE the tool after applying a light oil coating.

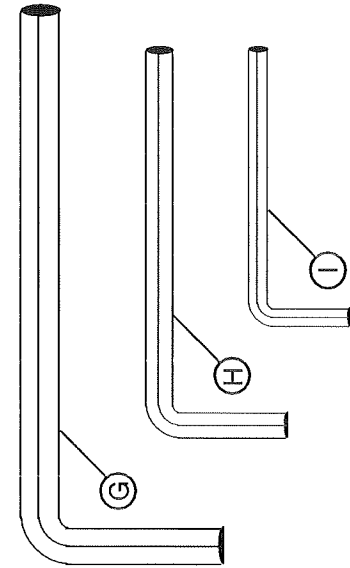

ITEM	QUALITY	PART NO.	DESCRIPTION
A	25	AT-25	Template
B	1	HP-25	Punch
C	1	D-25	Die
D	3	CS-2	Draw Screw
E	2	SE-1	Eject Screw
F	2	PP-1	Set Key
G	1	AW-D	Hex Key
H	1	AW-E	Hex Key
I	1	AW-PP	Hex Key

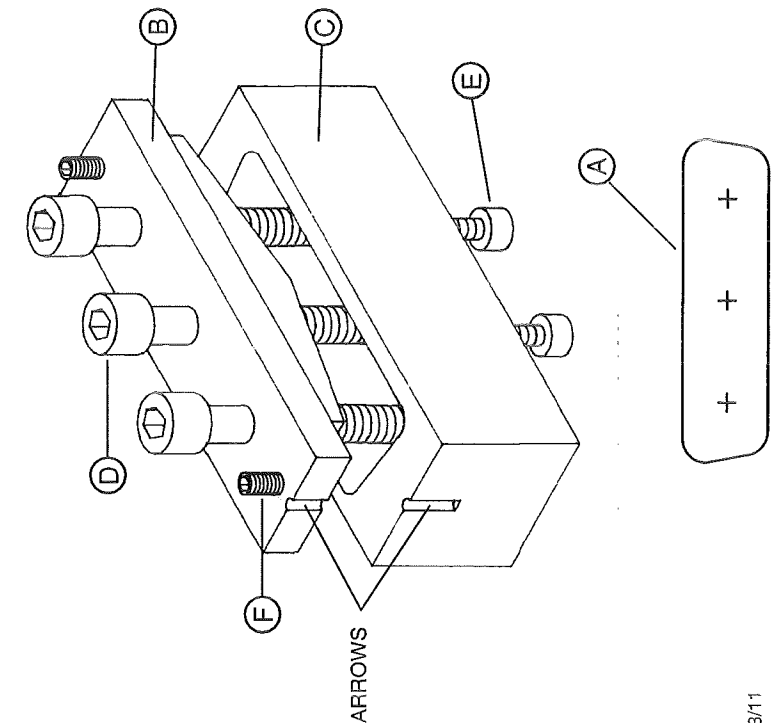

X-ON Electronics

Largest Supplier of Electrical and Electronic Components

Click to view similar products for [duratool](#) manufacturer:

Other Similar products are found below :

[21-7301](#) [D00346](#) [D01441](#) [D02342](#) [D03061](#) [D00338](#) [D00345](#) [D00358](#) [D00642](#) [D01617](#) [D01971](#) [D03070](#) [PDR4001](#) [1748](#) [SPC22132](#)
[MCA565](#) [MC000014](#) [24-8463](#) [DTRSRLCBS-8-01](#) [DTRHTSA-M3-20-1](#) [DTRHTSA-M3-15-1](#) [DTRDLMSPM-12-01](#) [DT5200](#)
[DTRSR4100W](#) [DTRSR3075W](#) [DTRRLCBSR-7-01](#) [DTRPGSB-4A](#) [DTRNSE 1207 M6 20](#) [DTRNSE 1207 M3 35](#) [DTRNSE 1207 M3 20](#)
[DTRNNE 1587 M3](#) [DTRHSR-1](#) [DTRFF-005P4X5](#) [DM6-CWA2WAS100BS4463](#) [NUT CAPTIVE NO10 PK100](#) [74431](#) [M2.510](#)
[KSSTMCZ100-](#) [M12- N5ST-Z100-](#) [79-3981](#) [79-3982](#) [PV1061](#) [02-10009](#) [DTRNSE 1207 M3 4](#) [DTRLCBS-3-01](#) [DTRSPN-8](#) [DTRNSE 1207](#)
[M4 6](#) [SPC22128](#) [WP-SP](#) [MC35759](#) [17026H44.079.GPB](#)