

### INFORMATION

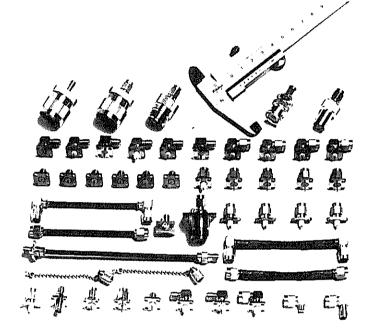
Characteristic

features

The HRM (Hirose Radio Miniature) series are connectors of the SMA (Sub-Miniature Type A) type, prescribed in MIL-C-39012. We developed them in 1967, for the first time in Japan, thanks to our company's outstanding technology. Since then, their high reliability has been recognized, and we have a sales record of more than 6 million thus far.

### Uses

The HRM series is suitable for inunit wiring in wired and wireless communications equipment, broadcasting equipment, radar equipment and electronic measuring instruments, for connections between units, and for input/output terminals of equipment components. They display their effects especially in set designs subject to severe requirements, such as those which operate in a frequency band above the L band and which also have transmission.



### 1. Outstanding performance characteristics.

The matters which most require consideration in matching the impedance of coaxial connectors are these: How are we to reduce the discontinuous capacitance caused by dimensional discontinuities on the transmission channel (the differences in level provided for supporting the center contacts or the dielectric materials), and how are we to correct the discontinuous capacitance which does occur? In this respect, the high-frequency performance characteristics of the HRM series are good because there are small differences in level in the transmission channel, and the discontinuous capacitance which does occur because of the differences in level is corrected by a unique technique.

Moreover, the series also has mechanically stable performance characteristics because the center contacts and dielectric materials have secure fastening structure.

### 2. They are compact in size, lightweight and sturdy.

The receptacle flanges are square in shape, measuring 12.7mm on each side. Their area being about one-half that of the BNC series and about one-fourth that of the S series, they are most suitable for high-density mounting. Moreover, their weights are greatly reduced (a standard receptacle weighs only about 3 grams). Even though they are compact and lightweight, their durability is no lower than that of other types, because they use stainless-steel shells.

### 3. They have high quality and reliability.

The HRM series is manufactured under a system of thorough quality control from the raw materials to the shipped product. In addition to the highest manufacturing quality, they also have high reliability, and not a single faulty unit has ever occurred at the end-user stage with a service record exceeding 6 million units.

### 4. There are many varieties.

An extensive expansion of the varieties has been carried out recently, including providing the S type for all varieties and adding airtight connectors and connectors for .085-inch semi-rigid cables. As a result, clients can now select products more freely than was possible before.



Standard cables	The following are the standard cables of the HRM series:		
	Flexible cables RG-142B/U, RG-55/U		
	Semi-rigid cables		
	The standard cable dimensions are listed on P.110.		

Types

#### 1. Classification by function

Functionally, the cables are classified into six types. The following is the configuration of their names.

<u> HRM`- &gt;</u>	XXX – XXX
	Additional number (A number of $1 \sim 3$ digits is used.
Name of	Numbers are assigned to some products and not to others.)
type	$-$ 100 $\sim$ 199 (Connectors for semi-rigid cables)
	$-200 \sim 299$ (Connectors for Flexible cables)
	$-300 \sim 399$ (Receptacles)
	$-300 \sim 399$ (Receptacles) -400 $\sim$ 499 (Plug receptacles)
	$-500 \sim 599 \text{ (Adapters)}$ -600 \sim 699 (Accessories)
	$-600 \sim 699$ (Accessories)

### 2. Classification by surface treatment

Products having the same structure, shape and dimensions may have different surface treatments of their armor (shell). There are gold-plated products (gold-plated type) and passivated products (S type).

Those of the S type have the letter S attached at the end of their part number.

Example 1	<u>HRM_301</u>	<u>HRM-301S</u>
	l Gold-plated type	S type
Exampel 2	<u>HRM-400-12</u>	HRM-400-12S
	Gold-plated type	S type


Technical explanations of the S-type products and of passivation are given on p. 90.

### 3. Airtight type

Airtight products with hermetic seals are also available.

All airtight products are of the gold-plated type. Air tight types are not available in the S type. Products of the airtight type have the letter H attached at the end of their part number.

Example HRM-300-2H



## Main materials used

	Materials		Finish			
Parts	Materials	Applicable standards	Туре		Plating	Plating thickness
		JIS G 4303	Gold-plated type		Gold plating	0.5 ~ 1 micron*
Shell	Stainless steel			Straight type	Passivation	
			S type	L-bent type	Nickel plating	3 microns
			Gold-pl	ated type	Gold plating	0.5 ~ 1 micron*
Coupling	Stainless steel	JIS G 4303	S type		Passivation	
Female contact	Beryllium copper	JIS H 3270			Gold plating	2 ~ 3 micron
Male contact	Brass	JIS H 3250			Gold plating	2 ~ 3 microns
Solderless sleeve (ferrule)	Annealed copper	JIS H 3250			Nickel plating	3 microns
Insulation	Tetrafluoride resin					
Rubber packings	Silicone rubber					
Cord coverings	Fluoreresin					

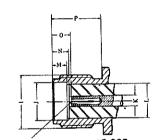
\*VA types with a plating thickness of 0.3 micron (min.) are also available.

# Dimensions of coupling parts

Male coupling parts

Symbols	Dimension values
Α	%-36UNS-28
В	4.56¢ <sup>±0.02</sup>
с	1.27¢ ±0.02
D	$0.92\phi +0.01 \\ -0.015$
E	2.3
F	0 +0.15 _0
G	60°
н	8





Insert p in of 0.910 $\phi$   $^{+0.005}_{-0}$ Grasping force 150 grams or more

Symbols	Dimension values
1	¼–36UNS–2A
J	$4.62\phi \pm 0.02$
к	1.27¢ <sup>±0.02</sup>
L	4.11 <i>φ</i>
М	1.93 <sup>±0.02</sup>
N	1.93 <sup>+0.05</sup> -0.1
0	1.95 <sup>+0.38</sup> -0
Р	5.8 or more

# **Performance characteristics**

	ltem	Performance characteristics
Structural dimensions	Structure	Refer to individual drawings.
Struc dimer	Dimensions	Refer to P.89 for the coupling part dimensions. Refer to P.91 $\sim$ 107 for the external dimensions.
	Insulation resistance	500M $\Omega$ or more measured at 500V DC
	Withstand voltage	Test voltage 1000V AC (rms) (at normal pressure)
	Contact resistance	Each $4m\Omega$ or less at center contact and at out contact
	Characteristic impedance	50Ω
	Frequency range	DC $\sim$ 12.4GHz (Those with a range up to 18GHz are also available. They are marked in the catalog with (18 next to the name.)
Electrical characteristics		Products of the straight type which have no center contacts {Example HRM-101} 1.05 + 0.01f HRM-100 ~ 199 Products of the straight type which have center contacts (Example HRM-102) 1.05 + 0.015f (Note) L-bent type 1.10 + 0.02f (Note) Note: These values are limited to cases where .141-inch semi-rigid cables are used. Straight type (Example HRM-202) 1.10 + 0.02f
lectrical		HRM-200 ~ 299
EI		HRM-300 ~ 399 - L-bent type (Example HRM-305) 1.05 + 0.025f
	Voltage standing wave ratio (V.S.W.R.)	HRM-400 ~ 499
		HRM-500 ~ 599 - Straight type (Example HRM-513) 1.05 + 0.01f - L-bent type (Example HRM-503) 1.05 + 0.025f Conversion For type N, type S (Example HRM-506) 1.05 + 0.01f adapter For type BNC (Example HRM-517) 1.2 or less
		HRM-600 ~ 699Standard terminal device (HRM-601, 602) 1.05 + 0.015fAirtight productsDC to 6GHz, .1.15 or less 6 ~ 12.4GHz, 1.2 or less f = frequency in GHz
istics	Coupling tightening torque	0.6~1.0Nm
Mechanical characteristics	Coupling fastening strength	490N or more
al cha	Center-contact holding power	1.5N or more
chanic	Center-contact fastening torque	16.7mN · m or more
Me	Contact life	Contact resistance of 6 m $\Omega$ or less after 1000 insertions and withdrawals
<u>и</u>	Vibration resistance	*There must be no abnormalities when tested by MIL-STD-202 Method 204, test condition D.
eristic	Impact resistance	*There must be no abnormalities when tested by MIL-STD-202 Method 202 at an acceleration of 200G.
laracti	Temperature-resistance cycles	*There must be no abnormalities when tested by MIL-STD-202 Method 202, test condition C.
Einvironmental characteristics	Corrosion resistance	*There must be no abnormalities when tested by MIL-STD-202 Method 101, test condition B.
onmei	Humidity resistance	*There must be no abnormalities when tested by MIL-STD-202 Method 106, test condition C.
Einvir	Airtightness	1 x 10 <sup>-7</sup> cc/sec or less
	Radiation resistance	There must be no abnormalities when exposed to radiation of 3 x 10 <sup>13</sup> neutrons.

\*The coupling tightening torque is 10kg-cm.



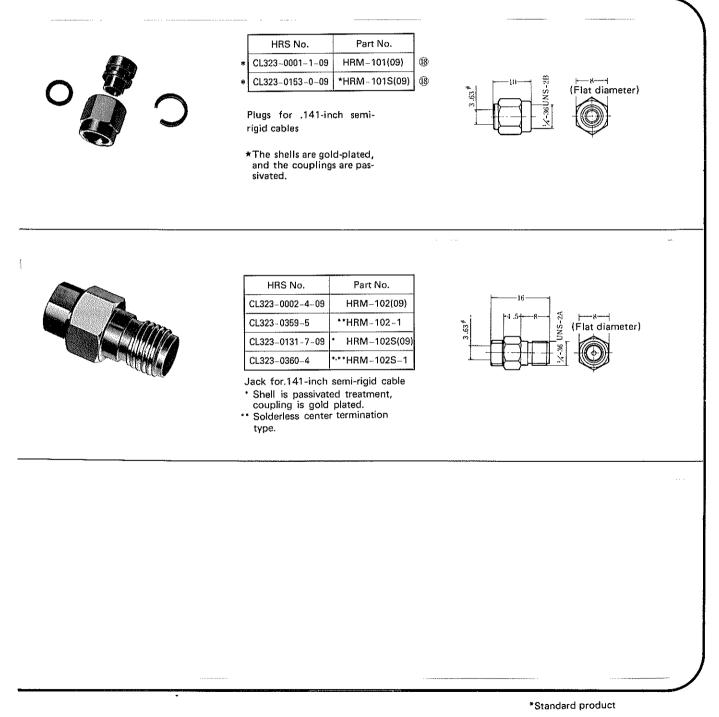
Guide to products

The following are typical products of the HRM series. Various products other than those listed here are also available. Please inquire about them.

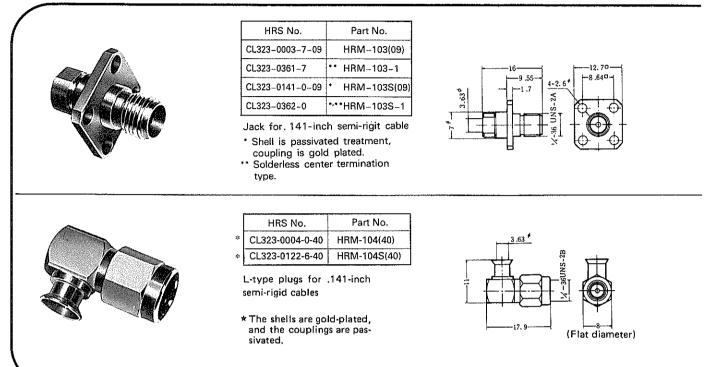
### Connectors for semi-rigid cables HRM-100~199

Connectors for semi-rigid cables match two types of cables: .141-inch and .085-inch semi-rigid cables. Use the .141-inch cables in order to obtain the V.S.W.R. listed on P.90. The .085-inch cables, which have good flexibility, are suitable when high-density wiring is to be used inside the set. In this case, the V.S.W.R. value will be higher than with the .141-inch cables.


### ▲For .141-inch Semi-rigid cable








# For .085-inch Semi-rigid cable

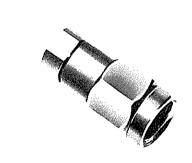


	HRS No.	Part No.
	CL323-0142-3-40	HRM-100-1(40)
*	CL323-0125-4-40	HRM-100-1S(40)


Plugs for .085-inch semirigid cables

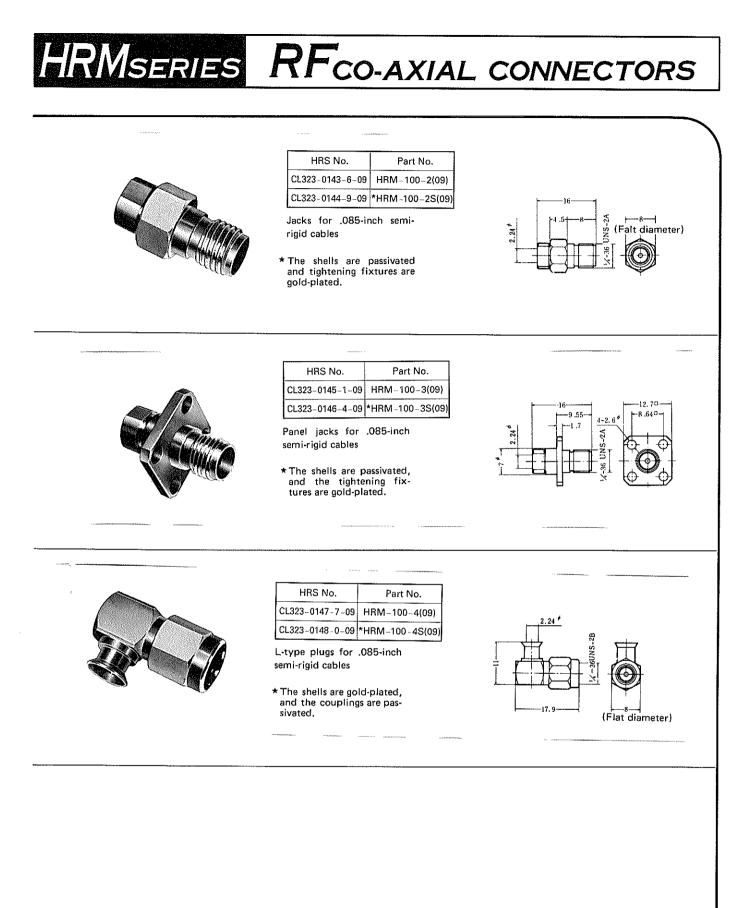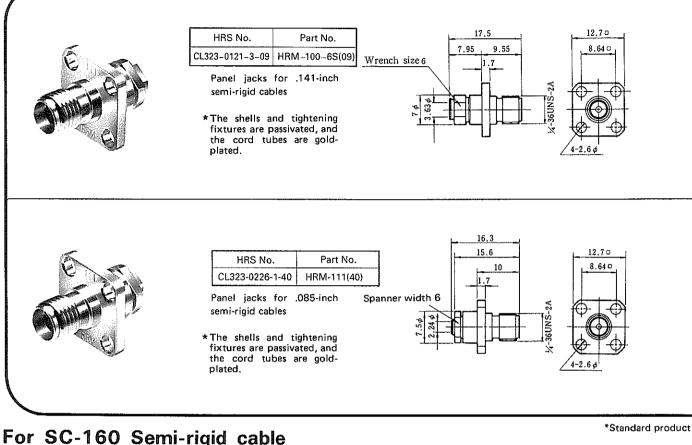\* The shells and couplings are passivated, and the tightening fixtures are gold-plated.












# For SC-160 Semi-rigid cable

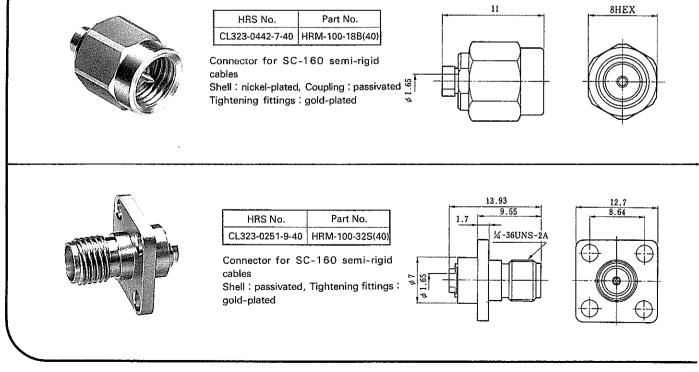



# Connectors for flexible cables HRM-200~299

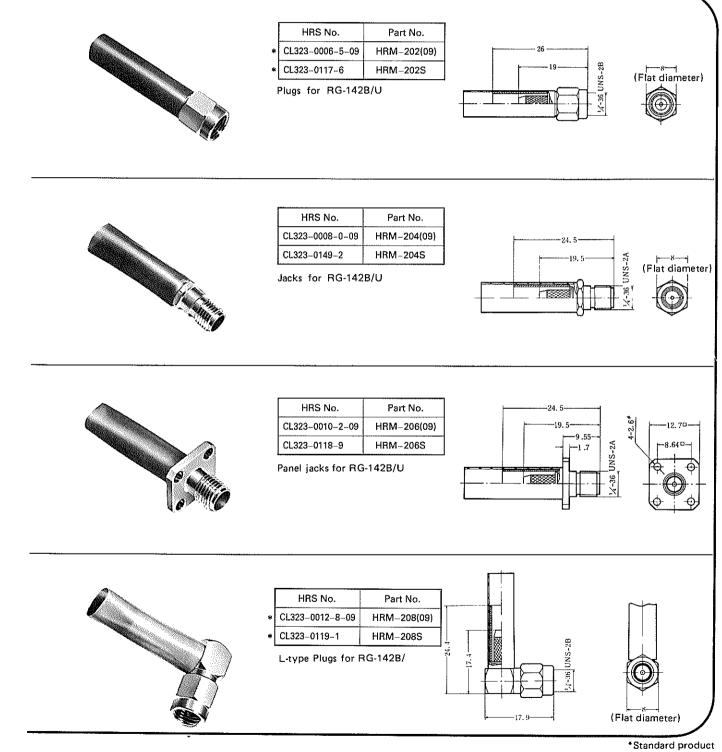Two types of cables: RG-142B/U match the connectors for flexible cables. However, the connectors are designed so that they will match both cables.




95



HRS No. CL323-0369-9-40 CL323-0412-6-40	Part No. HRM-200-2-C(40) HRM-200-2S-C(40)	Applicable cable 1.5D-2V	19.4 - SNN192
CL323-0500-1-40	HRM-200-2S-1C(40)	1.5D-2W	
 			8HEX
HRS No.	Part No.	Applicable cable	
HRS No. CL323-0371-0-40 CL323-0413-9-40	Part No. HRM-200-4-C(40) HRM-200-4S-C(40)	Applicable cable 1.5D-2V	16.8

L-Type Plug








# Receptacles HRM-300~399


The mounting parts of the receptacles are available in types for mounting strip lines (microstrips, triplates, suspender types), for mounting waveguides, for mounting lead wires, etc.

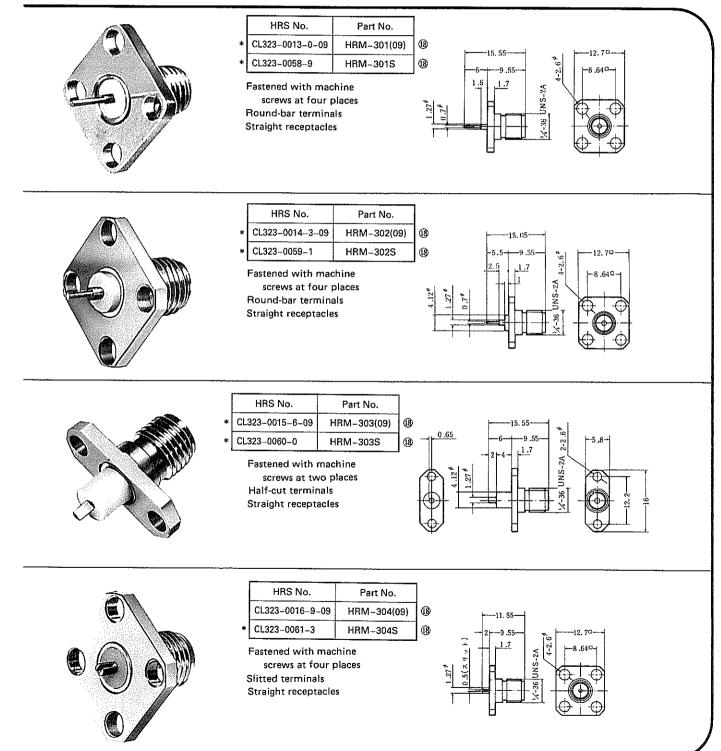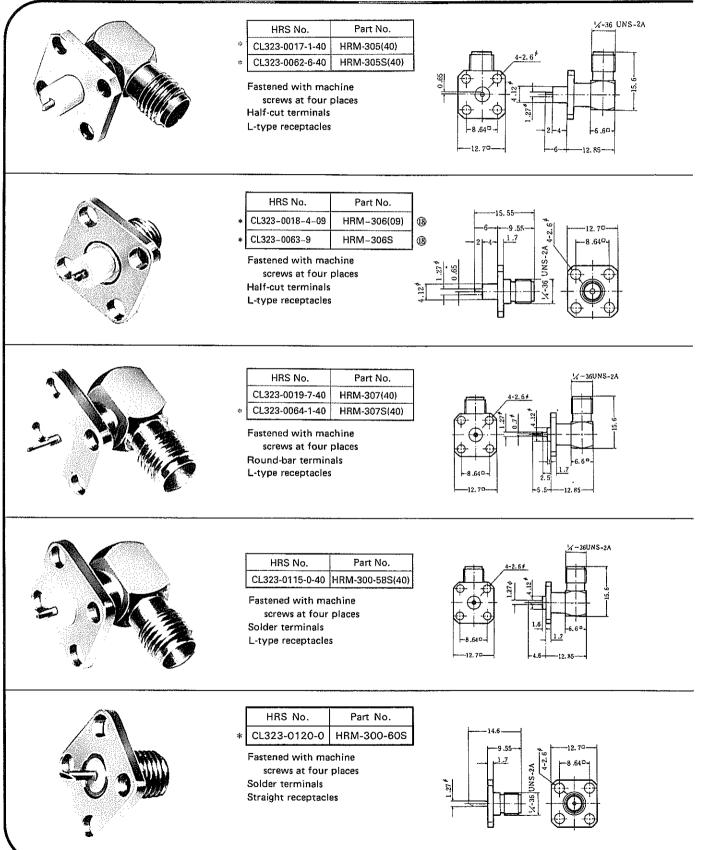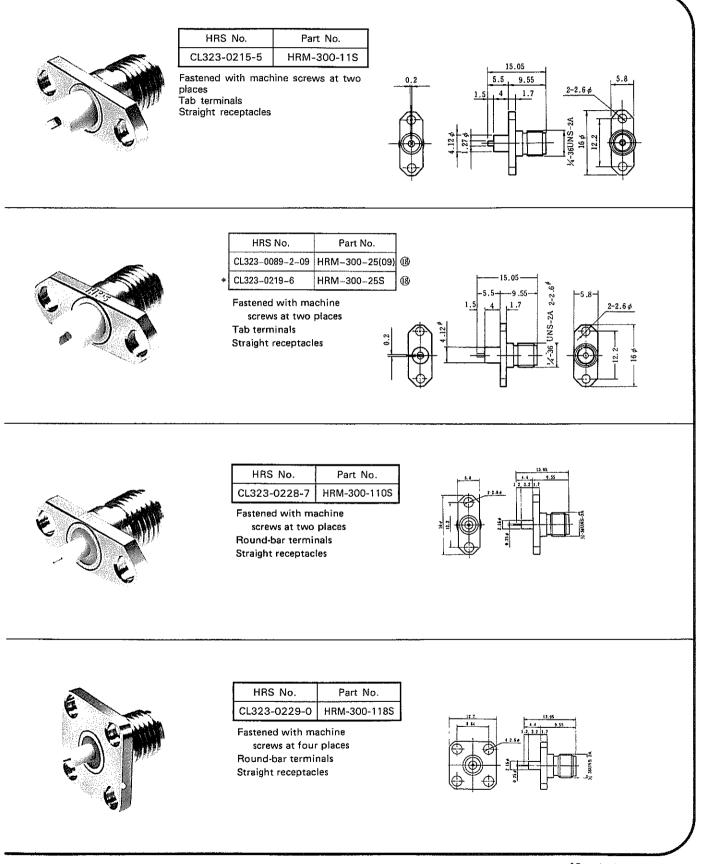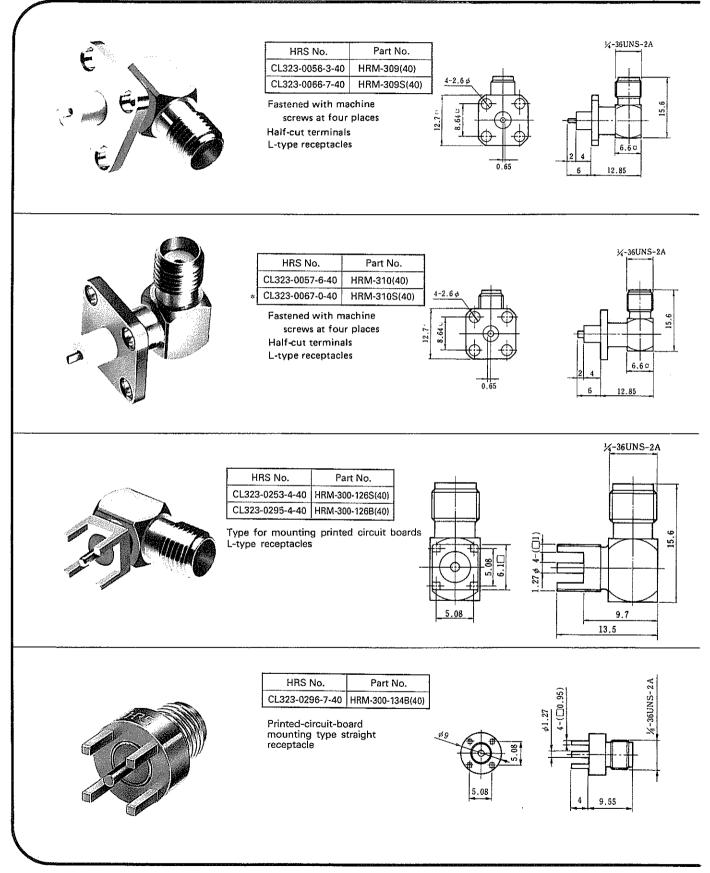
There are two mounting systems: fastening with machine screws (M2.3) at four or two places.















### Plug receptacles HRM-400~499

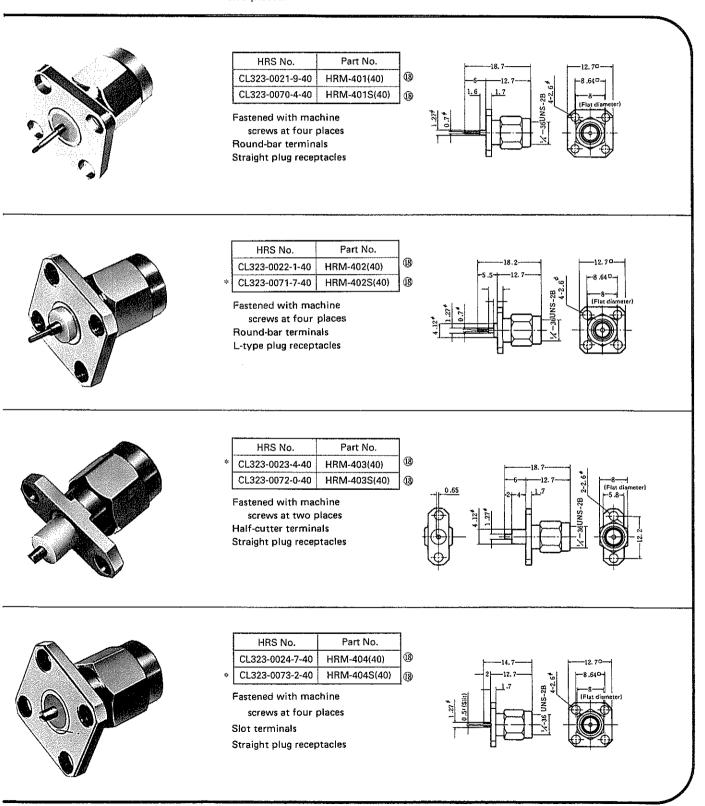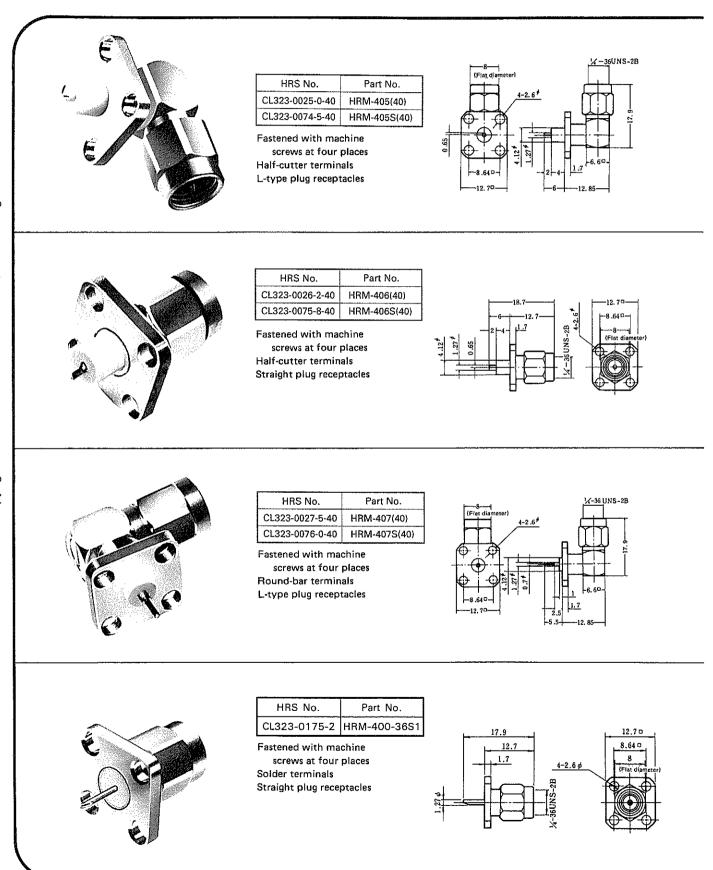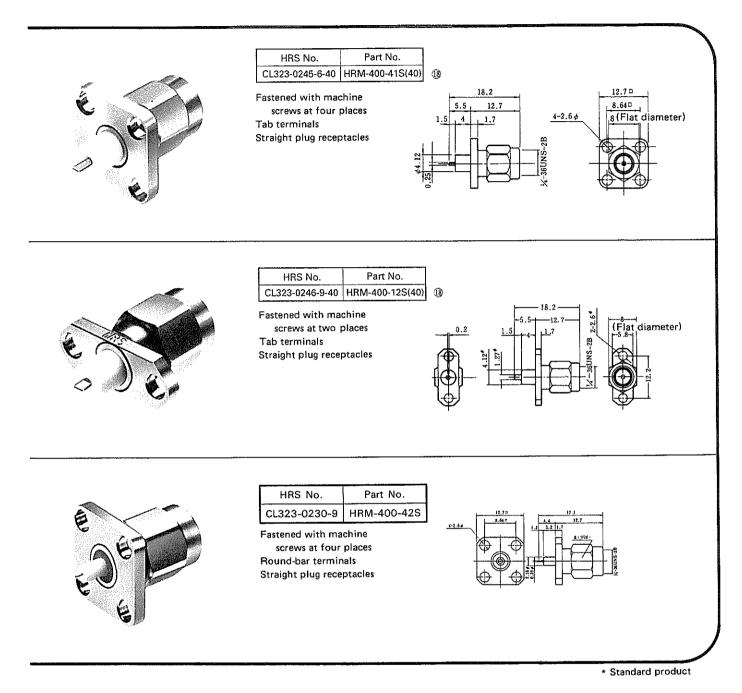
The mounting parts of the plug receptacles are available in types for mounting strip lines (microstrips, triplates, suspender types), for mounting waveguides, etc. There are two mounting systems: fastening with machine screws (M2.3) at four or two places.













103



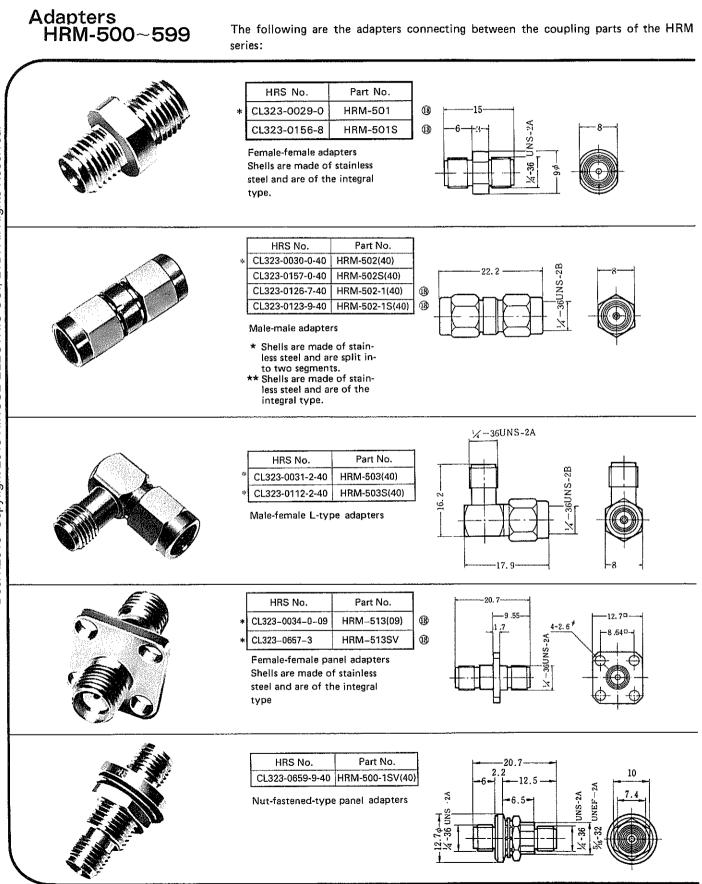


\*Standard product



# Converter adapter HRM-500-599

For the converter adapters for connecting the HRM series to other series, see the CL311BWA series.
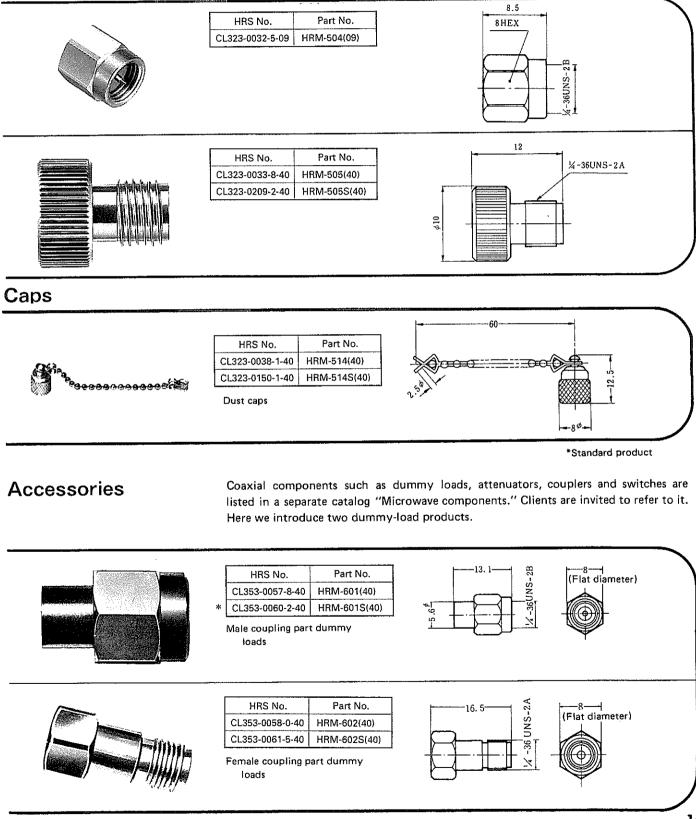
## Shortening connector




105




## Airtight type

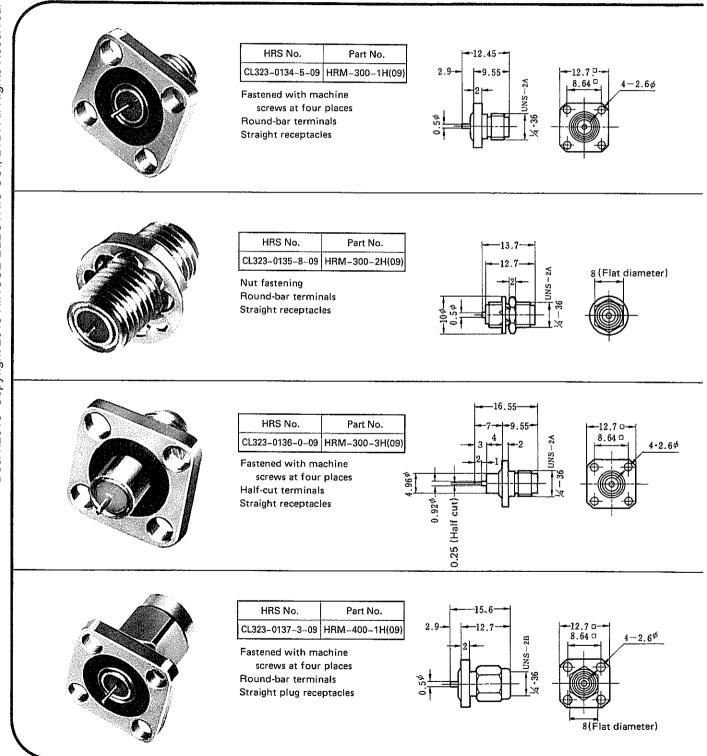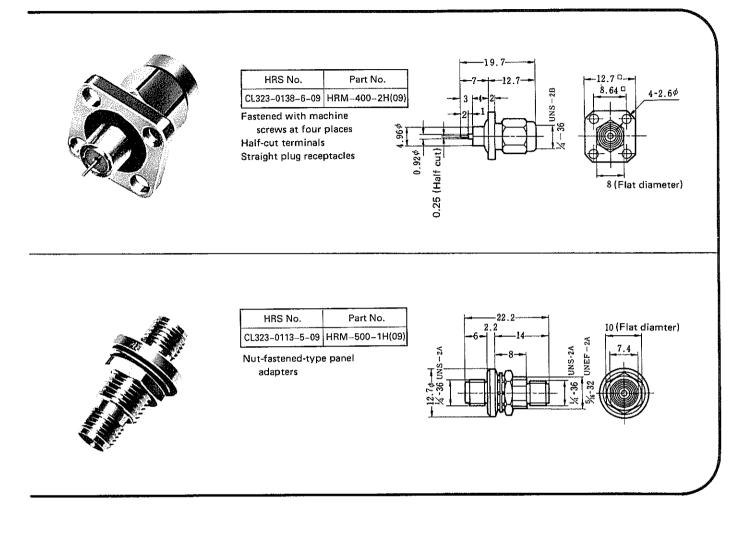We offer the following airtight connector products, mainly receptacles and plug receptacles.

We can also design and fabricate of products to meet special specifications, including modifications of the structure and of the mounting specifications. Clients are invited to place orders for them.









## Technical Guidance

Recommending

the S type

# The S type refers to products which use stainless steel as the shell material and in which the stainless steel has been passivated. Passivation refers to a type of surface treatment in which the outer surface of the stainless steel is etched with hydrofluoric acid in order to reduce the number of iron particles on it. This forms an oxide film which is thin enough to exert no influence on the electrical conductivity. The corrosion resistance of the stainless steel can be enhanced by performing this treatment. The original goal in developing the S type was to prevent corrosion. That is, in combinations in which the surface treatment of the armor parts is gold plating and the material of the set panel is aluminum, the potential difference between them is rather high (0.9V), and there is the danger that electrolytic corrosion may be induced under certain environmental conditions. As a countermeasure to prevent this, the S type is used, in which the potential difference between the stainless steel and aluminum is relatively low (0.4V).

Not only does the S type have high corrosion resistance, but it has also been proved to have corrosion resistance superior to that of the gold-plated type by acceleration tests with salt-water spraying and by tests in which samples were left for 5000 hours in places where there was much sulfurous acid gas. There are also other advantages. For example, in the gold-plated type, powder from the gold plating is deposited on the surfaces of the coupling parts, but this drawback is absent in the S type. In addition, since expensive gold is not used, the S type can be provided at a lower price than the gold-plated type.

In order to make more effective use of these advantages, it is scheduled in the future to give priority to the S type over the gold-plated type and to make it the standard product. Moreover, although passivation is, as a general rule, the surface treatment of the S type, other treatments may be used as special exceptions in the following cases:

- (1) In the L-bent type, nickel plating is used because the surface of stainless steel is highly discolored by the heat applied during brazing. In this case, the potential difference relative to the aluminum will be 0.6V.
- (2) In connectors for semi-rigid cables (HRM-100~199), gold plating is used in products in which the outer conductors of the cables are soldered (for example, the shell of HRM-101S) in consideration of the soldering properties.

### High-Frequency Properties


### 1. Frequency Range

The cut-off frequency of the coaxial transmission path can be found from the following expression:

$$f_{CUT} = \frac{3 \times 10^{11}}{\pi (d_1 + d_2)/2} (Hz) \qquad d_1 = \text{Outer diameter of center contact (unit: mm)} \\ d_2 = \text{Inner diameter of outer contact (unit: mm)}$$

The cut-off frequency of the HRM series calculated by this expression is 35.5GHz. However, this value is purely a theoretical value in an ideal transmission path. If we take into account the voltage standing wave ratio, the upper limit of the frequency that can be used industrially will be about 18GHz.

At the present time, the upper limit of the guaranteed frequency of the HRM series is 12.4GHz, lower than 18GHz. In certain products, satisfactory results have been obtained with frequencies of up to 18GHz as the typical value. Clients who plan to use frequencies higher than 12.4GHz are requested to inquire.



### 2. Insertion Loss

The insertion loss of the HRM series can be found from the following expression:

 $Loss \leq 0.03 \sqrt{f(GHz)}$  (dB)

The insertion loss at 12.4GHz calculated by this expression is 0.1dB. That is, the insertion loss of the HRM series will be 0.1dB or less throughout the entire guaranteed band. This value has been confirmed.

### 3. High-Frequency Loss

The high-frequency loss of the HRM series has values of 100dB or more within the range of the guaranteed frequencies under the following two conditions: that the couplings are tightened with the prescribed torque, and that the sets and connectors are thoroughly fastened with machine screws.

### 4. Performance properties of the S Type

In the gold-plated type there will be little conductor loss because the electromagnetic field will be concentrated at the gold-plated parts because of the skin effect. However, in the S type the conductor loss will be larger because the electromagnetic field will be distributed in the stainless-steel parts. However, it will be nearly negligible since the transmission path is short (the length of the transmission path is 15.2mm when a typical receptacle and a plug receptacle are coupled together). The skin will be rough as a result of the passivation, but this has no influence at all on the performance characteristics because the roughness is far less than the finishing precision of the cutting.

### Permissible Electric Power

### 1. Average Power

The permissible average power of the connectors cannot be determined unconditionally because a number of indeterminate conditions must be included, such as the frequency, the voltage standing wave ratio, the heat radiated by the device, the modulation ratio, etc. However, the value  $50/\sqrt{f(GHz)}$  (W) can be applied as a tentative yardstick value for the HRM series. Even this value cannot be said to be an absolute yardstick on account of factors such as the heat radiation conditions. In actual practice, 50W has been applied at 6GHz.

### 2. Peak Power

The peak power of the connectors is determined by their breakdown voltage. In the HRM series, the peak power is about 20kW.

Note that the values of both the average power and the peak power are values applicable under the following conditions:

- There is to be a state of normal temperature, normal humidity, and normal pressure.
- (2) In products to which cables are connected, priority is to be given to the permissible power values of the cables. Even in cases where the cables have a higher permissible power than the connectors, there are to be no defects in the wiring connections.
- (3) There is to be no metal powder on the coupling surfaces of the connectors. Care must be taken especially in the gold-plated type, since there is a tendency for metal powder to be deposited on the coupling surfaces of this type.



# Tightening Torque of Couplings

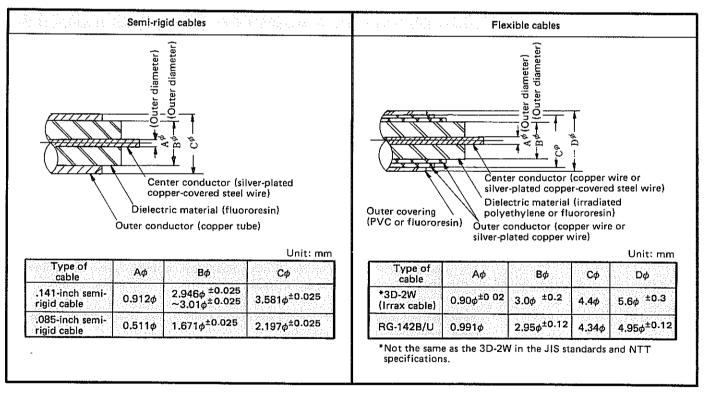
Suitable values for the tightening torque of couplings of the HRM series are 6  $\sim$  10kg-cm. As for which values ought to be chosen for use within this range, the most suitable tightening torque is 6kg-cm when no particular vibrations are applied except during transport, or 10kg-cm in environments where vibrations are applied.

The following is the basis on which the range of  $6 \sim 10$ kg-cm was established. First, in vibration tests simulating the vibration conditions that occur during transport, it has been confirmed that loosening does not occur when the couplings are tightened with a torque of 3kg-cm. Thus, allowing a safety factor of 2 times, the value was set at 6kg-cm. The upper limit value of 10kg-cm was established on the basis of the amount of dimensional changes in the outer diameter of the male coupling part, which is  $4.56\phi^{\pm 0.02}$ .

Thus, the tightening torque of the couplings of the HRM series has a narrow range, and problems will occur if they are tightened with a torque outside of this range. Consequently, we recommend that you use an 8 mm x 6 kg-cm or 8 mm x 10 kg-cm torque wrench when tightening the couplings.

## Standard Cables

The standard cables of the HRM series have the following dimensions, structures and materials:







# Tools for connecting wiring

Below are a table giving an overview of the tools used for connecting the wiring of the HRM series and a table listing the tools used for typical products:

Part No.	Overview of tool	Special remarks
HRM-T-1	Positioning tool for center contacts of female coupling parts	
HRM-T-2	Positioning tool for center contacts of male coupling parts	
HRM-T-3	Tapering tool for tips of center conductors of .141-inch semi-rigid cables	*Unsuitable for use as a mass-production tool.
HRM-T-4 UM.MSS-T-1 PO-P-2-T	Tool for crimp bonding of ferrules (sleeves) of connectors for flexible cables	
HRM-T-5	Tool for bending141-inch semi-rigid cables	
HRM-T-6	Soldered positioning and cutting tool for	*Unsuitable for use as a mass-production tool.
HRM-T-7	Tool for mounting HRM-101 and 101S couplings on shells	
HRM-T-8	Soldered positioning and cutting tool for	*Unsuitable for use as a mass-production tool.
HRM-T-9	Tool for bending .085-inch semi-rigid cables	

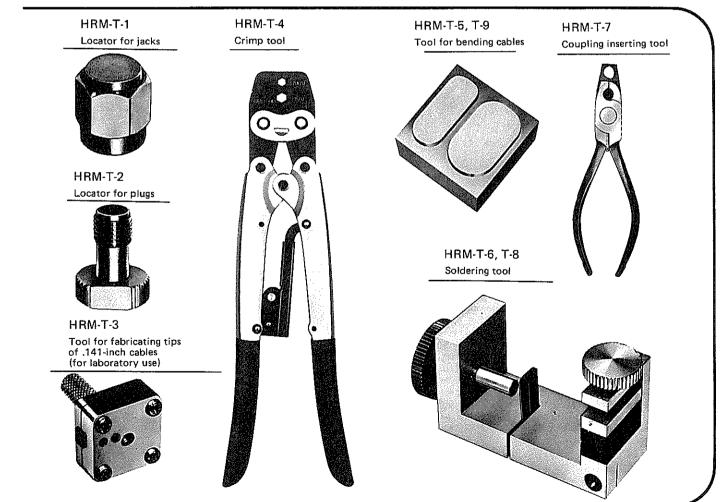Part No.	Type of cable used	Recommended tools
HRM-101,101S	.141-inch semi-rigid cables	HRM-T-3, 5, 6, 7
HRM-102,102S	.141-inch semi-rigid cables	HRM-T-1,5,6
HRM-103,103S	.141-inch semi-rigid cables	HRM-T-1, 5, 6
HRM-104,104S HRM-100-4,100-4S	.141-inch semi-rigid cables .085-inch semi-rigid cables	HRM-T-2,5
HRM-100-1,100-1S	.085-inch semi-rigid cables	HRM-T-2,8,9
HRM-100-2,100-2S	.085-inch semi-rigid cables	HRM-T-1,8,9
HRM-100-3,100-3S	.085-inch semi-rigid cables	HRM-T-1,8,9
HRM-202, 202S	3D-XW (Irrax cable) RG-1428/U	HRM-T-2,4
HRM-204, 204S	3D-XW (Irrax cable) RG-142B/U	HRM-T-1,4,6
HRM-206, 206S	3D-XW (Irrax cable) RG-142B/U	HRM-T-1,4,6
HRM-208, 208S	3D-XW (Irrax cable) RG-142B/U	HRM-T-2,4
HRM-200-2-C,2S-C HRM-200-4-C,4S-C	1.5D-2V	UM.MSS-T-1
HRM-200-2S-1C HRM-200-4S-1C	1.5D-2W	PO-P-2-T





### Connecting Methods 1. HRM-101, 101S

 Cut cable (refer to Fig. (1)) When cutting semi-rigid cables, cut them at the actually needed length l plus 2.3mm.

- Note 1: Take care that the cut surface is vertical.
- Note 2: Length l should be the length of the outer conductor of the cable after the wiring has been completely connected.

Fig.(1)

g.(1)

### .141-inch semi-rigid cable






Fig.(2)

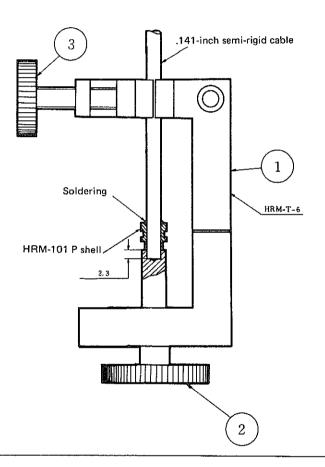
- Fasten the cable to the shell by soldering. (Use HRM-T-6)
  - i) Fasten (1) in Fig. (2) with a vice.
  - ii) As shown in the figure, pass the P shell through the cable, and fasten the cable by tightening (3).
- iii) Next, tighten (2) so that the cable tip protrudes 2.3mm from the tip of the shell.
- iv) Fasten the shell by soldering it to the cable.
- Note 1: It is desirable to use at this time a soldering iron of about 80W.
- Note 2: The solder must be applied evenly on the circumference.
- Note 3: During soldering, be careful not to allow the tip of the shell to move away from ②.
- Note 4: Screw ③ must be tightened tightly so that the cable will not move as a result of the thermal stress generated by the soldering.
- Note 5: Polish the soldered part of the cable in advance with sandpaper or the like so that the solder will adhere easily to it.



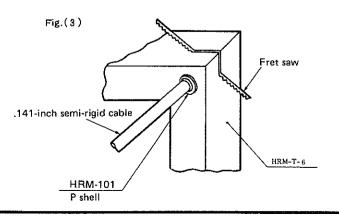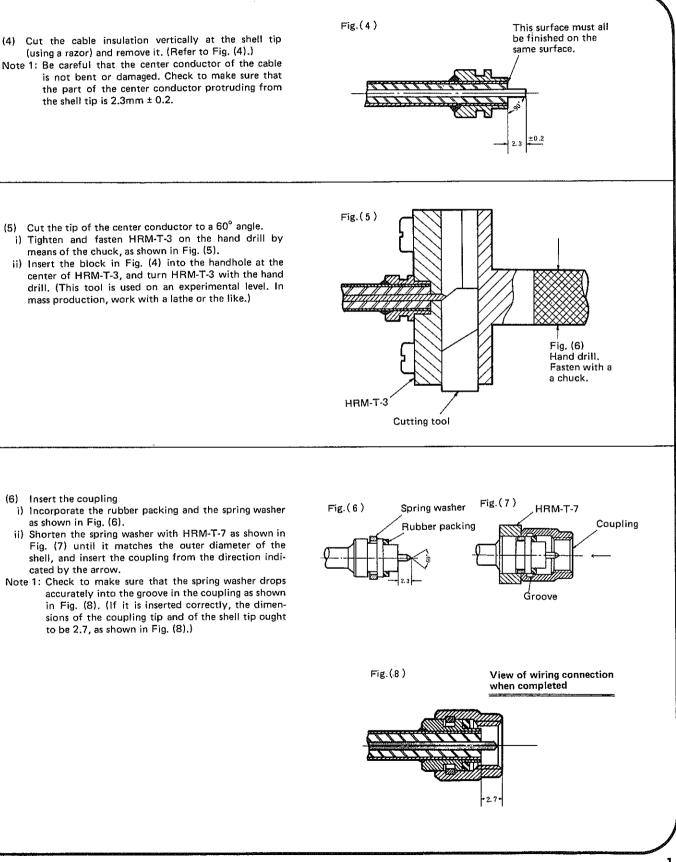- (3) Cut off the outer conductor of the cable with a fret saw at the shell-tip position. (Refer to Fig. (3).)
- Note 1: Be careful not to damage the shell tip when cutting the cable, and be sure that the shell tip and the cut surface of the cable will be on the same surface.
- Note 2: The slit with a width of 0.4 on the tool is provided so that the fret saw will stop between the center conductor and outer conductor of the cable. Care is necessary because if the tool is damaged during cutting the depth of the slit will change, and consequently the center conductor of the cable will be damaged.







### 2. HRM-102, 102S, 103, 103S

- (1) Cut the cable.
  - When cutting semi-rigid cables, cut them at the actually needed length  $\ell$  plus 2.3mm.
- Note 1: Take care that the cut surface is vertical.
- Note 2: Length 2 should be the entire length of the outer conductor of the cable after the wiring has been completely connected.


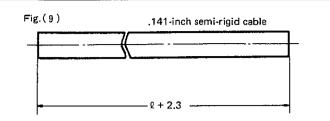


Fig.(10)

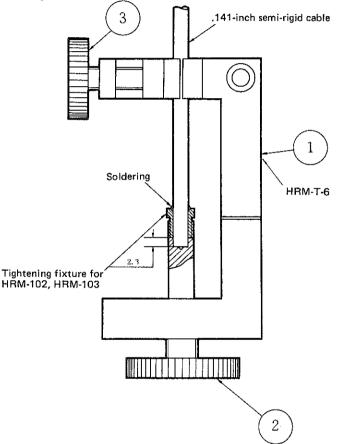- Fasten the cable to the shell by soldering. (Use HRM-T-6)
- i) Fasten ① in Fig. (10) with a vice.
- ii) As shown in the figure, pass the tightening fixture through the cable, and fasten the cable by tightening
   3.
- iii) Next, tighten ② so that the cable tip protrudes 2.3mm from the tip of the shell.
- iv) Fasten the tightening fixture by soldering it to the cable.
- Note 1: It is desirable to use at this time a soldering iron of about 80W.
- Note 2: The solder must be applied evenly on the circumference.
- Note 3: During soldering, be careful not to allow the tip of the tightening fixture to move away from (2).
- Note 4: Screw ③ must be tightened tightly so that the cable will not move as a result of the thermal stress generated by the soldering.
- Note 5: Polish the soldered part of the cable in advance with sandpaper or the like so that the solder will adhere easily to it.



- (3) Cut off the outer conductor of the cable with a fret saw at the tip position of the tightening fixture. (Refer to Fig. (11).)
- Note 1: Be careful not to damage the tip of the tightening fixture when cutting the cable, and be sure that the tip of the tightening fixture and the cut surface of the cable will be on the same surface.
- Note 2: The slit with a width of 0.4 on the tool is provided so that the fret saw will stop between the center conductor and outer conductor of the cable. Care is necessary because if the tool is damaged during cutting the depth of the slit will change, and consequently the center conductor of the cable will be damaged.

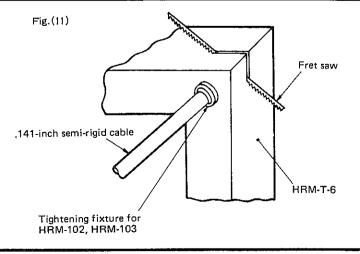



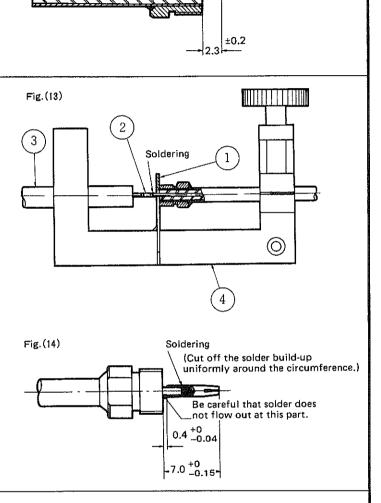


Fig.(12)

- (4) Cut the cable insulation vertically at the tip of the tightening fixture (using a razor) and remove it. (Refer to Fig. (12).)
- Note 1: The tip must be finished so that it will all be on the same surface.
- Note 2: Be careful not to bend or damage the center conductor of the cable.



- i) Put the positioning plate of the center conductor ① into the groove of the HRM-T-6 proper.
- ii) Mount the block in Fig. (12) onto HRM-T-6, as shown in Fig. (13). The tip will strike against ①. Pass the center conductor of the cable through the groove of ①, and fasten at that position.
- iii) Fit the female contact for HRM-102, HRM-103 into the contact holder ③. Perform preliminary soldering and insert as shown in Fig. (13) from the horizontal hole in the HRM-T-6 proper ④. Align the center conductor of the cable with the female contact hole while heating the female contact with the soldering iron, and press it until it strikes against ①.
- iv) After the soldering is finished, remove (1) and remove the block from the HRM-T-6 proper (4) and the contact holder (3). Finish the place which was soldered with a razor or the like uniformly on the circumference. (Refer to Fig. (14).)
- Note 1: It is desirable to use at this time a soldering iron of about  $20 \sim 30W$ .
- Note 2: Be careful that extra solder does not flow onto the center conductor of the cable at the part  $0.4^{+0}_{-0.04}$  in Fig. (14).
- Note 3: Check the dimensions of Fig. (14) after soldering the female contact.



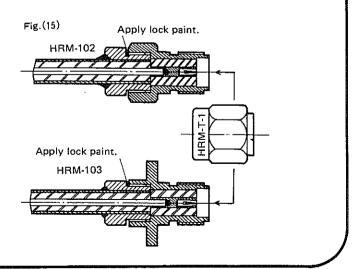
This surface must

be finished so that

it will all be on the


same surface

- (6) Screw the block into the connector proper. Connection of the wiring will be completed as in
- Fig. (15) when the block in Fig. (14) is screwed into the connector proper. Note 1: The opening part must be fastened by means of
- HRM-T-1 (locator) so that the connector insulation will not move when the block is being screwed in.
- Note 2: The screw must be tightened with a torque of 30kg-cm or more. When it is especially necessary to prevent the screw from loosening, lock paint is to be applied as is shown in the figure.



## 3. HRM-104, 104S

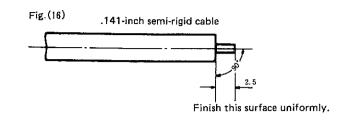
- Process cable ends. (Refer to Fig. (16).) Let the center conductor of the cable protrude 2.5mm and remove the outer conductor and insulation.
- Note 1: Finish the outer conductor and insulation vertically and uniformly with a fret saw or the like.
- Note 2: When cutting, be careful not to damage the center conductor.



(2) Soler the center conductor of the cable to the male contact of the connector. (Refer to Fig. (17).)

- i) Fit HRM-T-2 so that the female contact of the connector and the insulation will not move, and hold it firmly in place with a vice.
- ii) Remove the screw cover, insert the cable after end processing as shown in Fig. (16) through the cord inlet, and solder it as shown in Fig. (17).
- Note 1: Insert the cable until the tip of the outer conductor comes into contact with the inner surface of the connector shell, as shown in Fig. (17). Insert the center conductor into the groove of the male contact of the connector, and solder it.
- Note 2: When soldering, be careful not to get solder on the center conductor of the cable or on the outer surface of the male contact of the connector.
- Note 3: It is desirable to use at this time a soldering iron of about 20  $\sim$  30W. Its tip must be narrowed to facilitate the work.
- Note 4: When soldering, be careful to avoid knobby soldering. (To check this point, rotate the cable after soldering.)

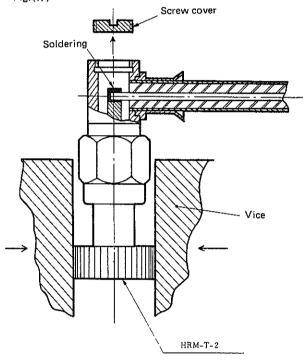
Fig.(17)




(3) Solder the outer conductor.


Fit HRM-T-2 into the opening part as shown in Fig. (18), hold it in a vice, and solder the outer conductor of the cable and the connector shell.

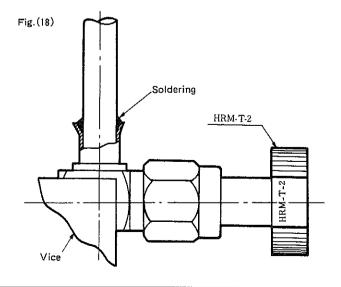- Note 1: It is desirable to use at this time a soldering iron of about 80W.
- Note 2: Apply the solder uniformly on the circumference, and carry out the soldering as speedily as possible.
- Note 3: Polish the soldered part of the cable in advance with sandpaper or the like so that the solder will adhere easily to it.





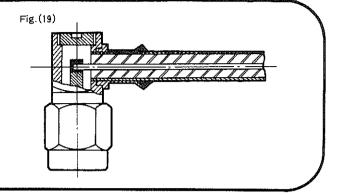(3) Remove the locator and screw on the screw cover. Then the wiring connections will be completed, as shown in Fig. (19).



### Addendum

Fig.(21)

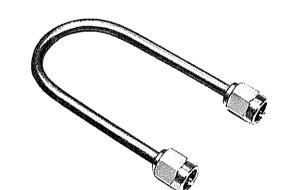
1.2

v


. s . 1.1 w

Ŕ

When connectors of the HRM series are to be connected and used with semi-rigid cables, their performance properties, like those of other types of connectors, will be governed largely by the quality of the wiring connection work. The same thing can be said with reference to connection of the wiring of flexible cables as well. However, in cases where even better performance characteristics are needed, the precautions described above must be observed. When semi-rigid cables are to be bent in use, tools like those shown in Fig. (20) (HRM-T-5, 9) can be used to bend them with radii of curvature of 6R, 8R, 10R or 12R, respectively. If they are to be used in a spiral shape, the rear surfaces of (HRM-T-5, 9) are used. This is shown in the photograph. Fig. (21) shows the V.S.W.R. data for semi-rigid cables that are connected in bent shape as shown in the photograph and for those that are connected straight. It is clear that there are no large differences in the characteristic features.





HRM-101 standards

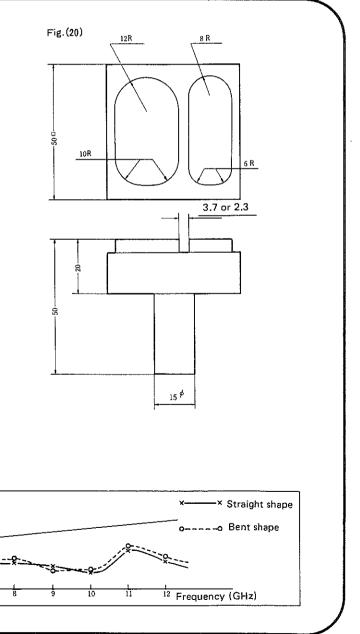


### 4. HRM-202, 202S

- (1) Process cable ends (Refer to Fig. (22).)
   i) Cut off 10mm of the outer covering of the cable
  - (RG-142B/U Next cut off the outer conductor and insulation so that 2.3mm of the center conductor will protrude.
- Note 1: When cutting the housing and insulation, be careful not to damage the outer conductor and the center conductor.
- Note 2: Be sure to cut the cable insulation vertically and flatly.
- (2) Solder the center conductor Hold the male contact for HRM-202 in place with a
- vice as shown in Fig. (23) and solder it to the center conductor of the cable. Note 1: Before soldering, apply preliminary solder on the
- Note 1: Before soldering, apply preliminary solder on the male contact in advance.
- Note 2: It is a good idea to make a hole of 0.8¢, as shown in Fig. (23), at the part where the male contact is to be held in the vice.
- Note 3: In the case of cables using Irrax insulation, be careful to perform the soldering speedily so that the tip will not dissolve as a result of the heat during soldering.
- Note 4: The build-up of solder after soldering must be finished uniformly on the circumference. To check the strength of the soldering, pull the male contact with a force of about 1kg (2.47 lb.).
- Note 5: Be careful not to allow a gap to be produced between the insulation and the contact after soldering.
- Note 6: Be careful not to allow the male contact to be soldered in a bent position towards the center conductor of the cable.
- Note 7: It is desirable to use a soldering iron of about 20  $\sim$  30W.
- (3) After passing the boot and solderless sleeve over the cable, insert the cable through the connector shell cord inlet, and crimp the ferrule (sleeve) in a hexagonal shape with HT303/HRM-T-4 (Refer to Fig. (24).)
  - i) To insert the cable, align the male contact with the hole in the insulation, and insert the connector shell between the dielectric material of the cable and the outer conductor.
  - ii) Insert the ferrule (sleeve) until it strikes against the uneven part of the shell, as shown in Fig. (24), and crimp it in a hexagonal shape with HT303/HRM-T-4
- Note 1: Insertion of the cable is finished when the uneven part of the male contact strikes against the connector insulation. It is a good idea to fit the HRM-T-2 (the locator) in the opening part in order to prevent the connector insulation from moving at this time. Crimping of the ferrule (sleeve) is performed first on the cable side and next on the connector side. (Be careful about the order; if the wrong order is followed, the clamping force will be reduced by one half.).
- (4) Put on the boot over the ferrule (sleeve), and apply heat with a hair dryer or the like to cause shrinking. When the connection of the wiring is completed, the appearance will be as shown in Fig. (25).
- Note 1: When shrinking, catch the boot on the groove in the shell, as shown in Fig. (25).
- Note 2: Remove HRM-T-2 (the locator) after shrinkage of the boot.

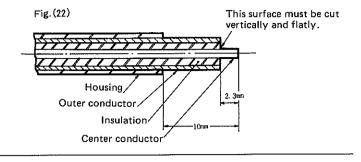

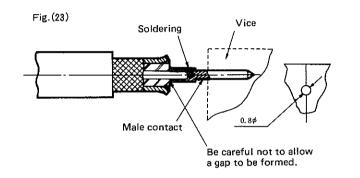

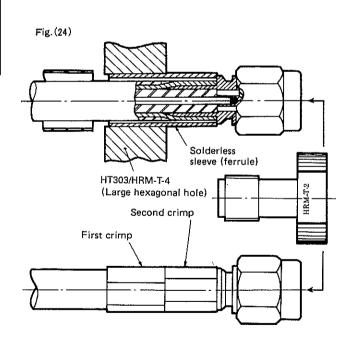

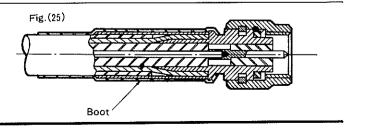




Fig.(26)

tantina.

### 5. HRM-204, 204S, 206, 206S

- (1) Process the cable ends
  - i) Cut off 12.5mm of the outer covering of the cable (RG-142B/U

Next cut off 4.5mm of the outer conductor, and also cut off 2.3mm of the insulation.

- Note 1: When cutting the outer covering and insulation, be careful not to damage the outer conductor and the center conductor.
- Note 2: Cut the cable insulation vertically and flatly.
- Fig.(27)

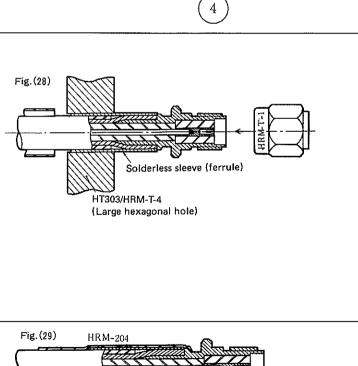
<u>ការប្រែកប្តីការក្តីការក្តីក</u>

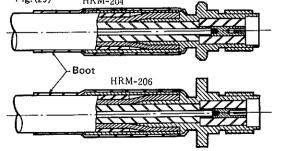
This surface must be finished

vertically and flatly.

(2) Solder the center conductor. Using HRM-T-6, solder the center conductor by the same procedure as in HRM-102 and HRM-103. (Refer to Fig. (27).)


- (3) After passing the boot and ferrule (sleeve) over the cable, insert the cable through the connector-shell cord inlet, and crimp the ferrule (sleeve) in a hexagonal shape with HT303/HRM-T-4 (Refer to Fig. (28).)
  - i) To insert the cable, align the female contact with the hole in the insulation, and insert the connector shell between the insulation of the cable and the outer conductor.
- ii) Insert the ferrule (sleeve) until it strikes against the uneven part of the shell, as shown in Fig. (28), and crimp it in a hexagonal shape with HT303/HRM-T-4
- Note 1: Spread out the tip in order to make it easy to insert the outer conductor of the cable.
- Note 2: Insertion of the cable is finished when the cable insulation strikes against the connector insulation. HRM-T-1 (the locator) is to be fitted in place in order to prevent the connector insulation from moving at this time.
- Note 3: Crimping of the ferrule (sleeve) is performed first on the cable side and next on the connector side, (Be careful about the order; if the wrong order is followed, the clamping force will be reduced by one half.)
- (4) Put on the boot over the ferrule (sleeve), and apply heat with a hair dryer or the like to cause shrinking. When the connection of the wiring is completed, the appearance will be as shown in Fig. (29).
- Note 1: When shrinking, catch the boot on the groove in the shell, as shown in Fig. (29).
- Note 2: Remove HRM-T-1 (the locator) after shrinkage of the boot.





119

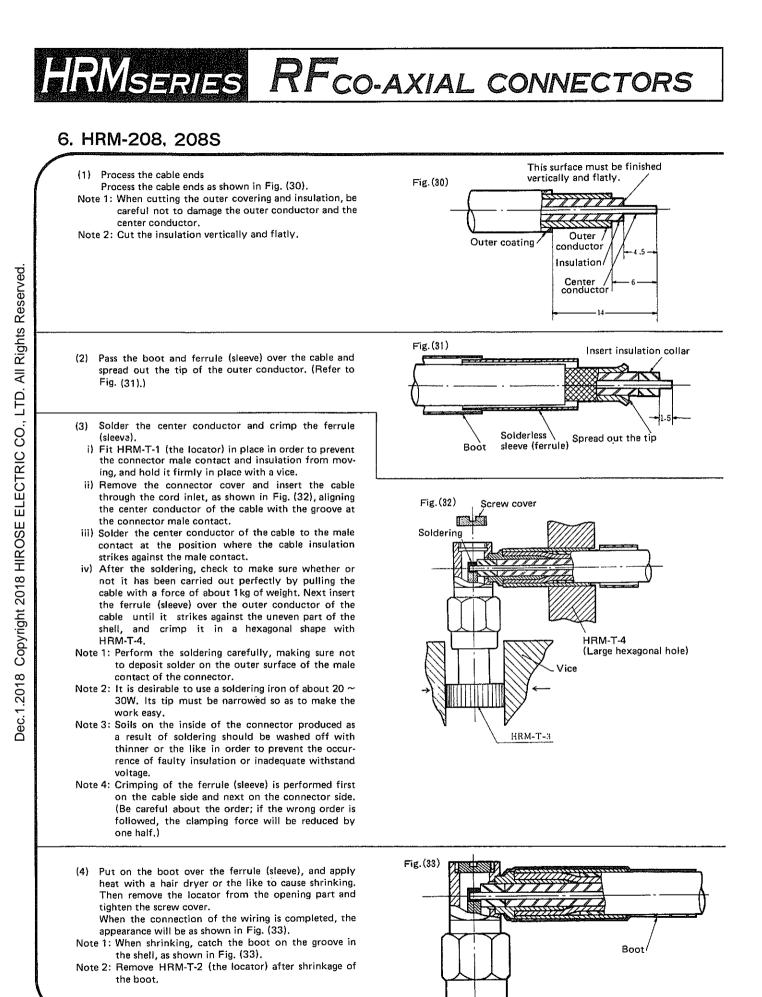..



# **X-ON Electronics**

Largest Supplier of Electrical and Electronic Components

Click to view similar products for Gate Drivers category:

Click to view products by Hirose manufacturer:

Other Similar products are found below :

 00028
 00053P0231
 8967380000
 56956
 CR7E-30DB-3.96E(72)
 57.404.7355.5
 LT4936
 57.904.0755.0
 5801-0903
 5803-0901
 5811-0902

 5813-0901
 58410
 00576P0030
 00581P0070
 5882900001
 00103P0020
 00600P0005
 00-9050-LRPP
 00-9090-RDPP
 5951900000
 01 

 1003W-10/32-15
 LTILA6E-1S-WH-RC-FN12VXCR1
 0131700000
 00-2240
 LTP70N06
 LVP640
 0158-624-00
 5J0-1000LG-SIL
 020017-13

 LY1D-2-5S-AC120
 LY2-0-US-AC120
 LY2-US-AC240
 LY3-UA-DC24
 00-5150
 00576P0020
 00600P0010
 LZNQ2M-US-DC5
 LZNQ2 

 US-DC12
 LZP40N10
 00-8196-RDPP
 00-8274-RDPP
 00-8275-RDNP
 00-8609-RDPP
 00-8722-RDPP
 00-8728-WHPP
 00-8869-RDPP
 00 

 9051-RDPP
 00-9091-LRPP
 00-9291-RDPP
 00-8275-RDNP
 00-8609-RDPP
 00-8722-RDPP
 00-8728-WHPP
 00-8869-RDPP
 00