


This connector requires dslicate and careful handing. Read through the instructions shown below and the connector properly. Each values indicating here are for reference and may differ from standard value. [INSTRUCTIONS FOR MOUNTING ON THE BOARD]


◆ Warp of Board Minmize warp of the board as possible Lead co-planarity including reinforced metal fitting is 0.08mm or less Too much warp of the board may result in a soldering.

 Load to Connector Do not apply a force of 0.5N or more to the connector before mounting it on the board. Otherwise, the connector may be broken. Do not warp the FPC or operate the connector before mounting it.

◆ Load to board °Splitting a large board into seveal pieces *Screwing the board Avoid the handling described above so that no force is exerted on the board during the assembly process. Otherwise, the connector may become defective.

◆ Amount of Warp The warp of a 100-mmwide board should be 0.5mm or less. The warp of board suffers stress on connector and connector may become defective.

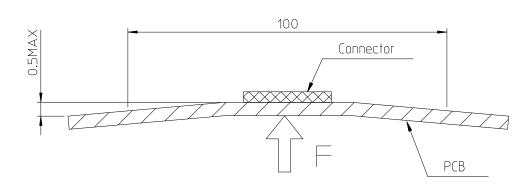


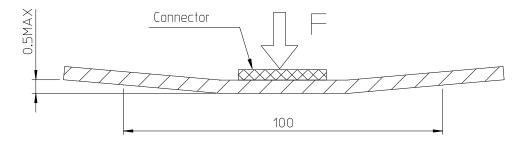


[INSTRUCTIONS ON INSERTING FFC/FPC AND CONNECTOR]

◆ Use of the Actuator


1. Be very careful not to apply excessive force when releasing the Actuator. in the initial position (with no FPC inserted) if you use your nail or finger as shown, the terimals may be deformed.

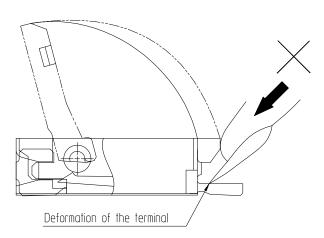



2. The actuator rotates around the rotational axis as shown below. Please rotate the actuator.

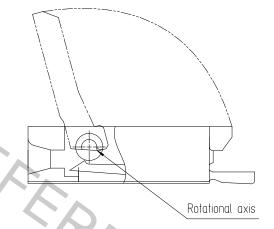

3. Please do not push downwards to the Actuator with more than 0.5N force, as shown below. Otherwise, the Actuator may fall off or be damaged.

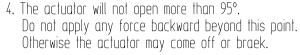

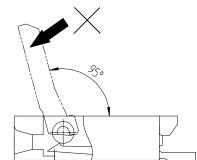

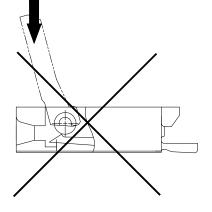

<INSTRUCTION MANUAL(1)>

HSHIROSE KOREA CO.,LTD.


CODE NO CL 6586-0022-0-800

8

7

5. Move the actuator at approximately the center. (It may break if operate the edge of the actuator with FPC inserted.)

6. Do not pinch or pick the actuator to lift it as shown below, Otherwise, it may break. (Do not carry out any operation other than rotating the actuator as shown in 2 above.)

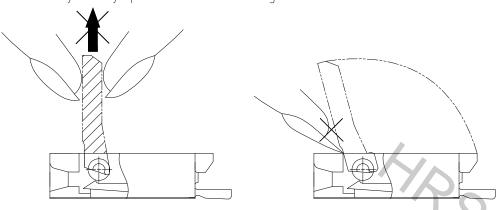

♦ Direction of Contacts

This connector has contacts on the bottom. Thus, insert FPC with the exposed conductors face down.

Inserting the FPC

1. Insert the FPC horizontally along the surface and at a right angle to the connector.

Insert it properly to the very end.


If the FPC is inserted at a slant(incorrectly)

the conductors may short-circuit due to pitch shift or the edge of the FPC may catch in the terminals. resulting in deformation of the terminals.

This connector has a ZIF structure and its effective engagement length is 1.92mm

(when the recommended FPC nominal is used)

Use the actuator carefully to prevent the FPC from dislocating after inserting it.

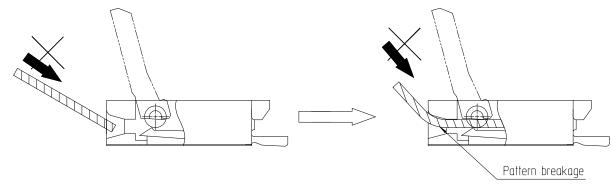

2. Do not insert the FPC diagonally from above If the FPC is inserted at a slat (incorrectly) as shown below in the FPC insertion process, the FPC may bend and patterns may break or the FPC may not insert completely. resulting in improper conduction.

- # Keep a sufficient FPC insertion space in the stage of the layout in order to avoid incorrect FPC insertion. Besodes, it is not difficult to insert FPC correctly at the way to the end. Designed the proper layout of parts.
- # Make adjustments with the FPC manufacturer for bending performance and breakage resistant.
- ♦ Checking the Locking Condition


In the locked condition, make sure that actuator is gorizontal on board surface. Do not apply excessive force to it near the O°position of the actuator. Otherwise, the terminals may be deformed. (Allowable force:1N or less)

<NSTRUCTION MANUAL (2)>

[INSTRUCTION ON FPC LAYOUT AFTER CONNECTOR]


♦ Load to FPC

Be very careful not to apply any force to the FPC after inserting it. Otherwise, the connector may become unlocked or the FPC may break. Fix the FPC, in particular, when loads are applied to it continuously. Design the FPC layout with care not to bend it sharply near the insertion opening.

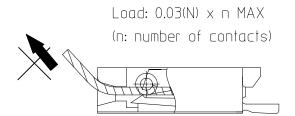

[INSTRUCTIONS ON REMOVING FPC]

• Release the actuator at approximately the center. (It may break if ioerate the edge of the actuator with FPC inserted.)

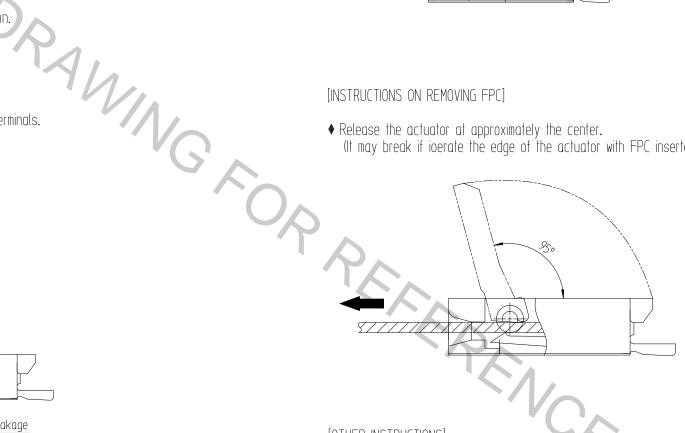

[OTHER INSTRUCTIONS]

♦ Instruction on Manual Soldering

Follow the instructions shown when soldering the connector manually during repair work, etc. 1. Do not perform reflow soldering or manual soldering with the FPC inserted into the connector.

2. Do not heat the connector excessively. Be very careful not to let the soldering iron contact any parts other than connector leads. Otherwise, the connector may be deformed or melt.

3. Do not use excessive solder(or flux)

if excessive solder(or flux) is used on the terminals, solder or flux may adhere to the contacts or rotating parts of the actuator, resulting inpoor contact or a rotation failure of the actuator.

HSHIROSE KOREA CO.,LTD.

CODE NO

CL 6586-0022-0-800

8

7

X-ON Electronics

Largest Supplier of Electrical and Electronic Components

Click to view similar products for FFC & FPC Connectors category:

Click to view products by Hirose manufacturer:

Other Similar products are found below:

K-FC20 FH29B-80S-0.2SHW(99) FPH-2022G AYF332735 52610-1075 52610-1275 52610-1934 501864-3091-TR225 086222026001800 52610-0675 62684-36210E9ALF 52746-1671-TR250 10051922-2810EHLF 6-520415-9 SFV6R-1STE9HLF XF3M-2915-1B-R100 1658549-1 46214008010800 AYF534065TA AYF351525 086212040340800+ AYF530365TA 67000-014LF 67000-004LF 006207341915000+ DS1020-19RT1D 67000-003LF 67000-011LF 67000-016LF HFW14R-2STE9LF SFV32R-2STBE9HLF SFW12R-5STE9LF SFW18R-1STAE9LF SFW4R-5STE9LF 52807-0430 046283021002868+ THD1015-8CL-SN 67000-006LF 502250-8027 104267-9617 66987-011LF AYF362535 F0501-T-50-20T-R HFW8S-2STAE1HLF 67000-008LF 67000-012LF ECC576069EU F1002-B-20-20T-R HFW15S-2STAE1HLF 0781271110