


Model 5307 50 Ω Male BNC Connector and Assembly Instructions



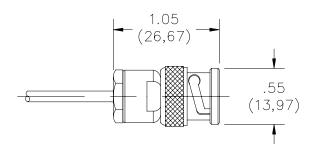

Use Pomona 50 Ω BNC connectors for your favorite custom applications

FEATURES:

- Connector to accept Types RG: 174, 179A, 179B, 187, 187A, 188, 188A and 316/U
- Connector designed to meet interface requirements of MIL-STD-348

MATERIALS:

- Body and Hardware Brass
- Center Contact Gold Plated Brass
- Dielectric PTFE
- Gasket Silicone Rubber
- Body and Hardware Tarnish Resistant Finish
- Center Contact Gold Plated

ORDERING INFORMATION:

Model 5307

RATINGS:

- Operating Voltage: Hands free testing in controlled voltage environment: 500 VRMS Max.
- Nominal Impedance: 50 Ohms

ASSEMBLY INSTRUCTIONS:

See pages 2 and 3.

Sales: Technical Support: 800-490-2361 800-241-2060 Fax: 800-241-2060

888-403-3360 technicalsupport@pomonatest.com



Model 5307 50 Ω Male BNC Connector and Assembly Instructions

ASSEMBLY INSTRUCTIONS



Figure #1

- 1. Cut cable to length and strip per dimensions:
 - outer jacket: 0.320" (8.128 mm)
 - inner conductor: 0.140" (3.556 mm)
- 2. Load the clamp nut, washer and V-Gasket on to the cable as shown in Figure #1.

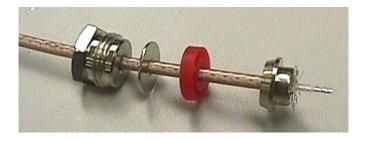


Figure #2

3. Install the braid clamp onto the cable and fold the braid back flat as shown in Figure #2. Make sure that all of the individual strands of braid are flat against the braid clamp.

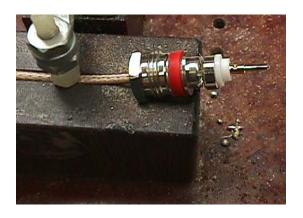


Figure #3

4. Install the metal spacer and rear insulator. Solder the center contact in place. Make sure the contact is completely seated against the rear insulator (see Figure #3).



Figure #4

5. Place the front insulator into the connector housing. The open end of the insulator should face the front of the connector housing (see Figure #4).

 Sales:
 Technical Support:

 800-490-2361
 800-241-2060

 Fax:
 or e-mail us at

888-403-3360 technicalsupport@pomonatest.com

Where to Buy: www.pomonaelectronics.com

All dimensions are in inches. Tolerances (except noted): $.xx = \pm .02"$ (,51 mm), $.xxx = \pm .005"$ (,127 mm). All specifications are to the latest revisions. Specifications are subject to change without notice. Registered trademarks are the property of their respective companies.



Model 5307 50 Ω Male BNC Connector and Assembly Instructions



Figure #5

6. Assemble the cable into the connector housing. Make sure that the center contact goes through the hole in the middle of the front insulator. Screw the clamp nut into the connector housing and torque at 18 to 22 in-lbs. (see Figure #5 for final assembly).

Sales: **Technical Support:** 800-490-2361 800-241-2060 Fax: or e-mail us at

X-ON Electronics

Largest Supplier of Electrical and Electronic Components

Click to view similar products for RF Connectors / Coaxial Connectors category:

Click to view products by Pomona manufacturer:

Other Similar products are found below:

8915-1511-000 89674-0827 6001-7071-019 6002-7051-003 6002-7551-202 6059674-1 619550-1 630059-000 M39030/3-01N M3933/25-36N 6500-7071-046 6769 CX050L2AQ 7002-1542-011 7004-1512-000 7009-1511-004 7010-1511-000 7029-1511-060 7101-1541-010 7101-1571-002 7105-1521-002 7145-1521-002 7203-1571-003 7209-1511-011 7210-1511-015 7210-1511-019 73137-5015 73216-2241 7325-1512-000 73404-2300 7405-1521-005 7405-1521-802 7406-1521-005 8527 8547 FS11V 8808-1511-001 9049-9513-000 9074-9513-000 9101-9573-002 910A205F 9130-9573-002 PL11SC-026 PL375-33 PL40-5 PL71-9 PL74C-221 PL75MC-217 PL803-7 980-8666-005