

Desktop Indoor Air Quality CO₂ Monitor

Measures Carbon Dioxide (CO₂), Air Temperature and Humidity
With user-settable high/low alarms


Features:

- Checks for Carbon Dioxide (CO₂) concentrations
- Maintenance free NDIR (non-dispersive infrared) CO₂ sensor
- Indoor Air Quality displayed in ppm with Good (380 to 420ppm), Normal (<1000ppm), Poor (>1000ppm) indication
- Visible and Audible CO₂ warning alarm with relay output for ventilation control
- Measurement ranges:
 - CO₂: 0 to 9,999ppm
 - Temperature: 14 to 140°F (-10 to 60°C)
 - Humidity: 0.1 to 99.9%RH
- Displays Year, Month, Date, and Time
- Max/Min CO₂ value recall function
- Automatic Baseline Calibration (minimum CO₂ level over 7.5 days) or manual calibration in fresh air
- Complete with Universal AC adaptor



Applications:

- Monitor air quality in schools, office buildings, greenhouses, factories, hotels, hospitals and anywhere that high levels of carbon dioxide are generated

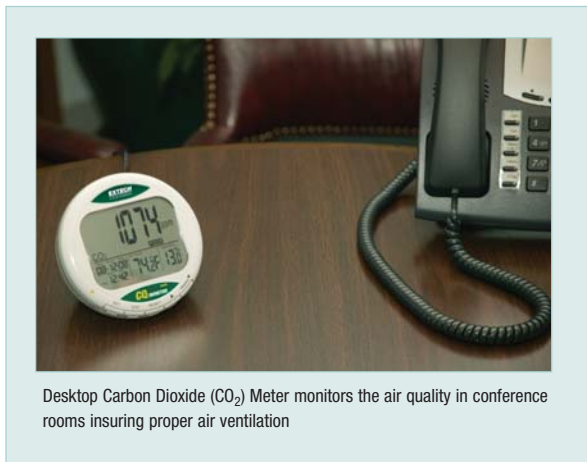

Desktop Carbon Dioxide (CO₂) Meter monitors the air quality in conference rooms insuring proper air ventilation

Specifications	
Carbon Dioxide (CO ₂)	0 to 9,999ppm
Resolution	1ppm
Temperature	14 to 140°F (-10 to 60°C)
Resolution	0.1°F/°C
Humidity	0.1 to 99.9%
Resolution	0.1%
Dimensions	4.6 x 4 x 4" (117 x 102 x 102mm)
Weight	7.2oz (204g)

Ordering Information:

C0200Desktop Indoor Air Quality CO₂ Monitor



X-ON Electronics

Largest Supplier of Electrical and Electronic Components

Click to view similar products for [Environmental Test Equipment](#) category:

Click to view products by [Extech](#) manufacturer:

Other Similar products are found below :

[CW40](#) [F150C10E3DRT](#) [F150LTC20](#) [F150CD10E2](#) [F150L75](#) [F150LRS](#) [S-11](#) [FLUKE-LDG](#) [382153](#) [FM100](#) [RH210](#) [382253](#) [MO290-P](#)
[GEO-CABLE-REEL-50M](#) [T197914](#) [RD300-L](#) [IR11BD](#) [IR11GM](#) [IR12GM](#) [IR21BD](#) [IR31CE](#) [IR32BC](#) [IR33BC](#) [MP7217TC](#) [NGM-1](#) [SGX-](#)
[7NH3](#) [UT381](#) [F150-SLC50](#) [AW-CO-1000](#) [AW-NmHc-100](#) [3.000.401](#) [AX-7535](#) [CS-9S6SS-A](#) [P 2800 A](#) [P 2801](#) [P 2802](#) [P 5039](#) [P 5130](#) [P](#)
[5055](#) [P 5060](#) [P 5065](#) [P 5086](#) [P 5090](#) [P 5110](#) [P 5115](#) [P 5135](#) [P 5140](#) [P 5145](#) [P 5150](#) [P 5160](#)