

LOCTITE[®] 454™

December 2008

PRODUCT DESCRIPTION

LOCTITE[®] 454[™] provides the following product characteristics:

01101101011011	
Technology	Cyanoacrylate
Chemical Type	Ethyl cyanoacrylate
Appearance (uncured)	Clear to slightly cloudy gel ^{LMS}
Components	One part - requires no mixing
Viscosity	High, thixotropic
Cure	Humidity
Application	Bonding
Key Substrates	Wood, Paper, Leather and Fabric

LOCTITE[®] 454™ is designed for the assembly of difficult-to-bond materials which require uniform stress distribution and strong tension and/or shear strength. The product provides rapid bonding of a wide range of materials, including metals, plastics and elastomers. LOCTITE[®] 454™ is particularly suited for bonding porous or absorbent materials such as wood, paper, leather and fabric. The gel consistency prevents adhesive flow even on vertical surfaces.

TYPICAL PROPERTIES OF UNCURED MATERIAL

Specific Gravity @ 25 °C 1.1

Flash Point - See MSDS

Casson Viscosity, 25 °C, mPa·s (cP):

Cone and plate rheometer 100 to 300^{LMS}

Viscosity, Brookfield - RVT, 25 °C, mPa·s (cP):

Spindle TC, speed 2.5 rpm, Helipath *100,000 to 300,000^{LMS} Spindle TC, speed 20 rpm, Helipath *18,000 to 40,000^{LMS}

* Applies to material made in N. America

TYPICAL CURING PERFORMANCE

Under normal conditions, the atmospheric moisture initiates the curing process. Although full functional strength is developed in a relatively short time, curing continues for at least 24 hours before full chemical/solvent resistance is developed.

Cure Speed vs. Substrate

The rate of cure will depend on the substrate used. The table below shows the fixture time achieved on different materials at 22 $^{\circ}\text{C}$ / 50 % relative humidity. This is defined as the time to develop a shear strength of 0.1 N/mm² .

Fixture Time, seconds:

Steel	60 to 210
Aluminum	3 to 10
Zinc dichromate	5 to 20
Neoprene	15 to 20
Rubber, nitrile	5 to 15
ABS	3 to 10
PVC	5 to 10
Polycarbonate	5 to 10
Phenolic	5 to 30

Wood (balsa)	<3
Wood (oak)	30 to 45
Wood (pine)	45 to 60
Chipboard	5 to 15
Fabric	15 to 30
Leather	105 to 150
Paper	7 to 15

Cure Speed vs. Bond Gap

The rate of cure will depend on the bondline gap. Thin bond lines result in high cure speeds, increasing the bond gap will decrease the rate of cure.

Cure Speed vs. Humidity

The rate of cure will depend on the ambient relative humidity. The best results are achieved when the relative humidity in the working environment is 40% to 60% at 22°C. Lower humidity leads to slower cure. Higher humidity accelerates it, but may impair the final strength of the bond.

Cure Speed vs. Activator

Where cure speed is unacceptably long due to large gaps, applying activator to the surface will improve cure speed. However, this can reduce ultimate strength of the bond and therefore testing is recommended to confirm effect.

TYPICAL PROPERTIES OF CURED MATERIAL

Cured for 1 week @ 22 °C

Coefficient of Thermal Expansion.

Physical Properties:

ISO 11359-2. K ⁻¹	
Coefficient of Thermal Conductivity, ISO 8302,	0.3
W/(m·K)	
Glass Transition Temperature ISO 11359-2 °C	137

Electrical Properties:

10 MHz

volume Resistivity, IEC 60093, Q-cm	1.0×10.0
Surface Resistivity, IEC 60093, Ω	57×10 ¹⁵
Dielectric Breakdown Strength,	25
IEC 60243-1, kV/mm	
Dielectric Constant / Dissipation Factor, IEC 60250	
1 kHz	3.6 / 0.04
1 MHz	3.0 / 0.11

TYPICAL PERFORMANCE OF CURED MATERIAL Adhesive Properties

, tancon o i roportico

Cured for 30 seconds @ 22 °C Tensile Strength, ISO 6922:

Buna-N N/mm² ≥6.0^{LMS} (psi) (≥870)



145×10⁻⁶

2.5 / 0.36


Cured for 72 hours @ 22 °C Tensile Strength, ISO 6922: Buna-N		7 to 17 (1,000 to 2,500)
Steel	,	10 to 16
Lap Shear Strength, ISO 4587:		
Steel (grit blasted)	N/mm² (psi)	
Aluminum (etched)		4 to 10 (580 to 1,500)
Zinc dichromate	N/mm²	, ,
ABS	N/mm²	• •
PVC	N/mm²	, ,
Phenolic	N/mm²	, ,
Polycarbonate	N/mm²	8 to 11
Nitrile		0.5 to 1.5
Neoprene	(psi) N/mm² (psi)	` ,

TYPICAL ENVIRONMENTAL RESISTANCE

Cured for 1 week @ 22 °C Lap Shear Strength, ISO 4587: Steel (grit blasted)


Hot Strength

Tested at temperature

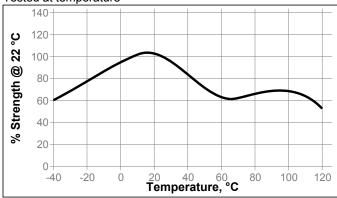

Heat Aging

Aged at temperature indicated and tested @ 22 °C

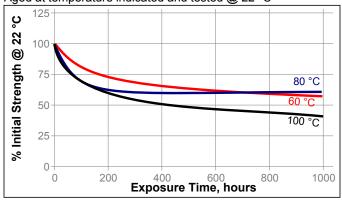

Chemical/Solvent Resistance

Aged under conditions indicated and tested @ 22 °C.

		% of initial strength		
Environment	°C	100 h	500 h	1000 h
Motor oil	40	95	75	65
Unleaded gasoline	22	85	80	80
Ethanol	22	85	85	90
Isopropanol	22	100	110	105
Water	22	80	80	70
98% RH	40	70	40	40

Lap Shear Strength, ISO 4587: Polycarbonate

		% of initial strength		
Environment	°C	100 h	500 h	1000 h
Air	22	105	110	120
98% RH	40	105	115	120

GENERAL INFORMATION

This product is not recommended for use in pure oxygen and/or oxygen rich systems and should not be selected as a sealant for chlorine or other strong oxidizing materials

For safe handling information on this product, consult the Material Safety Data Sheet (MSDS).

Directions for use:

- Bond areas should be clean and free from grease. Clean all surfaces with a Loctite[®] cleaning solvent and allow to dry
- Loctite[®] Primer may be applied to the bond area. Avoid applying excess Primer. Allow the Primer to dry.
- 3. LOCTITE[®] Activator may be used if necessary. Apply the LOCTITE[®] Activator to one bond surface (do not apply activator to the primed surface where Primer is also used). Allow the Activator to dry.
- 4. Apply adhesive to one of the bond surfaces (do not apply the adhesive to the activated surface). Do not use items like tissue or a brush to spread the adhesive. Assemble the parts within a few seconds. The parts should be accurately located, as the short fixture time leaves little opportunity for adjustment.
- 5. LOCTITE[®] Activator can be used to cure fillets of product outside the bond area. Spray or drop the activator on the excess product.
- Bonds should be held fixed or clamped until adhesive has fixtured.
- Product should be allowed to develop full strength before subjecting to any service loads (typically 24 to 72 hours after assembly, depending on bond gap, materials and ambient conditions).

Loctite Material Specification^{LMS}

LMS dated November 21, 2002. Test reports for each batch are available for the indicated properties. LMS test reports include selected QC test parameters considered appropriate to specifications for customer use. Additionally, comprehensive controls are in place to assure product quality and consistency. Special customer specification requirements may be coordinated through Henkel Quality.

Storage

Store product in the unopened container in a dry location. Storage information may be indicated on the product container labeling

Optimal Storage: 2 °C to 8 °C. Storage below 2 °C or greater than 8 °C can adversely affect product properties. Material removed from containers may be contaminated during use. Do not return product to the original container. Henkel Corporation cannot assume responsibility for product which has been contaminated or stored under conditions other than those previously indicated. If additional information is required, please contact your local Technical Service Center or Customer Service Representative.

Conversions

(°C x 1.8) + 32 = °F kV/mm x 25.4 = V/mil mm / 25.4 = inches μ m / 25.4 = mil N x 0.225 = lb N/mm x 5.71 = lb/in N/mm² x 145 = psi MPa x 145 = psi N·m x 8.851 = lb·in N·m x 0.738 = lb·ft N·mm x 0.142 = oz·in mPa·s = cP

Note

The data contained herein are furnished for information only and are believed to be reliable. We cannot assume responsibility for the results obtained by others over whose methods we have no control. It is the user's responsibility to determine suitability for the user's purpose of any production methods mentioned herein and to adopt such precautions as may be advisable for the protection of property and of persons against any hazards that may be involved in the handling and use thereof. In light of the foregoing, Henkel Corporation specifically disclaims all warranties expressed or implied, including warranties of merchantability or fitness for a particular purpose, arising from sale or use of Henkel Corporation's products. Henkel Corporation specifically disclaims any liability for consequential or incidental damages of any kind, including lost profits. The discussion herein of various processes or compositions is not to be interpreted as representation that they are free from domination of patents owned by others or as a license under any Henkel Corporation patents that may cover such processes or compositions. We recommend that each prospective user test his proposed application before repetitive use, using this data as a guide. This product may be covered by one or more United States or foreign patents or patent applications.

Trademark usage

Except as otherwise noted, all trademarks in this document are trademarks of Henkel Corporation in the U.S. and elsewhere. [®] denotes a trademark registered in the U.S. Patent and Trademark Office.

Reference 2.2

X-ON Electronics

Largest Supplier of Electrical and Electronic Components

Click to view similar products for loctite manufacturer:

Other Similar products are found below:

37684 2257357 2139180 LOC-MIKSER2 406 5366, 310ML 603, 10ML 403, 50G 2472691 2701, 50ML 542, 250ML 572, 50ML 3526 8106, 1L 5800, 50ML MM01057 1188112 LOC-5615/400ML 97262 983438 3463, 114G 2700, 50ML 648, 50ML 40945 MM01056 386862 984569 5400, 50ML 5990, 40ML SUPERLUBE OIL, 375ML MM01939 290 98472 GC 10 TYPE 3 (JAR) 660, 50ML SUPER GLUE GLASS, 3G LOC-MIKSER 6300, 50ML 2023641 LT 5075 GC 10 TYPE 4 (JAR) 495, 50G 243, 250ML LOC-638-10 641, 10ML 496, 50G 2472659 98473 5660, 40ML 4080, 50G