


# MK16 Series Reed Sensors

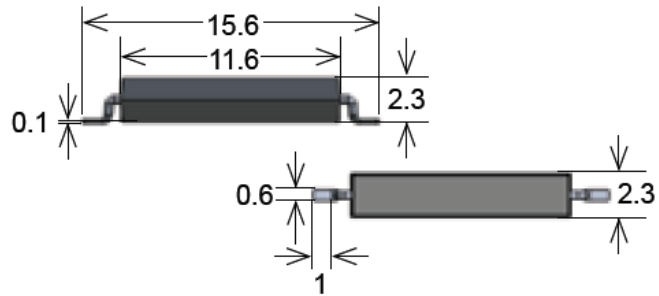

- Features: Supplied in Tape & Reel, Axial or Gull-Wing Lead, Excellent for Low Power Operations
- Applications: On/Off Control Switch, Position Detection, Switching Element in Microphones & Others
- Markets: Appliance, Telecommunication, Security, Medical & Others

Part Description: **MK 16-0-X**

<b>Magnetic Sensitivity</b>	<b>Lead Design</b>
B, C, D, E	1, 2

Customer Options	Switch Model	Unit
<b>Contact Data</b>	<b>87</b>	
<b>Rated Power (max.)</b> <small>Any DC combination of V&amp;A not to exceed their individual max.'s</small>	10	W
<b>Switching Voltage (max.)</b> <small>DC or peak AC</small>	200	V
<b>Switching Current (max.)</b> <small>DC or peak AC</small>	0.4	A
<b>Carry Current (max.)</b> <small>DC or peak AC</small>	0.5	A
<b>Contact Resistance (max.)</b> <small>@ 0.5V &amp; 50mA</small>	150	mOhm
<b>Breakdown Voltage (min.)</b> <small>According to EN60255-5</small>	0.23	kVDC
<b>Operating Time (max.)</b> <small>Incl. Bounce; Measured with w/ Nominal Voltage</small>	0.6	ms
<b>Release Time (max.)</b> <small>Measured with no Coil Excitation</small>	0.05	ms
<b>Insulation Resistance (typ.)</b> <small>Rh&lt;45%, 100V Test Voltage</small>	10 <sup>9</sup>	GOhm
<b>Capacitance (typ.)</b> <small>@ 10kHz across open Switch</small>	0.2	pF

Series Datasheet – MK16 Reed Sensors


www.standexmeder.com

Housing and Lead Specifications	
Housing Material	Mineral Filled Epoxy
Case Color	Black
Lead design 1	Flat, straight leads for PCB slot mounting
Lead design 2	Flat, bent SMD leads

Environmental Data		Unit
Shock Resistance (max.) 1/2 sine wave duration 11ms	30	g
Vibration Resistance (max.)	20	g
Operating Temperature	-40 to 130	°C
Storage Temperature	-50 to 130	°C
Soldering Temperature (max.) 5 sec. max.	260	°C

Glossary Contact Form		
Form A	NO = Normally Open Contacts SPST = Single Pole Single Throw	
Form B	NC = Normally Closed Contacts SPST = Single Pole Single Throw	
Form C	Changeover SPDT = Single Pole Double Throw	

Glossary Magnetic Sensitivity							
Sens.	A	B	C	D	E	F	G
AT	05-10	10-15	15-20	20-25	25-30	30-35	35-40

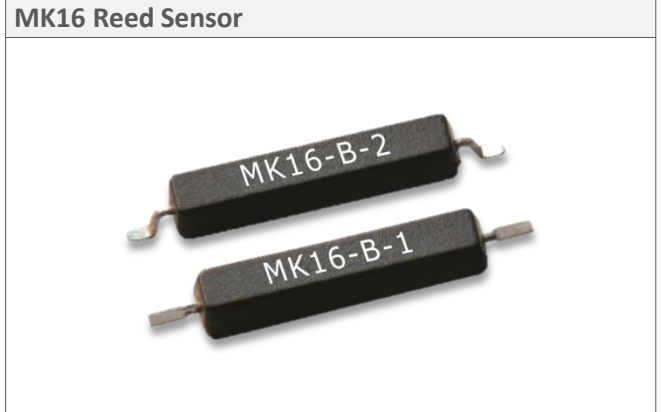

**Handling & Assembly Instructions**

- Use proper lead clamping or heat sinking techniques to prevent mechanical and/or heat stress during, soldering, and welding
- Mechanical shock as the result of dropping the reed sensor typically from a distance of greater than 12" may change it's magnetic sensitivity and/or destroy the sensor

