

Pmod CMPS2™ Reference Manual


Revised July 19, 2017
This manual applies to the Pmod CMPS2 rev. A

Table of Contents

Table of Contents	1
Overview.....	2
1 Specifications.....	2
1.1 Pinout Table Diagram.....	3
1.2 Physical Dimensions	3
2 Functional Description	3
2.1 Serial Communication	3
2.2 Register Details.....	3
2.2.1 Data Registers	3
2.2.2 Status Register	4
2.2.3 Internal Control Registers	4
2.2.4 Continuous Measurement Mode.....	5
2.2.5 Output Resolution Measurement Time.....	5
2.3 Quick Start.....	5
2.4 Applications Information.....	7
2.4.1 Calibration.....	7
2.4.2 Data Conversion.....	11
2.5 Timing Diagrams.....	12

Overview

The Digilent Pmod CMPS2 is a 3 axis anisotropic magneto-resistive sensor. With Memsic's MMC34160PJ, the local magnetic field strength in a ± 16 Gauss range with a heading accuracy of 1° and up to 0.5 mG of resolution.

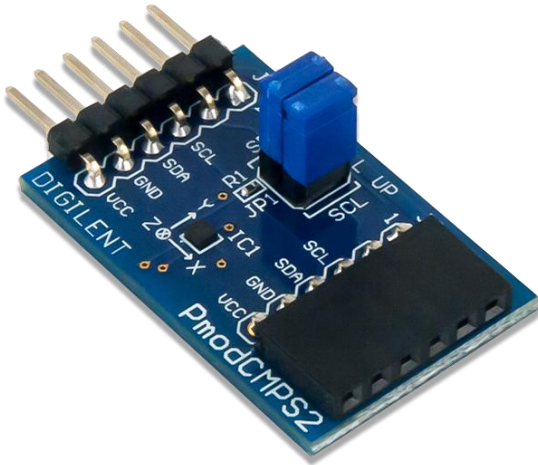

The Pmod CMPS2.

Features include:

- Low noise 3-axis Digital Compass
- 0.5 mG Field Resolution in ± 16 Gauss fields
- I²C Slave, FAST (≤ 400 kHz) mode
- Optional pull-up resistors for SCL and SDA pins
- $\pm 1^\circ$ heading accuracy
- Small PCB size for flexible designs 0.8" \times 1.25" (2.0 cm \times 3.2 cm)
- 6-pin Pmod connector with I²C serial interface
- Pass-through Pmod host port for daisy chaining
- Follows Digilent [Pmod Interface Specification 1.1.0](#)
- Library and example code in the Pmod CMPS2 [Resource Center](#)

1 Specifications

Parameter	Min	Typical	Max	Units
Power Supply Voltage	1.62	1.8	3.6	V
Output Resolution	12	14	16	bits
Alignment Error	-3	± 1	+3	Degrees
Parameter	Condition	Value	Units	
Total RMS Noise	16 bits at 7.92 ms/S	1.5	mG	
Total RMS Noise	16 bits at 4.08 ms/S	2.0	mG	
Total RMS Noise	14 bits at 2.16 ms/S	4.0	mG	
Total RMS Noise	12 bits at 1.20 ms/S	6.0	mG	
Max Output Data Rate	16 bits at 7.92 ms/S	125	Hz	
Max Output Data Rate	16 bits at 4.08/S	250	Hz	
Max Output Data Rate	14 bits at 2.16 ms/S	450	Hz	
Max Output Data Rate	12 bits at 1.20 ms/S	800	Hz	
Parameter	Value	Units		
Field Range for Each Axis	± 16	G		

1.1 Pinout Table Diagram

Header J1			Header J2			Jumper JP1		
Pin	Signal	Description	Pin	Signal	Description	Pin	Status	Description
1	N/C	Not Connected	1	N/C	Not Connected	SCL	Loaded	4.7 kΩ Pullup to Vcc
2	N/C	Not Connected	2	N/C	Not Connected	SCL	Unloaded	No Pullup to Vcc
3	SCL	Serial Clock	3	SCL	Serial Clock	SDA	Loaded	4.7 kΩ Pullup to Vcc
4	SDA	Serial Data	4	SDA	Serial Data	SDA	Unloaded	No Pullup to Vcc
5	GND	Power Supply Ground	5	GND	Power Supply Ground			
6	VCC	Power Supply (3.3V)	6	VCC	Power Supply (3.3V)			

1.2 Physical Dimensions

The pins on the pin header are spaced 100 mil apart. The PCB is 1.25 inches long on the sides parallel to the pins on the pin header and 0.8 inches long on the sides perpendicular to the pin header.

2 Functional Description

The Pmod CMPS2 utilizes the MMC34160PJ to collect magnetic field data. While communicating with the host board via the [I²C protocol](#) using an I²C address of 0x0110000/ users can measure the ±16 G field surrounding the device.

2.1 Serial Communication

The Pmod CMPS2 communicates with the host board via the I²C protocol. By first sending the 7-bit I²C device address of 0110000 and then a read/write bit (high/low logic level, respectively), followed by the register address of interest at a maximum clock frequency of 400 kHz users can both configure and read from the Pmod CMPS2. An additional set of pins on header J2 is provided so that users may daisy chain the Pmod CMPS2 with other I²C devices.

2.2 Register Details

2.2.1 Data Registers

Each Cartesian axis has two registers to store the high and low data bytes for each measurement. The data registers are arranged in a low byte, high byte arrangement.

Data Registers addresses 0x00 to 0x05	
Address	Register Name
0x00	X out LSB
0x01	X out MSB

Data Registers addresses 0x00 to 0x05	
Address	Register Name
0x02	Y out LSB
0x03	Y out MSB
0x04	Z out LSB
0x05	Z out MSB

2.2.2 Status Register

Bit Name	Bit Number	Bit Description	Bit Values	Functional Description
RSV	[7]	Reserved	0 ¹	Reserved Bit
RSV	[6]	Reserved	0 ¹	Reserved Bit
RSV	[5]	Reserved	0 ¹	Reserved Bit
RSV	[4]	Reserved	0 ¹	Reserved Bit
ST_XYZ_OK	[3]	ST_XYZ_OK	0 ¹	Indicates that the selftest was OK when this bit is a "1"
Rd_Done	[2]	Rd_Done	0 ¹	Indicates that chip was successfully able to read its memory.
Pump On	[1]	Pump On	0 ¹	This bit indicates the status of the charge pump.
RSV	[0]	Meas Done	0 ¹	Indicates that a measurement event is completed.

2.2.3 Internal Control Registers

Internal Control 0				
Bit Name	Bit Number	Bit Description	Bit Values	Functional Description
Refill Cap	[7]	Refill Cap	0 ¹	Setting this bit will recharge the capacitor at the CAP pin, it is requested to be issued before the SET/RESET command
RST	[6]	Reset Sensor	0 ¹	Setting this bit will reset the sensor
SET	[5]	Set Sensor	0 ¹	Setting this bit will set the sensor
No Boost	[4]	No boost	0 ¹	Disable the charge pump
CM Freq1 ²	[3]	Continuous Measurement bit 1	0 ¹	Controls the continuous measurement rate of the chip
CM Freq0 ²	[2]	Continuous Measurement bit 0	0 ¹	Controls the continuous measurement rate of the chip
Cont Mode On	[1]	Continuous Measurement Mode	0 ¹	Setting this bit enables Continuous Measurement Mode
TM	[0]	Take Measurement	0 ¹	Setting this bit will initiate a reading

Internal Control 1				
Bit Name	Bit Number	Bit Description	Bit Values	Functional Description
RST	[7]	Software reset bit	0 ¹	Normal Operation, this bit self clears
TEMP-tst	[6]	Temp test	0 ¹	Factory-use register
ST_XYZ	[5]	Selftest check	0 ¹	Set this bit an execute TM command, the result can be read as bit ST-XYZ_OK
Z-inhibit	[4]	Z-inhibit	0 ¹	Factory-use register
Y-inhibit	[3]	Y-inhibit	0 ¹	Factory-use register
X-inhibit	[2]	X-inhibit	0 ¹	Factory-use register
BW1 ³	[1]	Bandwidth bit	0 ¹	Controls the output resolution and measurement time
BW0 ³	[0]	Bandwidth bit	0 ¹	Controls the output resolution and measurement time

Notes:

¹ - This is the value on power-up and reset

² - For more details see the Continuous Measurement Mode section

³ - For more details see the Output Resolution and Measurement Time section

2.2.4 Continuous Measurement Mode

Continuous Measurement Mode Settings		
CM Freq1	CM Freq0	Frequency
0	0	1.5 Hz
0	1	13 Hz
1	0	25 Hz
1	1	50 Hz

2.2.5 Output Resolution Measurement Time

Bandwidth Output Resolution and Measurement Time			
BW1	BW0	Output Resolution	Measurement Time
0	0	16 bits	7.92 mS
0	1	16 bits	4.08 mS
1	0	14 bits	2.16 mS
1	1	12 bits	1.20 mS

2.3 Quick Start

Here is the series of commands to acquire a set of magnetometer data from the Pmod CMPS2 via pseudo I²C code.

1. Power on the Pmod CMPS2 and wait for 10 mS before further operation.
2. Provide a START condition and call the device ID with a write bit

```
I2CBegin(0xA0); //device ID 0x30 with a write (0) bit
```

3. Wait to receive an ACK from the Pmod CMPS2.
4. Send the Internal Control Register 0 (address 0x07) as the register to communicate with

```
I2CWrite(0x07); //address 0x07 corresponds to Control Register 0
```

5. Wait to receive an ACK from the Pmod CMPS2.
6. Write the command to take a measurement by setting bit 0 high followed by a STOP bit.

```
I2CWrite(0x01); //0x01 initiates a data acquisition
```

7. Delay at least 7.92 mS by default to allow the Pmod CMPS2 to finish collecting data.
8. Provide a START condition and call the device ID with a write bit

```
I2CBegin(0xA0); //device ID 0x30 with a write (0) bit
```

9. Wait to receive an ACK from the Pmod CMPS2.
10. Send the Status Register (0x03) as the register to read

```
I2CWrite(0x03); //indicate you wish to interact with address 0x03
```

11. Provide a START condition and call the device ID with a read bit

```
I2CBegin(0xA1); //device ID 0x30 with a read (1) bit
```

12. Wait to receive an ACK from the Pmod CMPS2.
13. Cycle the SCL line to receive the Status Register data on the SDA line. Keep reading the Status Register by repeating steps 8 through 13 until bit 0 is set to '1', indicating that the data on all 3 axes as available to be read.
14. Provide a START condition and call the device ID with a write bit

```
I2CBegin(0xA0); //device ID 0x30 with a write (0) bit
```

15. Wait to receive an ACK from the Pmod CMPS2.
16. Send the first register address corresponding to Xout LSB (0x00) as the register to be read.

```
I2CWrite(0x00); //address 0x00 as the first register to be read
```

17. Provide a START condition and call the device ID with a read bit

```
I2CBegin(0xA1); //device ID 0x30 with a read (1) bit
```

18. Wait to receive an ACK from the Pmod CMPS2.
19. Cycle the SCL line to receive the data bits from the X, Y, and Z registers in the SDA line, providing an ACK between each data byte. The Pmod CMPS2 address pointer automatically moves to each consecutive byte. End the communication by sending a NACK followed by a STOP command.

```
I2CReadMultiple(6); //read six bytes, sending an ACK to the slave device between each byte received and a NACK after the last byte
```

20. Convert the readings into usable data. More details are available in the Data Conversion section.
21. Wait 1/3 of the acquisition time (by default 2.64 ms) before performing another measurement.

2.4 Applications Information

The Pmod CMPS2 is an ideal Pmod to use as a compass. Like all compasses, it is recommended that the Pmod CMPS2 is calibrated before using the module.

2.4.1 Calibration

To calibrate the magnetometer, the offset associated with the magnetic sensors and the environment needs to be calculated and removed from future measurements.

The internal offset can be calculated and accounted for through the following method:

1. Power on the Pmod CMPS2 and wait for 10 mS before further operation.
2. Provide a START condition and call the device ID with a write bit

```
I2CBegin(0xA0); //device ID 0x30 with a write (0) bit
```

3. Wait to receive an ACK from the Pmod CMPS2.
4. Send the Internal Control Register 0 (address 0x07) as the register to communicate with

```
I2CWrite(0x07); //address 0x07 corresponds to Control Register 0
```

5. Wait to receive an ACK from the Pmod CMPS2.
6. Write the command to recharge the capacitor to prepare for the SET action.

```
I2CWrite(0x80); //0x80 refills the capacitor
```

7. Wait to receive an ACK from the Pmod CMPS2.
8. Delay at least 50 mS to allow the Pmod CMPS2 to finish preparing.
9. Provide a START condition and call the device ID with a write bit

```
I2CBegin(0xA0); //device ID 0x30 with a write (0) bit
```

10. Wait to receive an ACK from the Pmod CMPS2.
11. Send the Internal Control Register 0 (address 0x07) as the register to communicate with

```
I2CWrite(0x07); //address 0x07 corresponds to Control Register 0
```

12. Wait to receive an ACK from the Pmod CMPS2.
13. Write the command to start a SET action.

```
I2CWrite(0x20); //0x20 starts the SET action
```

14. Wait to receive an ACK from the Pmod CMPS2.
15. Delay at least 1 mS to allow the Pmod CMPS2 to finish the SET action.
16. Provide a START condition and call the device ID with a write bit

```
I2CBegin(0xA0); //device ID 0x30 with a write (0) bit
```

17. Wait to receive an ACK from the Pmod CMPS2.
18. Send the Internal Control Register 0 (address 0x07) as the register to communicate with

```
I2CWrite(0x07); //address 0x07 corresponds to Control Register 0
```

19. Wait to receive an ACK from the Pmod CMPS2.
20. Write the command to take a measurement by setting bit 0 high followed by a STOP bit.

```
I2CWrite(0x01); //0x01 initiates a data acquisition
```

21. Delay at least 7.92 mS by default to allow the Pmod CMPS2 to finish collecting data.
22. Provide a START condition and call the device ID with a write bit

```
I2CBegin(0xA0); //device ID 0x30 with a write (0) bit
```

23. Wait to receive an ACK from the Pmod CMPS2.
24. Send the Status Register (0x03) as the register to read

```
I2CWrite(0x03); //indicate you wish to interact with address 0x03
```

25. Provide a START condition and call the device ID with a read bit

```
I2CBegin(0xA1); //device ID 0x30 with a read (1) bit
```

26. Wait to receive an ACK from the Pmod CMPS2.
27. Cycle the SCL line to receive the Status Register data on the SDA line. Keep reading the Status Register by repeating steps 8 through 13 until bit 0 is set to '1', indicating that the data on all 3 axes as available to be read.
28. Provide a START condition and call the device ID with a write bit

```
I2CBegin(0xA0); //device ID 0x30 with a write (0) bit
```

29. Wait to receive an ACK from the Pmod CMPS2.
30. Send the first register address corresponding to Xout LSB (0x00) as the register to be read.

```
I2CWrite(0x00); //address 0x00 as the first register to be read
```

31. Provide a START condition and call the device ID with a read bit


```
I2CBegin(0xA1); //device ID 0x30 with a read (1) bit
```

32. Wait to receive an ACK from the Pmod CMPS2.
33. Cycle the SCL line to receive the data bits from the X, Y, and Z registers in the SDA line, providing an ACK between each data byte. The Pmod CMPS2 address pointer automatically moves to each consecutive byte. End the communication by sending a NACK followed by a STOP command.

```
I2CReadMultiple(6); //read six bytes, sending an ACK to the slave device between each byte received and a NACK after the last byte
```

34. Each of the readings will contain the external magnetic field H in addition to offset associated with the current put through the coil by the SET action.

$$\text{Output1} = +H + \text{Offset}$$

35. Now a RESET action will be performed to reverse the magnetization for the sensing resistors to get the inverse offset value.
36. Provide a START condition and call the device ID with a write bit

```
I2CBegin(0xA0); //device ID 0x30 with a write (0) bit
```

37. Wait to receive an ACK from the Pmod CMPS2.
38. Send the Internal Control Register 0 (address 0x07) as the register to communicate with

```
I2CWrite(0x07); //address 0x07 corresponds to Control Register 0
```

39. Wait to receive an ACK from the Pmod CMPS2.
40. Write the command to recharge the capacitor to prepare for the RESET action.

```
I2CWrite(0x80); //0x80 refills the capacitor
```

41. Wait to receive an ACK from the Pmod CMPS2.
42. Delay at least 50 mS to allow the Pmod CMPS2 to finish preparing.
43. Provide a START condition and call the device ID with a write bit

```
I2CBegin(0xA0); //device ID 0x30 with a write (0) bit
```

44. Wait to receive an ACK from the Pmod CMPS2.
45. Send the Internal Control Register 0 (address 0x07) as the register to communicate with

```
I2CWrite(0x07); //address 0x07 corresponds to Control Register 0
```

46. Wait to receive an ACK from the Pmod CMPS2.
47. Write the command to start a RESET action.

```
I2CWrite(0x40); //0x40 starts the RESET action
```

48. Wait to receive an ACK from the Pmod CMPS2.
49. Delay at least 1 mS to allow the Pmod CMPS2 to finish the SET action.

50. Provide a START condition and call the device ID with a write bit

```
I2CBegin(0xA0); //device ID 0x30 with a write (0) bit
```

51. Wait to receive an ACK from the Pmod CMPS2.
52. Send the Internal Control Register 0 (address 0x07) as the register to communicate with

```
I2CWrite(0x07); //address 0x07 corresponds to Control Register 0
```

53. Wait to receive an ACK from the Pmod CMPS2.
54. Write the command to take a measurement by setting bit 0 high followed by a STOP bit.

```
I2CWrite(0x01); //0x01 initiates a data acquisition
```

55. Delay at least 7.92 mS by default to allow the Pmod CMPS2 to finish collecting data.
56. Provide a START condition and call the device ID with a write bit

```
I2CBegin(0xA0); //device ID 0x30 with a write (0) bit
```

57. Wait to receive an ACK from the Pmod CMPS2.
58. Send the Status Register (0x03) as the register to read

```
I2CWrite(0x03); //indicate you wish to interact with address 0x03
```

59. Provide a START condition and call the device ID with a read bit

```
I2CBegin(0xA1); //device ID 0x30 with a read (1) bit
```

60. Wait to receive an ACK from the Pmod CMPS2.
61. Cycle the SCL line to receive the Status Register data on the SDA line. Keep reading the Status Register by repeating steps 8 through 13 until bit 0 is set to '1', indicating that the data on all 3 axes as available to be read.
62. Provide a START condition and call the device ID with a write bit

```
I2CBegin(0xA0); //device ID 0x30 with a write (0) bit
```

63. Wait to receive an ACK from the Pmod CMPS2.
64. Send the first register address corresponding to Xout LSB (0x00) as the register to be read.

```
I2CWrite(0x00); //address 0x00 as the first register to be read
```

65. Provide a START condition and call the device ID with a read bit

```
I2CBegin(0xA1); //device ID 0x30 with a read (1) bit
```

66. Wait to receive an ACK from the Pmod CMPS2.

67. Cycle the SCL line to receive the data bits from the X, Y, and Z registers in the SDA line, providing an ACK between each data byte. The Pmod CMPS2 address pointer automatically moves to each consecutive byte. End the communication by sending a NACK followed by a STOP command.

```
I2CReadMultiple(6); //read six bytes, sending an ACK to the slave device between each byte received and a NACK after the last byte
```

68. Each of the readings will contain the external magnetic field H in addition to offset associated with the current put through the coil by the RESET action.

$$Output2 = -H + Offset$$

69. The offset associated with the device can be calculated and then subtracted from future measurements to obtain the actual magnetic field.

$$Offset = Output1 + \frac{Output2}{2}$$

The other method of calibration is to remove the hard iron bias introduced to the magnetometer by the surrounding environment by measuring (either continually or for a set time) all of the possible magnetometer readings in a Cartesian sphere and keep track of the highest and lowest readings for each axis. The offset can then be calculated in the same fashion as described above with the SET and RESET actions. The advantage of this method is when the Pmod CMPS2 is continually changing locations or when other external magnetic fields may be introduced into the test environment.

2.4.2 Data Conversion

The Memsic MMC34160PJ provides data for each axis in units of Gauss, but the information is generally more legible when presented as a compass heading. The method for converting Gauss units to a compass heading is provided below.

1. Calculate the real Gauss value for the X and Y axes from the amount of LSBs returned where the LSB value by default is 0.48828125 mG, resulting in 2048 LSBs per Gauss.

$$xGaussData = xDataLSB * 0.48828125mG$$

$$yGaussData = yDataLSB * 0.48828125mG$$

2. Calculate the direction D by first checking to see if the X Gauss data is equal to 0 to prevent divide by 0 zero errors in the future calculations. If the X Gauss data is 0, check to see if the Y Gauss data is less than 0. If Y is less than 0 Gauss, the direction D is 90 degrees; if Y is greater than or equal to 0 Gauss, the direction D is 0 degrees.
3. If the X Gauss data is not zero, calculate the arctangent of the Y Gauss and X Gauss data and convert from polar coordinates to degrees.


$$D = \arctan\left(\frac{yGaussData}{xGaussData}\right) * \frac{180}{\pi}$$

4. If the direction D is greater than 360 degrees, subtract 360 degrees from that value.
5. If the direction D is less than 0 degrees, add 360 degrees to that value.
6. The compass heading can then be determined by the direction value D :
 - If D is greater than 337.25 degrees or less than 22.5 degrees – North
 - If D is between 292.5 degrees and 337.25 degrees – North-West
 - If D is between 247.5 degrees and 292.5 degrees – West
 - If D is between 202.5 degrees and 247.5 degrees – South-West
 - If D is between 157.5 degrees and 202.5 degrees – South

- If D is between 112.5 degrees and 157.5 degrees – South-East
- If D is between 67.5 degrees and 112.5 degrees – East
- If D is between 0 degrees and 67.5 degrees – North-East

2.5 Timing Diagrams

An example timing diagram for reading and writing to the Pmod CMPS2 taken from the Memsic datasheet is provided below:

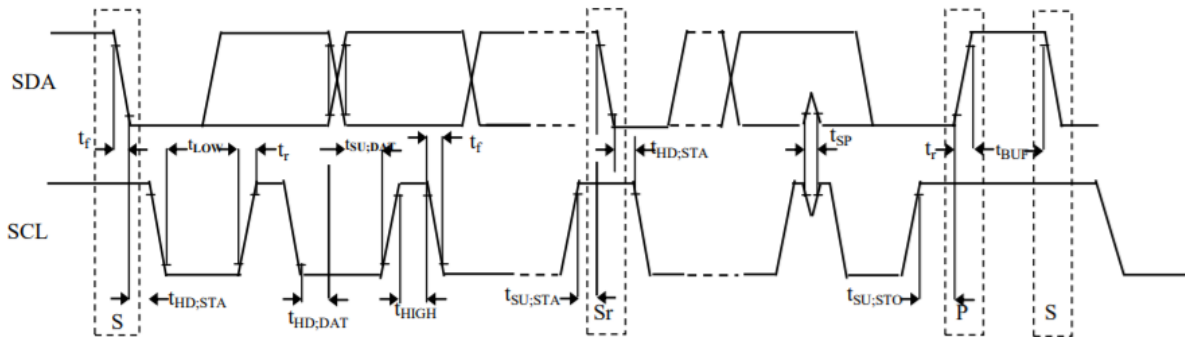

When using an external power supply to run the Pmod, be sure to stay within the parameters provided in Specifications.

X-ON Electronics

Largest Supplier of Electrical and Electronic Components

Click to view similar products for [Magnetic Sensor Development Tools](#) category:

Click to view products by [Digilent](#) manufacturer:

Other Similar products are found below :

[AS5045 DB V2](#) [AS5134 AB](#) [MMC5633NJL-B](#) [ROTATEKNOBANGLE2GOTOBO1](#) [MIKROE-1647](#) [MIKROE-1646](#) [EVAL-CN0332-PMDZ](#) [AS5510-SO_EK_AB](#) [AS5510-WL_EK_DB](#) [ADA4571R-EBZ](#) [AS5170A-SO_EK_AB](#) [4366](#) [AS5013-QF_EK_AB](#) [AS5040 AB](#) [AS5040 DB V2](#) [AS5040-SS_EK_PB](#) [AS5045 AB](#) [AS5047D-TS_EK_AB](#) [AS5048A-EK-AB-STM1.1](#) [AS5048A-TS_EK_AB](#) [AS5048-TS_EK_DB](#) [AS5050A-QF_EK_AB](#) [AS5132 AB](#) [AS5132 DB](#) [AS5132-PB](#) [AS5140 DB](#) [AS5145B-EK-AB-STM1.0](#) [AS5147P-TS_EK_AB](#) [AS5162-EK-AB](#) [AS5172B-TS_EK_AB](#) [AS5247-MF_EK_SB](#) [AS5247U-TQ_EK_AB](#) [AS5247U-TQ_EK_SB](#) [AS5262-MF_EK_AB](#) [AS5311-TS_EK_AB](#) [AS5510-SOIC8-AB](#) [AS5600-SO_EK_AB](#) [AS5600-SO_EK_ST](#) [AS5601-SO_EK_AB](#) [AS5601-SO_EK_ST](#) [AS5601-SO_RD_ST](#) [AS5X47U-TS_EK_AB](#) [SD4Y-EK-XX](#) [USB I&P BOX](#) [EVAL-CN0323-SDPZ](#) [EVAL-CN0368-SDPZ](#) [DFR0033](#) [OUTOFSHAFTFOR3D2GOTOBO1](#) [S2GO3DSENSETLV493DTOBO1](#) [S2GOCURSENSETLI4970TOBO1](#)