


DRAWING FOR REFERENCE: This is subject to change without notice  
08/11/2012

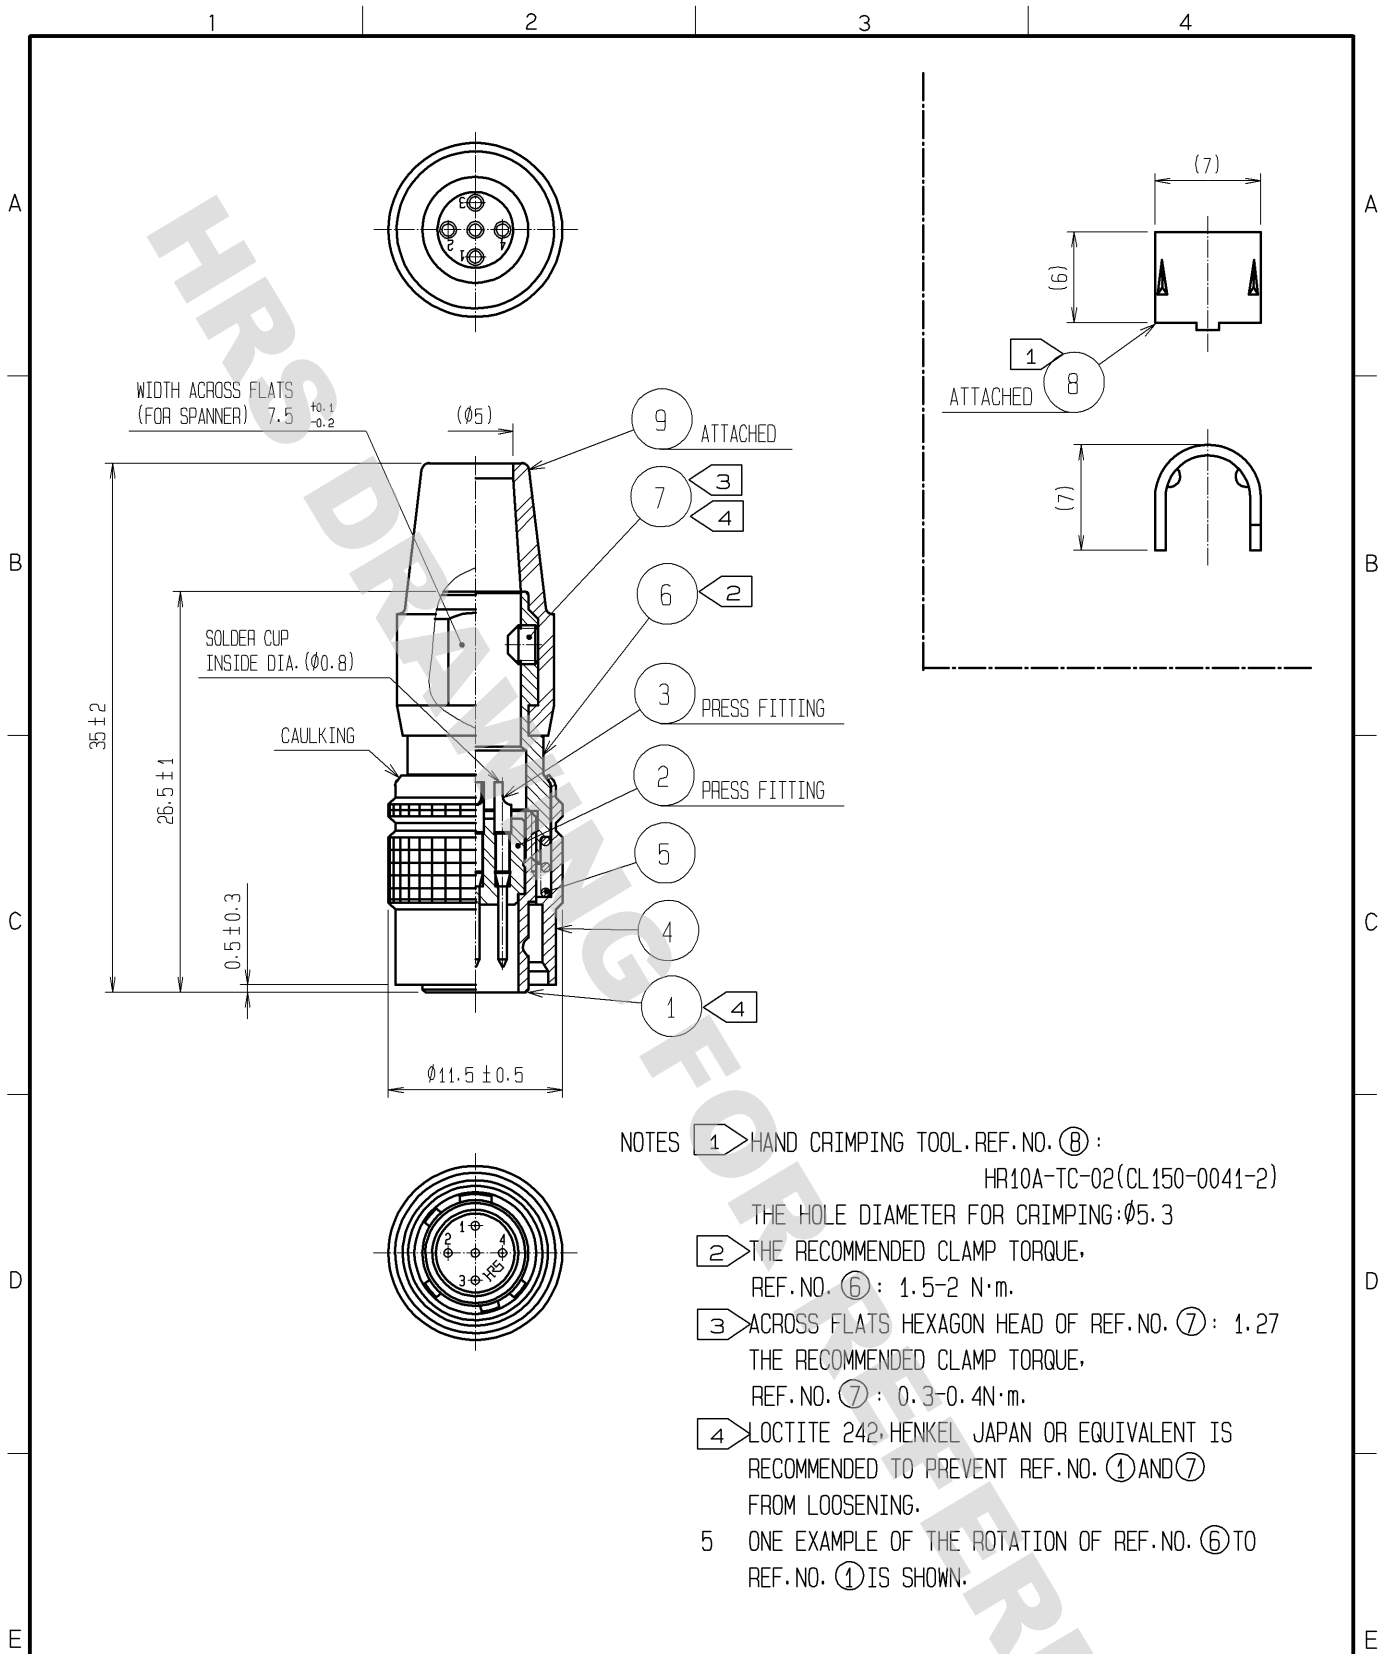

- NOTES
- ① HAND CRIMPING TOOL, REF. NO. ⑧ :  
HR10A-TC-02(CL150-0041-2)  
THE HOLE DIAMETER FOR CRIMPING: Ø5.3
  - ② THE RECOMMENDED CLAMP TORQUE,  
REF. NO. ⑥ : 1.5-2 N·m.
  - ③ ACROSS FLATS HEXAGON HEAD OF REF. NO. ⑦ : 1.27  
THE RECOMMENDED CLAMP TORQUE,  
REF. NO. ⑦ : 0.3-0.4 N·m.
  - ④ LOCTITE 242 HENKEL JAPAN OR EQUIVALENT IS  
RECOMMENDED TO PREVENT REF. NO. ① AND ⑦  
FROM LOOSENING.
  - ⑤ ONE EXAMPLE OF THE ROTATION OF REF. NO. ⑥ TO  
REF. NO. ① IS SHOWN.

5	STEEL	NICKEL PLATING			
4	BRASS	MATTE FINISH NICKEL PLATED	9	CHLOROPRENE RUBBER (BLACK)	
3	BRASS	GOLD PLATING : 0.2µm min. NICKEL UNDER PLATING : 2µm min.	8	BRASS	
2	POLYAMIDE	(BLACK) UL94V-0	7	STEEL	NICKEL PLATING HEXAGON SOCKET SET SCREW M2.6X0.45X2
1	ZINC ALLOY	MATTE FINISH NICKEL PLATED	6	BRASS	NICKEL PLATING
NO.	MATERIAL	FINISH, REMARKS	NO.	MATERIAL	FINISH, REMARKS

UNITS mm	SCALE 2 : 1	COUNT	DESCRIPTION OF REVISIONS	DESIGNED	CHECKED	DATE
<b>HIROSE ELECTRIC CO., LTD.</b>	APPROVED : MO. SATOH	09.01.08	DRAWING NO.	EDC4-025301-74		
	CHECKED : HY. KOBAYASHI	09.01.08	PART NO.	HR10A-7P-5P(74)		
	DESIGNED : TY. SUZUKI	09.01.07	CODE NO.	CL110-0318-5-74		
	DRAWN : TY. SUZUKI	09.01.07				

## X-ON Electronics

Largest Supplier of Electrical and Electronic Components

*Click to view similar products for [Circular Push Pull Connectors](#) category:*

*Click to view products by [Hirose](#) manufacturer:*

Other Similar products are found below :

[6407-249V-11273P](#) [6408-201V-13273](#) [6408-202V-13343](#) [6408-202V-17343](#) [EZG.0B.309.CLN](#) [FFA.2S.310.ZLA](#) [FGA.1B.307.CYCD72Z](#)  
[FGJ.1B.304.CLLD76](#) [FGJ.1B.306.CWLD72](#) [FGJ.3B.304.CYMD10Z](#) [FGJ.3B.304.CYMD82Z](#) [FHG.1B.303.CYCZ](#) [PCS.01.250.DLLE24](#)  
[PHG.0K.305.CYMC40Z](#) [PHG.1K.308.CLLK85](#) [PKG.M0.6BL.LZ](#) [PLC.M1.0SL.LA](#) [GMA.10.290.DN](#) [GMA.3B.090.DA](#)  
[PRG.M0.6GL.LC52GZ](#) [PSA.1S.275.CTLC66](#) [ABF.1S.250.NTA](#) [133020F](#) [1331ER193MZ](#) [1332M107MZ](#) [DTS26Z19-32JA-LC](#) [DTS26Z19-](#)  
[32SA](#) [DTS26Z19-32SA-LC](#) [DTS26Z23-55HA](#) [DTS26Z23-55HA-LC](#) [EAJ.1B.306.CWA](#) [ECG.XB.312.CLL](#) [1589430-2](#) [EEA.0B.305.CLN](#)  
[EEA.0B.309.CLL](#) [ELF.00.250.NTL](#) [ERA.01.250.DLL](#) [BRR.2S.200.PZVG](#) [HR10A-P](#) [CAH.M34.SLL.C72GZ](#) [CAJ.M34.SLL.C72GZ](#) [300500](#)  
[ESB.00.303.NLL](#) [EXG.0B.309.HLN](#) [FFB.1S.250.CLAC27](#) [FGA.2B.306.CYCD92](#) [FGA.2B.306.CYCD92Z](#) [FGA.XB.312.CLAD72](#)  
[FGJ.1B.302.CYMD62](#) [FGJ.3B.308.CLLD72Z](#)