Pressure Sensors

Absolute, Differential, Gage, Vacuum Gage/Amplified



FEATURES

- PCB terminals on opposite side from the ports
- Fully signal conditioned

140PC SERIES PERFORMANCE CHARACTERISTICS at 8.0 ±0.01 VDC Excitation, 25°C

	Min.	Тур.	Max.	Units		
Excitation*	7.00	8.00	16.0	VDC		
Supply Current		8.00	20.0	mA		
Current Sourcing Output			10	mA		
Null Offset (141/142PC)	0.95	1.00	1.05	V		
Null Offset (143PC) **	3.45	3.50	3.55	٧		
Null Offset 142PC15A @ 2 psia 142PC30A @ 2 psia	1.62 1.28	1.67 1.33	1.72 1.38	V V		
Output at Full Pressure	5.90	6.00	6.10	V		
Span† (141/142PC)	4.95	5.00	5.05	V		
Span† (143PC)**		5.00		V		
Span 142PC15A 142PC30A	4.28 4.62	4.33 4.67	4.48 4.72	V V		
Ratiometricity Error 7 to 8 V or 8 to 9 V 9 to 12 V		±0.50 ±2.00		%Span		
Stability over One Year		±0.50		%Span		
Response Time			1.00	msec		
Common Mode Pressure***	***		40	psi		
Weight		5		grams		
Short Circuit Protection	Output may be shorted indefinately to ground					
Output Ripple	None, DC device					
Ground Reference	Supply	and output	are comm	ion		

ENVIRONMENTAL SPECIFICATIONS

Operating Temperature	-40° to +85°C (-40° to +185°F)
Storage Temperature	-55° to +125°C (-67° to +257°F)
Compensated Temperature	-18° to +63°C (0° to +145°F)
Shock	MIL-STD-202, Method 213 (50 g, half sine, 11 msec)
Vibration	MIL-STD-202, Method 204 (10 to 2000 Hz at 10 g)
Media	P2 port Wetted materials; polyester housing, epoxy adhesive, silicon, borosilicate glass, and silicon-to-glass bond*
	P1 port Dry gases only

^{*}Liquid media containing some highly ionic solutions could potentially neutralize the chip-to-glass tube

^{*8.0} VDC excitation is recommended with 1 psi unit.

**Positive and negative pressure measurement.

***Higher common mode pressures possible if sensor is not used over entire operating temperature range.

†Span is defined as the algebraic difference between end points. Please note: actual output is 1 V to 6 V (at 8.00 ±0.01 VDC). Span is then 5 V.

Pressure Sensors

Absolute, Differential, Gage, Vacuum Gage/Amplified

140PC SERIES ORDER GUIDE, VACUUM GAGE TYPE

		Combin	ned Null &	Sensitivity Sh	ift (%Span)			Linearity, B.F.S.L.		Repeatability & Hysteresis %Span	
			o 5°	25 to -18° 25 to -40°				P2 > P1	P2 < P1		
Catalog	Pressure Range					25 to +63°C	25 to 85°C	Sensitivity	Overpressure psi		%Span
Listing	psi	Тур.	Max.	Max.	Max.	V/psi	Max.	Max.	Max.	Тур.	
141PC01G	01		±1.50			5.000	20		±0.75	±0.30	
141PC05G	05	±0.50		±1.00	±2.00	1.000	20		±0.75	±0.25	
141PC15G	0-15	±0.50		±1.00	±2.00	0.333	45		±0.40	±0.15	

140PC SERIES ORDER GUIDE, GAGE TYPE

	Combined Null & Sensitivity Shift (% Span)							Linearity, B.S.F.L.		
	Dunna	25 t	o 5°	25 to -18°	25 to -40°		Overnressure	P2 > P1	P2 < P1	Repeatability
Catalog	Preggiire		45°C	25 to +63°C	5 to +63°C 25 to 85°C		Overpressure psi	%Span		& Hysteresis %Span
Listing	psi	7 _ _		Max.	Max.	Sensitivity V/psi	Max.	Max.	Max.	Тур.
142PC01G	0-1		±1.50			5.000	20	±0.75		±0.30
142PC02G	0-2		±1.50			2.500	20	±0.75		±0.30
142PC05G	0-5	±0.50		±1.00	±2.00	1.000	20	±1.50		±0.25
142PC15G	0-15	±0.50		±1.00	±2.00	0.333	45	±0.75		±0.15
142PC30G	0-30	±0.50		±1.00	±2.00	0.167	60	±0.75		±0.15
143PC03G	±2.5			±1.00	±1.50	1.000	20	±0.75		±0.25
143PC05G	±5			±1.00	±1.50	0.500	30	±0.75		±0.15
143PC15G	±15			±1.00	±1.50	0.177	50	±0.75		±0.15

140PC SERIES ORDER GUIDE, DIFFERENTIAL TYPE

	Combined Null & Sensitivity Shift (%Span)						W. 40 10	Linearity, B.F.S.L.		
	_	25 t	0.5°	25 to -18°	25 to -40°	-	_	P2 > P1	P2 < P1	Repeatability
Catalog	Pressure Range			25 to +63°C 25 to 85°C		1 1 .	Overpressure psi	%Span		& Hysteresis %Span
Listing	psi	Тур.	Max.	Max.	Max.	V/psi	Max.	Max.	Max.	Typ.
142PC01D	0-1		±1.50			5.000	20	±0.75	±0.40	±0.30
142PC02D	0-2		±1.50			2.500	20	±0.75	±0.40	±0.30
142PC05D	0-5	±0.50		±1.00	±2.00	1.000	20	±1.50	±0.75	±0.25
142PC15D	0-15	±0.50		±1.00	±2.00	0.333	45	±0.75	±0.40	±0.15
142PC30D	0-30	±0.50		±1.00	±2.00	0.167	60	±0.75	±0.40	±0.15
143PC03D	±2.5			±1.00	±1.50	1.000	20	±0.75	±0.40	±0.25
143PC05D	±5		***	±1.00	±1.50	0.500	30	±0.75	±0.40	±0.15
143PC15D	±15			±1.00	±1.50	0.177	50	±0.75	±0.40	±0.15


140PC SERIES ORDER GUIDE, ABSOLUTE TYPE*

	Combined Null & Sensitivity Shift (%Span)							Linearity, B.F.S.L.			
	25 to 5°				25 to -18° 25 to -40°	1	_	P2 > P1	P2 < P1	Repeatability	
Catalog	Pressure Range	25 to		25 to +63°C	25 to 85°C	Sensitivity	Overpressure psi	%Span		& Hysteresis %Span	
Listing	psia	Тур.	Max.	Max.	Max.	V/psi	Max.	Max.	Max.	Typ.	
142PC15A	0-15	±0.50		±1.00	±2.00	0.333	45		±0.40	±0.15	
142PC30A	0-30	±0.50		±1.00	±2.00	0.167	60		±0.40	±0.15	

^{*}Tested at 2 psia reference

Absolute, Differential, Gage, Vacuum Gage/Amplified


ELECTRICAL CONNECTION Voltage Excitation

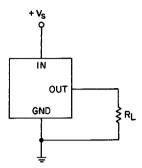


NOTES

- 1. Terminals are labeled on the sensor.
- 2. Input and output share a common ground.
- Ř_L must be greater than or equal to 3000 ohms.

INTERNAL CIRCUITRY

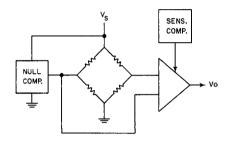

RATIOMETRICITY

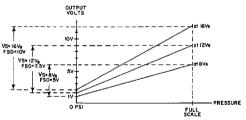

Ratiometricity refers to the output voltage being directly proportional to the supply voltage. 140PC sensors in this catalog are calibrated at 8 VDC supply voltage to provide a 1-6 volt (5V Span) output swing. For example, if supply increases by 50% to 12 VDC, the output voltage increases by 50% to 1.5-9 volts (7.5 V Span).

NOTE

The output is not perfectly ratiometric. See specifications for the degree of error.


NULL AND SENSITIVITY TEMPERATURE SHIFT

Amplified pressure sensors are 100% tested to insure that the maximum null and sensitivity temperature shift does not exceed the specification. The diagram below illustrates how null and sensitivity shift relates to temperature. Note that the maximum shift occurs at temperature extremes. Therefore, if a sensor is not ex-


posed to the entire temperature range, the maximum null and sensitivity shift will actually be less than the value specified.

This diagram indicates the temperature shift pertaining to a few listings. Maximum null and sensitivity shift varies from listing to listing.

NULL AND SENSITIVITY SHIFT (% F.S.O.)

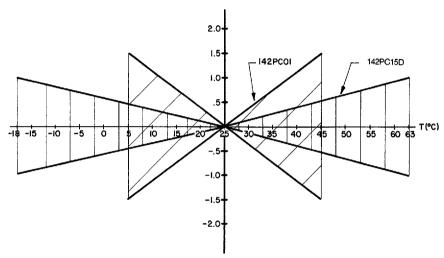

SCALING OF 140PC SERIES SENSORS WITH 8V EXCITATION

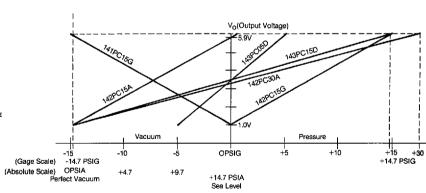

142PC15A	Absolute	V _O = 1 V at 0 psia & 6 V at 15 psia
142PC30A	Absolute	V _O = 1 V at 0 psia & 6 V at 30 psia
142PC15G	Gage	V _O = 1 V at 0 psig & 6 V at 15 psig
141PC15G	Vacuum Gage	V _O = 1 V at 0 psig & 6 V at -15 psig
143PC05D	Differential	V _O = 1 V at -5 psig & 6 V at 5 psig
143PC15D	Differential	V _O = 1 V at -15 psig & 6 V at 15 psig


NOTE: 141PC sensors are scaled for vacuum pressure on P2.

142PC sensors are scaled for greater pressure on the P2 side of the chip. Input pressures on absolute units are applied to the P1 port.

Other scalings available upon request.


Absolute, Differential, Gage, Vacuum Gage/Amplified

MOUNTING DIMENSIONS (For reference only)

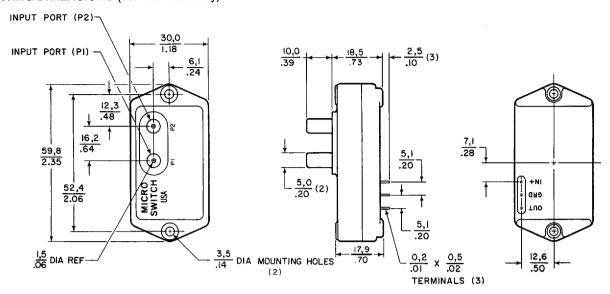

Dimensions shown apply to Differential and Absolute versions. Gage units are identical, except the P1 port is absent.

140PC CONSTRUCTION

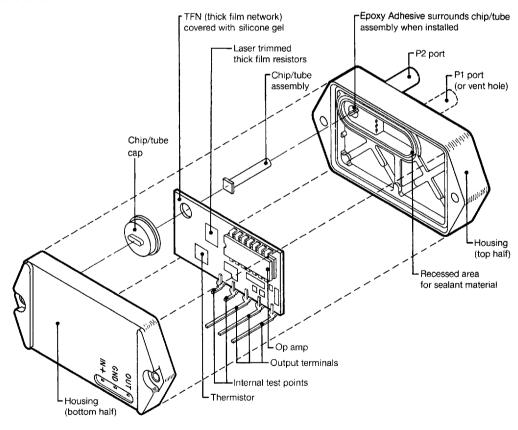

X-ON Electronics

Largest Supplier of Electrical and Electronic Components

Click to view similar products for Board Mount Pressure Sensors category:

Click to view products by Honeywell manufacturer:

Other Similar products are found below:

6407-249V-17343P 6407-250V-09273P 80527-25.0H2-05 80541-B00000150-01 80541-B00000200-05 80554-00700100-05 8056800300050-01 93.631.4253.0 93.731.4353.0 93.932.4553.0 136PC150G2 136PC15A1 142PC95AW71 142PC05DW70 15PSI-G-4V 180501A-L0N-B 26PCBKT 26PCCFA6D26 26PCCFS2G 26PCCVA6D 93.632.7353.0 93.731.3653.0 93.931.4853.0 93.932.4853.0 SCDA120XSC05DC 185PC30DH 20INCH-G-MV-MINI 26PCAFJ3G 26PCCEP5G24 26PCDFA3G 26PCJEU5G19 ASCX15AN-90
TSCSAAN001PDUCV DCAL401DN DCAL401GN XZ202798SSC XZ203676HSC 6407-249V-09343P 6407-250V-17343P SP370-25-1160 81794-B00001200-01 HSCDLNN100PGAA5 82681-B00000100-01 81618-B00000040-05 SSCDJNN015PAAA5 TSCDLNN100MDUCV
TSCSAAN100PDUCV NBPDANN015PGUNV NBPLLNS150PGUNV 142PC100D