

Safe and Durable Design. Wide Operating Temperature.

■Complies with IEC 61010-1, CAT IV 600V, CAT III 1000V

■Safety shutters to prevent incorrect test leads' insertion in current terminals

- Terminal shutters are opening or closing being linked with the rotation of the function switch.

Operation of the Safety Shutters

Safety shutters are open or closed when the appropriate function is selected because they are linked with the rotation of the function switch.



If the DMM has the function switch in position 1 (V, Ω, TEMP, etc) the safety shutters close the input terminals for the current measurements (μA, mA, A) and then the test leads cannot be plugged-in.

If the DMM has the function switch in position 2 (current measurements) then the safety shutters automatically open making it possible to plug-in the test leads in the input terminals for the current measurements (μA, mA, A).

■Very wide operating temperature range

- From -20°C to +55°C for KEW 1061/1062
- From -10°C to +55°C for KEW 1051/1052

■High specs UL standard fuses for extra safety

- Fuses rated at 1000V with 30kA of breaking capacity.

■Over molding case

- Made by "Elastomer", a superior shock sustainable material. Perfectly fits to hand.

Reliable support for data management

■Large internal memory to store test data

- KEW1062: 10,000 data in Logging mode, 100 data manually saved.
- KEW1061: 1,000 data in Logging mode, 100 data manually saved.
- KEW1052: 1,600 data in Logging mode, 100 data manually saved.
- Logging interval can set from 1 sec. to 30 min.

■Test data can be transferred to a PC or directly to a Printer*


- Real-time data can be transferred and shown on a PC.
- Real-time transferring permits the saving of a considerable amount of data on a PC.
- Stored data of internal memory can be monitored by PC.

■Data management with the software DMM Application*

- List of measured data can be converted into Graph.
- Data can be transferred to Excel** and saved as CSV file.

*Optional accessories are required, refer to last page.

**Excel is a registered trademark of Microsoft in the USA.

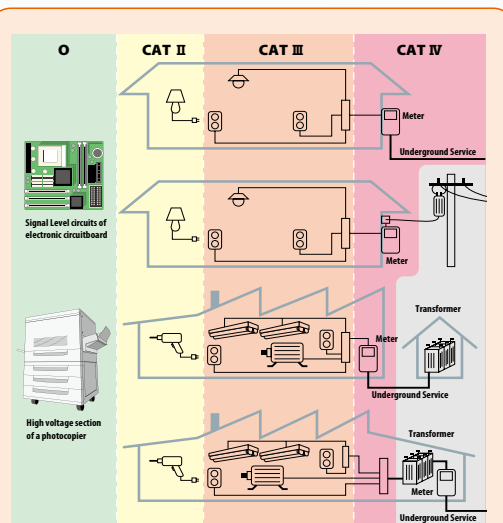

To protect us against overvoltage spikes, we must use instruments that meet the requirements for high protection standards.

The IEC (International Electrotechnical Commission) has prepared an International and European safety standard named IEC 61010-1 with the aim of defining the safety requirements for measuring instruments.

In particular IEC 61010-1 standard defines also the safety Measurement areas called Categories, shortly indicated with the abbreviation "CAT".

These Categories start from O to CAT IV and the most dangerous one is the CAT IV. The figure above shows some area examples of Measurement Categories.

Measurement category	Description	Examples
O	For measurements performed on circuits not directly connected to MAINS.	Signal level circuits of electronic PCBs, etc.
CAT II	For measurements performed on circuits directly connected to the low voltage installation.	Appliances, portable equipment, ect.
CAT III	For measurements performed in the building installation.	Distribution board, circuit breaker, ect.
CAT IV	For measurements performed all the source of the low-voltage installation.	Overhead wire, cable systems, ect.


Printer output

L0000 N+12.539 VDC
L0001 N+12.532 VDC
L0002 N+12.532 VDC
L0003 N+12.529 VDC
L0004 N+12.532 VDC
L0005 N+12.538 VDC
L0006 N+12.541 VDC
L0007 N+12.546 VDC
L0008 N+12.552 VDC
L0009 N+12.557 VDC
L0010 N+12.555 VDC
L0011 N+12.554 VDC
L0012 N+12.553 VDC
L0013 N+12.553 VDC


Printed items (from the left)

- L: Logging memory
- 4 digit numbers: Data number
- N: Normal measurement (O: at "OL" display)
- (B: at "Battery warning" display)
- 5 digit numbers: Measurement
- VDC: Unit (VDC is DC Voltage)

Data analysis with Excel

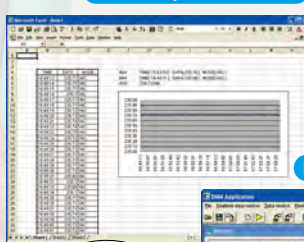

DMM Application software

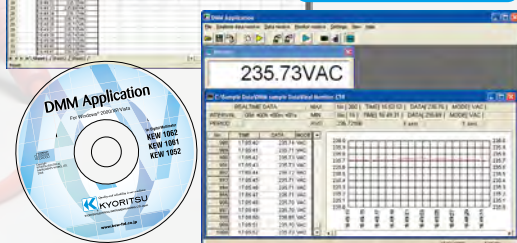

● Included Accessories

Description	MODEL	Contents
Test leads	7220A	CAT IV 600V, CAT III 1000V 1set
	8926	440mA/1000V×1
Fuse	8927	10A/1000V×1

● Optional Accessories

Description	MODEL	Contents
Alligator Clip	7234	CAT IV 600V, CAT III 1000V 1set
USB Communication set	8241	USB adaptor+USB cable+DMM Software
	8405	Max. 500°C (Surface type, Point material: Ceramic)
	8406	Max. 500°C (Surface type)
Thermocouple Type K	8407	Max. 700°C (Liquid, Semi-solid)
	8408	Max. 600°C (Air, Gas)
	8121	AC 100A
	8122	AC 500A
Clamp sensor	8123	AC 1000A
	8146	AC 30A
	8147	AC 70A
	8148	AC 100A
Banana Ø4mm Adjuster Plug	7146	length :190mm
Carrying case	9154	Soft case(for the main unit with test leads and communication cable)



Test leads (7220A)



Calibration Certificate is included.



Alligator Clip (7234)



USB Communication set (8241)



Carrying case (9154)



Banana Ø4mm adjuster plug (7146)

● Clamp sensor Specification

	AC/DC current sensor	8115	8121	8122	8123	8146	8147	8148
Conductor size	φ12	φ24	φ40	φ55	φ24	φ40	φ40	φ68
Rated current	AC 130A / DC 180A	AC 100A	AC 500A	AC 1000A	AC 30A	AC 70A	AC 70A	AC 100A
Output voltage	AC/DC 10mV/A	AC 500mV/100A	AC 500mV/500A	AC 500mV/1000A	AC 1500mV/30A	AC 3500mV/70A	AC 3500mV/70A	AC 5000mV/100A
Accuracy (50/60Hz)	AC ±1.0%rdg±0.4mV DC ±1.0%rdg±0.4mV (This accuracy is defined after a zero-adjustment)		±2.0%rdg±0.3mV		0~15A ±1.0%rdg±0.1mV 15~30A ±5.0%rdg	0~40A ±1.0%rdg±0.1mV 40~70A ±5.0%rdg	0~40A ±1.0%rdg±0.1mV 40~70A ±5.0%rdg	0~80A ±1.0%rdg±0.1mV 80~100A ±5.0%rdg
Frequency range				40Hz~1kHz				
Dimensions	127[L]×42[W]×22[D]mm	97[L]×59[W]×26[D]mm	128[L]×81[W]×36[D]mm	170[L]×105[W]×48[D]mm	100[L]×60[W]×26[D]mm	128[L]×81[W]×36[D]mm	128[L]×81[W]×36[D]mm	186[L]×129[W]×53[D]mm
Weight	approx. 160g	approx. 150g	approx. 260g	approx. 360g	approx. 150g	approx. 240g	approx. 240g	approx. 510g

※ Other Kyoritsu clamp sensors can be used with these DMMs, please check our website for more info. ※ Banana Ø4 mm adjuster plug (7146) is required to use these sensors with the DMMs, with the exception for the 8115.

● Thermocouple Type K Specification


Model	Usage	Measurement temperature	Tolerance (t: measurement temperature)	Response speed
8405	(Surface type, Point material: Ceramic)	Max. 500°C	±2.5°C/t=-40°C~333°C, ±0.0075× t °C/t=333°C~500°C	approx. 1.8 Sec.
8406	Surface type			approx. 1.0 Sec.
8407	(Liquid, Semi-solid)	Max. 700°C	±2.5°C/t=-40°C~333°C, ±0.0075× t °C/t=333°C~700°C	1 Sec. or less
8408	(Air, Gas)	Max. 600°C	±2.5°C/t=-40°C~333°C, ±0.0075× t °C/t=333°C~600°C	0.4 Sec.




MODEL 8405



MODEL 8406

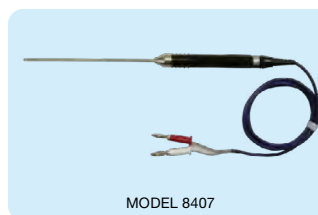

MODEL 8407

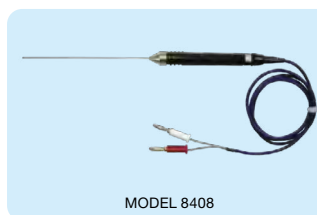

MODEL 8408



Safety Warnings :

Please read the "Safety Warnings" in the instruction manual supplied with the instrument thoroughly and completely for correct use. Failure to follow the safety rules can cause fire, trouble, electrical shock, etc. Therefore, make sure to operate the instrument on a correct power supply and voltage rating marked on each instrument.

■For inquires or orders :



**KYORITSU ELECTRICAL
INSTRUMENTS
WORKS, LTD.**

2-5-20, Nakane, Meguro-ku, Tokyo, 152-0031 Japan

Phone:+81-3-3723-0131

Fax:+81-3-3723-0152

E-mail:info-eng@kew-ltd.co.jp

www.kew-ltd.co.jp



The Best of Reliable Multimeters with Terminal Safety Shutters

Versatile Multimeters

For Electrical and Electronic
Troubleshooting

KEW 1051/1052

Top Class Multimeters

For Laboratory and
Industrial Use

KEW 1061/1062



High Accuracy, Performance and safe design

KEW 1051

KEW 1052

KEW 1061

KEW 1062



KYORITSU ELECTRICAL INSTRUMENTS WORKS, LTD.

www.kew-ltd.co.jp

High Accuracy, High Performance and Reliable Measurements

■Top Accuracy

- 0.02% basic DC accuracy for KEW 1061/1062.
- 0.09% basic DC accuracy for KEW 1051/1052.

■Dual Display

- KEW 1061/1062 : 50,000 counts, Bar graph with 51 segments. White back light display.
- KEW 1051/1052 : 6,000 counts, Bar graph with 31 segments. White back light display.

■Wide AC Frequency Bandwidth

※only for 1061, 1062

- KEW 1062 : ACV frequency bandwidth from 10Hz to 100kHz.
- KEW 1061 : ACV frequency bandwidth from 10Hz to 20kHz.

Advanced Functions

■User calibration function

- Calibration and adjustment are possible by simple operation of DMM keys.
- New technology enables the adjustment for the frequency bandwidth characteristic. ※only for 1061, 1062
※A calibrator is necessary for calibration.

■Low-pass Filter

※except for 1061

- AC measurement can be limited to low frequency, helping for instance voltage measurements in the presence of variable speed motor drivers or inverters.
- The Low-pass filter can be switched ON/OFF.

■LowPower-Ω measurement

※only for 1062

- This function uses a test voltage which is lower than 0.7V (that is the typical junction voltage drop of semi-conductors) thus it allows testing of resistors on a circuit board without unsoldering them.

■Selection of the reading mode

※only for 1052, 1062

- Selectable TRMS or MEAN measurement. The presence of distortion in an AC signal can be confirmed, if the measured TRMS and MEAN values are different.

■Sensor mode

※only for 1051, 1052

- The DMM measures the output voltage of an external sensor (e.g. clamp sensor, light sensor, temperature sensor, etc.) in the secondary display, while the primary display can be set to show the unit of the measured parameter (e.g. A, mA, Lux, °C) according to the conversion ratio chosen.

■Peak Hold function

※only for 1062

- Response time : 250μs

- The instantaneous peak values can be easily captured where normally it is impossible by MIN/MAX/AVG function.

■Auto Hold function

- The measured value is held on the display just by removing the test leads from the circuit under test. Users can remain safely concentrated on the measuring point without the need to press the Hold key.

■Relative and Percentage calculation

- Can calculate and display Relative values or Percentage (%) against the reference measurement values.


■TRMS Measurement

- Ensures accurate readings, avoiding errors (of up to 50%) which can occur when non-sinusoidal waveforms, created by common non linear loads such PCs, Inverters, switch-mode power supplies, etc, are measured.

■DC+AC TRMS Measurement

※only for 1061, 1062

- Accurate AC TRMS measurements also in the presence of superimposed DC component.
- AC and DC values are displayed simultaneously via dual display.

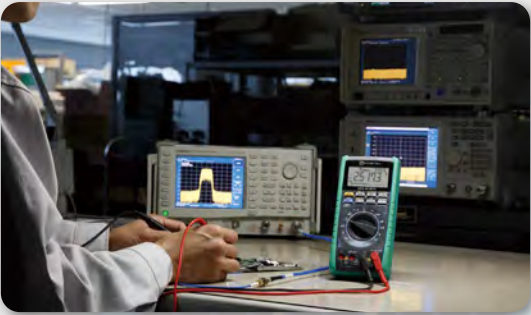

■Minimum / Maximum / Average function

※except for 1051

- Can record the MIN/MAX/AVG values during the measurement process displaying the data and the elapsed time.
※The average value is shown by dividing the integrated record data by the number of recording time.

■Duty cycle ratio measurement

※only for 1061, 1062

- The duty cycle ratio is displayed in percentage (%).

■Decibel dBV, dBm calculation

※only for 1061, 1062

- Can perform logarithmic calculations on AC voltage.
※Reference resistance value:
4/8/16/32/50/75/93/110/125/135/150/200/250/300/500/600/800/900/1000/1200Ω

Versatile Digital Multimeters KEW 1051/1052

●General Specifications

Measurement function:	DC Voltage, AC Voltage, DC Current, AC Current, Resistance, Frequency, Temperature, Capacitor, Continuity Check, Diode Test Effective value [root mean square value] detection [RMS] and mean value detection [MEAN] can be switched during AC voltage measurement (KEW1052 only). The low-pass filter can be switched on/off during AC voltage or AC current measurement.
Other functions:	Data Hold [D-H], Auto Hold [A-H], Range Hold [R-H], Maximum value* [MAX], Minimum value* [MIN], Average value* [AVG], Zero Adjustment [Capacitor, Resistance], Relative values, Save to Memory*, Auto Power Off [Approx. 20 minutes], LCD backlight. *: For model KEW1052 only 4-digit [LCD].....7-segment Main-display.....6000 counts Sub-display.....6000 counts Bar graph indicator.....31-segment Polarity Indicator.....“-” Appears automatically when the polarity is negative. Overrange Indicator.....“ OL ” Low-battery Indicator.....“  ” Appears when the batteries become low.
Display:	

●Specifications

Test conditions: Temperature and humidity: 23±5°C at 80%RH or less Accuracy: ± [% of reading + digit] Note: Each response time is a value to rated accuracy within selected range.

DC Voltage Measurement(≡V)			
Range	Accuracy	Input Impedance	Overload Protection
600.0mV	0.09+2	10MΩ	1000V DC 1000V rms AC
6.000V		11MΩ	
60.00V		10MΩ	
600.0V			
1000V	0.15+2		

NMRR: 60dB or more 50/60Hz ±0.1% CMRR: 120dB or more 50/60Hz (Rs=1kΩ)

Response time: 1 sec. max.

AC Voltage Measurement(∼V)					
Range		Accuracy		Input Impedance	Overload Protection
		50/60Hz	40∼500Hz		
600.0mV	0.5+5	1+5	1.5+5	10MΩ<200pF	1000V rms AC 1000V DC
6.000V				11MΩ<50pF	
60.00V				10MΩ<50pF	
600.0V				10MΩ<50pF	
1000V					

Accuracy: At 5 to 100% of range and 1000V range is 200 to 1000V, less than 1500V peak for non-sinusoidal waveforms, add ±[2% + 2% of full scale], for Crest factor<3.
CMRR: 60dB or more DC to 60Hz (Rs=1kΩ) 4 counts or less is corrected to 0, Response time: 2 sec. max.

Resistance Measurement(Ω)				
Range	Accuracy	Maximum Measuring Current	Open Circuit Voltage	Overload Protection
600.0Ω	0.4+1	<1.2mA	<3.5V	1000V rms
6.000kΩ		<110μA		
60.00kΩ		<13μA		
600.0kΩ		<1.3μA		
6.000MΩ	0.5+1	<130nA	<1.3V	1000V rms
60.00MΩ				

Accuracy is specified after zero adjustment at 600Ω to 6kΩ (Resistance)

Response time: 2 sec. max. at 600Ω to 600kΩ, 10 sec. max. at 6M to 60MΩ

Continuity Check(⦿)				
Range	Range of Operation	Measuring Current	Open Circuit Voltage	Overload Protection
600.0Ω	Buzzer sounds at lower than 50±30Ω	Approx.<1.2mA	<3.5V	1000V rms

Selection Guide

Model	1051	1052	1061	1062
Display				
Detection method	RMS	RMS/MEAN	RMS	RMS/MEAN
Maximum count display	6000	6000	50000	50000
Dual display	●	●	●	●
Bar graph	31-segment	31-segment	51-segment	51-segment
Back light	White LED	White LED	White LED	White LED
Function				
Auto hold	●	●	●	●
Peak hold	—	—	—	●
Max/Min/Ave	—	●	●	●
REL	●	●	●	●
Manual memory	—	●	●	●
Logging memory	—	●	●	●
Communication	—	●	●	●
Frequency response	40Hz∼1kHz	40Hz∼1kHz	10Hz∼20kHz	10Hz∼100kHz
Operating temperature	−10°C∼55°C	−10°C∼55°C	−20°C∼55°C	−20°C∼55°C
Safety standard	CAT III 1000V CAT IV 600V	CAT III 1000V CAT IV 600V	CAT III 1000V CAT IV 600V	CAT III 1000V CAT IV 600V

Measurement cycle:	5 times per second [except frequency measurement : one time per second, Resistance measurement (6MΩ/60MΩ) : 2.5 times per second, capacitor measurement (1000pF) : max.0.14 time per second] Bar graph display approx 25 times per second (at AC, Ω)
Operating temperature and humidity ranges:	−10 to 55°C, 80%RH or less [no condensation] 70%RH or less at 40 to 55°C.
Storage temperature and humidity ranges:	−30 to 70°C, 70%RH or less [no condensation]
Temperature coefficient:	[Accuracy at 23±5°C×0.1%/°C should be added]. (Temperature ranges: −10 to 18°C and 28 to 55°C)
Power supply:	AA-size [R6/1R8] 1.5V batteries: 4 Approximately 300 hours [Operating hours of alkaline batteries when in DC voltage-mode.] Note: The battery life varies depending on the operating conditions.
Withstand voltage:	6.88Vrms AC for five seconds [across input terminals and casing]
Dimensions:	Approx. 192(L)×90(W)×49(D)mm
Weight:	Approx. 560g [including batteries]
Applicable standards:	IEC61010-1 CAT IV 600V, CAT III 1000V Pollution degree 2, IEC61010-031, IEC61326-1
Accessories included:	Batteries : 4, Test leads: 1set (7220A), Fuse [included]: 440mA/1000V (8926), 10A/1000V (8927), Instruction manual: 1, Calibration Certificate

DC Current Measurement (≡)(A)			
Range	Accuracy	Voltage Drop	Overload Protection
600.0μA	0.2+2	<0.12mV/μA	440mA Protected by a 440mA/1000V fuse.
6000μA		<3.3mV/mA	
60.00mA			
440.0mA		<0.1V/A	
6.000A	0.5+5		10A Protected by A 10A/1000V fuse.
10.00A			

Response time: 1 sec. max.

AC Current Measurement[RMS](∼A)				
Range		Accuracy		Voltage Drop
		50/60Hz	40Hz∼1kHz	
600.0μA	0.75+5	1.5+5	<0.12mV/μA	440mA Protected by a 440mA/1000V fuse.
6000μA				
60.00mA				
440.0mA				
6.000A	10.00A		<0.1V/A	10A Protected by a 10A/1000V fuse.
10.00A				

Accuracy: At 5 to 100% of range, 10A range is 2 to 10A and 440mA range is 30 to 440mA.

※2: At 10 to 100% of range

Crest factor <1.5V at 1000V range; Crest factor <3 at other range

CMRR: 80dB or more DC to 60Hz (Rs=1kΩ) 4 counts or less is corrected to 0, Response time: 3 sec. max.

Diode Test(⚡)				
Range	Accuracy	Measuring Current(I _h 0.8V)	Open Circuit Voltage	Overload Protection
2.000V	1+2	Approx. 0.5mA	<3.5V	1000V rms

Temperature Measurement(TEMP)				
Range	Accuracy	Overload Protection	Capacitor Measurement(⚡)	
−50.0∼600.0°C	2+2°C	1000V rms	Range	Accuracy
			10.00nF	2+10
			100.0nF	1000V rms
			1.000μF	
			10.00μF	
			100.0μF	
			1000μF	3+5

Frequency Measurement(Hz) AC Coupling, Maximum Reading 9999

Range	Accuracy	Input Voltage
10.00∼99.99Hz	0.02+1	0.2∼600Vrms
90.0∼999.9Hz		
0.900∼9.999kHz		
9.00∼99.9kHz		
900∼999kHz		

Accuracy is specified after zero adjustment at 10nF to 1μF [Capacitance]

Top-Class Digital Multimeters KEW 1061/1062

●General Specifications

Measurement function:	DC Voltage, AC Voltage, DC Current, AC Current, Resistance, Frequency, Temperature, Capacitor, Duty cycle ratio, Decibel [dB, dBm], Continuity Check, Diode Test Low power: Ω*, Effective value [root mean square value] detection [RMS] and mean value detection [MEAN] can be switched during AC voltage or AC current measurement [KEW1062 only]. The low-pass filter can be switched on/off during AC voltage or AC current measurement [KEW1062 only].
Other functions:	Data Hold [D-H], Auto Hold [A-H], Peak Hold* [P-H], Range Hold [R-H], Maximum value [MAX], Minimum value [MIN], Average value [AVG], Zero Adjustment [Capacitor, Resistance], Relative values, Save to Memory, Auto Power Off [Approx. 20 minutes], LCD backlight. *: For model KEW1062 only 5-digit [LCD].....7-segment Main-display.....50000 counts Sub-display.....50000 counts Bar graph indicator.....51-segment Polarity Indicator.....“-” Appears automatically when the polarity is negative. Overrange Indicator.....“ OL ” Low-battery Indicator.....“  ” Appears when the batteries become low.
Display:	

●Specifications

Test conditions: Temperature and humidity: 23±5°C at 80%RH or less Accuracy: ± [% of reading + digit] Note: Each response time is a value to rated accuracy within selected range.

DC Voltage Measurement(≡V)			
Range	Accuracy 1061,1062	Input Impedance	Overload Protection
50.000mV	0.05+10	Approx. 100MΩ	1000V DC 1000V rms AC
500.00μV	0.02+2		
2400.0mV	0.025+5		
5.0000V			
50.000V	0.03+2	10MΩ	
500.00V			
1000.0V			

NMRR: 80dB or more 50/60Hz ±0.1% (70dB or more 50/60Hz ±0.1% when 50mV Range)

CMRR: 100dB or more 50/60Hz (Rs=1kΩ) Response time: 0.3 sec. max.

AC Voltage Measurement [RMS](~V)				AC Coupling, RMS value detection, sine wave		
Range	Accuracy		Not Specified		Input Impedance	Overload Protection
	10~20Hz	20Hz~1kHz	1k~10kHz	10k~20kHz	20k~50kHz	50~100kHz
50.000mV	2+80 ^{※1}	0.4+40 ^{※2}	5+40 ^{※2}	5+40 ^{※2}	15+40 ^{※2}	11MΩ<50pF
500.00μV	1.5+30 ^{※1}	0.7+30 ^{※1}	2+50 ^{※2}	1+40 ^{※1}	5+200 ^{※2}	
5.0000V						
50.000V						
500.0V	※2	※2	3+30 ^{※2}	—	—	10MΩ<50pF
1000.0V						

※1: At 5 to 100% of range

※2: At 10 to 100% of range

Crest factor <1.5V at 1000V range; Crest factor <3 at other range

CMRR: 80dB or more DC to 60Hz (Rs=1kΩ) Response time: 1 sec. max.

AC Voltage Measurement [MEAN](∼V) ※1062 only					
Range		Accuracy		Input Impedance	Overload Protection
		10∼20Hz	20∼500Hz		
50.000mV	2+80 ^{※2}	1.5+30 ^{※2}	5+30 ^{※2}	11MΩ<50pF	1000V rms AC 1000V DC
500.00μA					
5.0000V					
50.000V					
500.00V	※2	※2	—	10MΩ<50pF	1000V rms AC 1000V DC
1000.0V					

※1: At 5 to 100% of range

※2: At 10 to 100% of range

Crest factor <1.5V at 1000V range; Crest factor <3 at other range

CMRR: 80dB or more DC to 60Hz (Rs=1kΩ) Response time: 2 sec. max.

DCV+ACV(≡+∼)						AC Coupling, RMS value detection, sine wave	
Range	Accuracy				Input Impedance	Overload Protection	
	Upper:1061; Lower:1062; -Not Specified						
	DC,10~20Hz	DC,20Hz~1kHz	DC,1k~10kHz	DC,10k~20k~50kHz	DC,50k~100kHz		
5.0000V	1.5×10 ⁻¹	1×10 ⁻¹	2×10 ⁻²	—	—	11MΩ<50pF	
50.000V	1.5×10 ⁻¹	—	2×10 ⁻²	—	—		
500.00V	1.5×10 ⁻¹	0.5×10 ⁻¹	1×10 ⁻¹	2×10 ⁻²	5×2×10 ⁻²		
1000.0V	※2	※2	—	—	—	10MΩ<50pF	
	※2	※2	—	—	—	1000V rms	
	—	—	—	—	—	1000V DC	

Safe and Durable Design. Wide Operating Temperature.

■Complies with IEC 61010-1, CAT IV 600V, CAT III 1000V

■Safety shutters to prevent incorrect test leads' insertion in current terminals

- Terminal shutters are opening or closing being linked with the rotation of the function switch.

Operation of the Safety Shutters

Safety shutters are open or closed when the appropriate function is selected because they are linked with the rotation of the function switch.



If the DMM has the function switch in position 1 (V, Ω, TEMP, etc) the safety shutters close the input terminals for the current measurements (μA, mA, A) and then the test leads cannot be plugged-in.

If the DMM has the function switch in position 2 (current measurements) then the safety shutters automatically open making it possible to plug-in the test leads in the input terminals for the current measurements (μA, mA, A).

■Very wide operating temperature range

- From -20°C to +55°C for KEW 1061/1062
- From -10°C to +55°C for KEW 1051/1052

■High specs UL standard fuses for extra safety

- Fuses rated at 1000V with 30kA of breaking capacity.

■Over molding case

- Made by "Elastomer", a superior shock sustainable material. Perfectly fits to hand.

Reliable support for data management

■Large internal memory to store test data

- KEW1062: 10,000 data in Logging mode, 100 data manually saved.
- KEW1061: 1,000 data in Logging mode, 100 data manually saved.
- KEW1052: 1,600 data in Logging mode, 100 data manually saved.
- Logging interval can set from 1 sec. to 30 min.

■Test data can be transferred to a PC or directly to a Printer*


- Real-time data can be transferred and shown on a PC.
- Real-time transferring permits the saving of a considerable amount of data on a PC.
- Stored data of internal memory can be monitored by PC.

■Data management with the software DMM Application*

- List of measured data can be converted into Graph.
- Data can be transferred to Excel** and saved as CSV file.

*Optional accessories are required, refer to last page.

**Excel is a registered trademark of Microsoft in the USA.

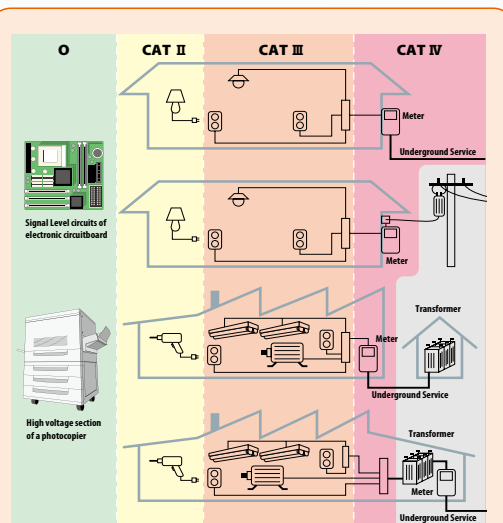

To protect us against overvoltage spikes, we must use instruments that meet the requirements for high protection standards.

The IEC (International Electrotechnical Commission) has prepared an International and European safety standard named IEC 61010-1 with the aim of defining the safety requirements for measuring instruments.

In particular IEC 61010-1 standard defines also the safety Measurement areas called Categories, shortly indicated with the abbreviation "CAT".

These Categories start from O to CAT IV and the most dangerous one is the CAT IV. The figure above shows some area examples of Measurement Categories.

Measurement category	Description	Examples
O	For measurements performed on circuits not directly connected to MAINS.	Signal level circuits of electronic PCBs, etc.
CAT II	For measurements performed on circuits directly connected to the low voltage installation.	Appliances, portable equipment, ect.
CAT III	For measurements performed in the building installation.	Distribution board, circuit breaker, ect.
CAT IV	For measurements performed all the source of the low-voltage installation.	Overhead wire, cable systems, ect.


Printer output

L0000 N+12.539 VDC
L0001 N+12.532 VDC
L0002 N+12.532 VDC
L0003 N+12.529 VDC
L0004 N+12.532 VDC
L0005 N+12.538 VDC
L0006 N+12.541 VDC
L0007 N+12.546 VDC
L0008 N+12.552 VDC
L0009 N+12.557 VDC
L0010 N+12.555 VDC
L0011 N+12.554 VDC
L0012 N+12.553 VDC
2.553 VDC


Printed items (from the left)

- L: Logging memory
- 4 digit numbers: Data number
- N: Normal measurement (C: at "OL" display)
- (B: at "Battery warning" display)
- 5 digit numbers: Measurement
- VDC: Unit (VDC is DC Voltage)

Data analysis with Excel

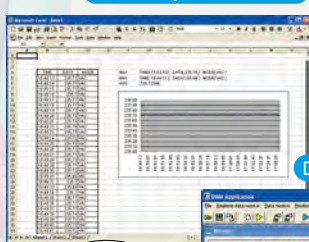

DMM Application software

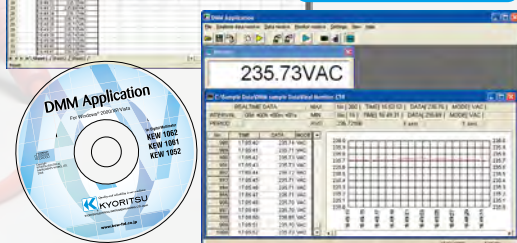

● Included Accessories


Description	MODEL	Contents
Test leads	7220A	CAT IV 600V, CAT III 1000V 1set
	8926	440mA/1000V×1
Fuse	8927	10A/1000V×1

● Optional Accessories

Description	MODEL	Contents
Alligator Clip	7234	CAT IV 600V, CAT III 1000V 1set
USB Communication set	8241	USB adaptor+USB cable+DMM Software
	8405	Max. 500°C (Surface type, Point material: Ceramic)
	8406	Max. 500°C (Surface type)
Thermocouple Type K	8407	Max. 700°C (Liquid, Semi-solid)
	8408	Max. 600°C (Air, Gas)
	8121	AC 100A
	8122	AC 500A
Clamp sensor	8123	AC 1000A
	8146	AC 30A
	8147	AC 70A
	8148	AC 100A
Banana Ø4mm Adjuster Plug	7146	length :190mm
Carrying case	9154	Soft case(for the main unit with test leads and communication cable)




Test leads (7220A)

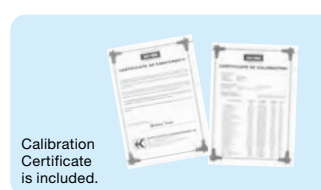

Calibration Certificate is included.



Alligator Clip (7234)

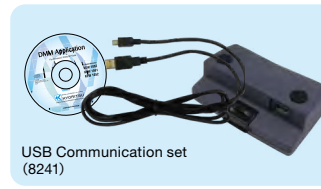

USB Communication set (8241)



Carrying case (9154)



Banana Ø4mm adjuster plug (7146)

● Clamp sensor Specification

	AC/DC current sensor		AC current sensor			Leakage & AC current sensor		
MODEL	8115	8121	8122	8123	8146	8147	8148	
	 CE	 CE	 CE	 CE	 CE	 CE	 CE	
Conductor size	φ12	φ24	φ40	φ55	φ24	φ40	φ68	
Rated current	AC 130A / DC 180A	AC 100A	AC 500A	AC 1000A	AC 30A	AC 70A	AC 100A	
Output voltage	AC/DC 10mV/A	AC 500mV/100A	AC 500mV/500A	AC 500mV/1000A	AC 1500mV/30A	AC 3500mV/70A	AC 5000mV/100A	
Accuracy (50/60Hz)	AC ±1.0%rdg±0.4mV DC ±1.0%rdg±0.4mV (This accuracy is defined after a zero-adjustment)	±2.0%rdg±0.3mV			0~15A ±1.0%rdg±0.1mV 15~30A ±5.0%rdg	0~40A ±1.0%rdg±0.1mV 40~70A ±5.0%rdg	0~80A ±1.0%rdg±0.1mV 80~100A ±5.0%rdg	
Frequency range	40Hz~1kHz							
Dimensions	127[L]×42[W]×22[D]mm	97[L]×59[W]×26[D]mm	128[L]×81[W]×36[D]mm	170[L]×105[W]×48[D]mm	100[L]×60[W]×26[D]mm	128[L]×81[W]×36[D]mm	186[L]×129[W]×53[D]mm	
Weight	approx. 160g	approx. 150g	approx. 260g	approx. 360g	approx. 150g	approx. 240g	approx. 510g	

※ Other Kyoritsu clamp sensors can be used with these DMMs, please check our website for more info. ※ Banana Ø4 mm adjuster plug (7146) is required to use these sensors with the DMMs, with the exception for the 8115.

● Thermocouple Type K Specification


Model	Usage	Measurement temperature	Tolerance (t: measurement temperature)	Response speed
8405	(Surface type, Point material: Ceramic)	Max. 500°C	±2.5°C/t=-40°C~333°C, ±0.0075× t °C/t=333°C~500°C	approx. 1.8 Sec.
8406	Surface type			approx. 1.0 Sec.
8407	(Liquid, Semi-solid)	Max. 700°C	±2.5°C/t=-40°C~333°C, ±0.0075× t °C/t=333°C~700°C	1 Sec. or less
8408	(Air, Gas)	Max. 600°C	±2.5°C/t=-40°C~333°C, ±0.0075× t °C/t=333°C~600°C	0.4 Sec.




MODEL 8405



MODEL 8406

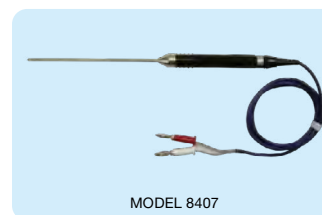

MODEL 8407

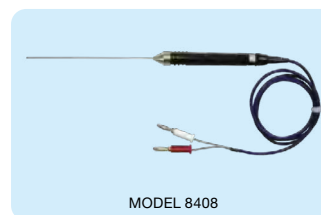

MODEL 8408



Safety Warnings :

Please read the "Safety Warnings" in the instruction manual supplied with the instrument thoroughly and completely for correct use. Failure to follow the safety rules can cause fire, trouble, electrical shock, etc. Therefore, make sure to operate the instrument on a correct power supply and voltage rating marked on each instrument.

■For inquires or orders :



**KYORITSU ELECTRICAL
INSTRUMENTS
WORKS, LTD.**

2-5-20, Nakane, Meguro-ku, Tokyo, 152-0031 Japan

Phone:+81-3-3723-0131

Fax:+81-3-3723-0152

E-mail:info-eng@kew-ltd.co.jp

www.kew-ltd.co.jp



The Best of Reliable Multimeters with Terminal Safety Shutters

Versatile Multimeters

For Electrical and Electronic
Troubleshooting

KEW 1051/1052

Top Class Multimeters

For Laboratory and
Industrial Use

KEW 1061/1062



High Accuracy, Performance and safe design

KEW 1051

KEW 1052

KEW 1061

KEW 1062



KYORITSU ELECTRICAL INSTRUMENTS WORKS, LTD.

www.kew-ltd.co.jp

High Accuracy, High Performance and Reliable Measurements

■Top Accuracy

- 0.02% basic DC accuracy for KEW 1061/1062.
- 0.09% basic DC accuracy for KEW 1051/1052.

■Dual Display

- KEW 1061/1062 : 50,000 counts, Bar graph with 51 segments. White back light display.
- KEW 1051/1052 : 6,000 counts, Bar graph with 31 segments. White back light display.

■Wide AC Frequency Bandwidth

※only for 1061, 1062

- KEW 1062 : ACV frequency bandwidth from 10Hz to 100kHz.
- KEW 1061 : ACV frequency bandwidth from 10Hz to 20kHz.

Advanced Functions

■User calibration function

- Calibration and adjustment are possible by simple operation of DMM keys.
- New technology enables the adjustment for the frequency bandwidth characteristic. ※only for 1061, 1062
※A calibrator is necessary for calibration.

■Low-pass Filter

※except for 1061

- AC measurement can be limited to low frequency, helping for instance voltage measurements in the presence of variable speed motor drivers or inverters.
- The Low-pass filter can be switched ON/OFF.

■LowPower-Ω measurement

※only for 1062

- This function uses a test voltage which is lower than 0.7V (that is the typical junction voltage drop of semi-conductors) thus it allows testing of resistors on a circuit board without unsoldering them.

■Selection of the reading mode

※only for 1052, 1062

- Selectable TRMS or MEAN measurement. The presence of distortion in an AC signal can be confirmed, if the measured TRMS and MEAN values are different.

■Sensor mode

※only for 1051, 1052

- The DMM measures the output voltage of an external sensor (e.g. clamp sensor, light sensor, temperature sensor, etc.) in the secondary display, while the primary display can be set to show the unit of the measured parameter (e.g. A, mA, Lux, °C) according to the conversion ratio chosen.

■Peak Hold function

※only for 1062

- Response time : 250μs

- The instantaneous peak values can be easily captured where normally it is impossible by MIN/MAX/AVG function.

■Auto Hold function

- The measured value is held on the display just by removing the test leads from the circuit under test. Users can remain safely concentrated on the measuring point without the need to press the Hold key.

■Relative and Percentage calculation

- Can calculate and display Relative values or Percentage (%) against the reference measurement values.


■TRMS Measurement

- Ensures accurate readings, avoiding errors (of up to 50%) which can occur when non-sinusoidal waveforms, created by common non linear loads such PCs, Inverters, switch-mode power supplies, etc, are measured.

■DC+AC TRMS Measurement

※only for 1061, 1062

- Accurate AC TRMS measurements also in the presence of superimposed DC component.
- AC and DC values are displayed simultaneously via dual display.

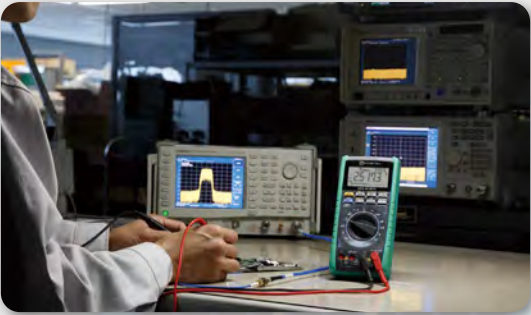

■Minimum / Maximum / Average function

※except for 1051

- Can record the MIN/MAX/AVG values during the measurement process displaying the data and the elapsed time.
※The average value is shown by dividing the integrated record data by the number of recording time.

■Duty cycle ratio measurement

※only for 1061, 1062

- The duty cycle ratio is displayed in percentage (%).

■Decibel dBV, dBm calculation

※only for 1061, 1062

- Can perform logarithmic calculations on AC voltage.
※Reference resistance value:
4/8/16/32/50/75/93/110/125/135/150/200/250/300/500/600/800/900/1000/1200Ω

Versatile Digital Multimeters KEW 1051/1052

●General Specifications

Measurement function:	DC Voltage, AC Voltage, DC Current, AC Current, Resistance, Frequency, Temperature, Capacitor, Continuity Check, Diode Test Effective value [root mean square value] detection [RMS] and mean value detection [MEAN] can be switched during AC voltage measurement (KEW1052 only). The low-pass filter can be switched on/off during AC voltage or AC current measurement.
Other functions:	Data Hold [D-H], Auto Hold [A-H], Range Hold [R-H], Maximum value* [MAX], Minimum value* [MIN], Average value* [AVG], Zero Adjustment [Capacitor, Resistance], Relative values, Save to Memory*, Auto Power Off [Approx. 20 minutes], LCD backlight. *: For model KEW1052 only 4-digit [LCD].....7-segment Main-display.....6000 counts Sub-display.....6000 counts Bar graph indicator.....31-segment Polarity Indicator.....“-” Appears automatically when the polarity is negative. Overrange Indicator.....“ OL ” Low-battery Indicator.....“  ” Appears when the batteries become low.
Display:	

●Specifications

Test conditions: Temperature and humidity: 23±5°C at 80%RH or less Accuracy: ± [% of reading + digit] Note: Each response time is a value to rated accuracy within selected range.

DC Voltage Measurement(≡V)			
Range	Accuracy	Input Impedance	Overload Protection
600.0mV	0.09+2	10MΩ	1000V DC 1000V rms AC
6.000V		11MΩ	
60.00V		10MΩ	
600.0V			
1000V	0.15+2		

NMRR: 60dB or more 50/60Hz ±0.1% CMRR: 120dB or more 50/60Hz (Rs=1kΩ)

Response time: 1 sec. max.

AC Voltage Measurement(∼V)					
Range		Accuracy	Accuracy	Input Impedance	Overload Protection
		50/60Hz	40∼500Hz	500Hz∼1kHz	
600.0mV	0.5+5	1+5	1.5+5	10MΩ<200pF	1000V rms AC 1000V DC
6.000V				11MΩ<50pF	
60.00V				10MΩ<50pF	
600.0V				—	

Accuracy: At 5 to 100% of range and 1000V range is 200 to 1000V, less than 1500V peak for non-sinusoidal waveforms, add ±[2% + 2% of full scale], for Crest factor<3.
CMRR: 60dB or more DC to 60Hz (Rs=1kΩ) 4 counts or less is corrected to 0, Response time: 2 sec. max.

Resistance Measurement(Ω)				
Range	Accuracy	Maximum Measuring Current	Open Circuit Voltage	Overload Protection
600.0Ω	0.4+1	<1.2mA	<3.5V	1000V rms
6.000kΩ		<110μA		
60.00kΩ		<13μA		
600.0kΩ		<1.3μA		
6.000MΩ	0.5+1	<130nA	<1.3V	1000V rms
60.00MΩ				

Accuracy is specified after zero adjustment at 600Ω to 6kΩ (Resistance)
Response time: 2 sec. max. at 600Ω to 600kΩ, 10 sec. max. at 6M to 60MΩ

Continuity Check(⦿)				
Range	Range of Operation	Measuring Current	Open Circuit Voltage	Overload Protection
600.0Ω	Buzzer sounds at lower than 50±30Ω	Approx.<1.2mA	<3.5V	1000V rms

Selection Guide

Model	1051	1052	1061	1062
Display				
Detection method	RMS	RMS/MEAN	RMS	RMS/MEAN
Maximum count display	6000	6000	50000	50000
Dual display	●	●	●	●
Bar graph	31-segment	31-segment	51-segment	51-segment
Back light	White LED	White LED	White LED	White LED
Function				
Auto hold	●	●	●	●
Peak hold	—	—	—	●
Max/Min/Ave	—	●	●	●
REL	●	●	●	●
Manual memory	—	●	●	●
Logging memory	—	●	●	●
Communication	—	●	●	●
Frequency response	40Hz∼1kHz	40Hz∼1kHz	10Hz∼20kHz	10Hz∼100kHz
Operating temperature	−10°C∼55°C	−10°C∼55°C	−20°C∼55°C	−20°C∼55°C
Safety standard	CAT III 1000V CAT IV 600V	CAT III 1000V CAT IV 600V	CAT III 1000V CAT IV 600V	CAT III 1000V CAT IV 600V

Measurement cycle:	5 times per second [except frequency measurement : one time per second, Resistance measurement (6MΩ/60MΩ) : 2.5 times per second, capacitor measurement (1000pF) : max.0.14 time per second] Bar graph display approx 25 times per second (at AC, Ω)
Operating temperature and humidity ranges:	−10 to 55°C, 80%RH or less [no condensation] 70%RH or less at 40 to 55°C.
Storage temperature and humidity ranges:	−30 to 70°C, 70%RH or less [no condensation]
Temperature coefficient:	[Accuracy at 23±5°C×0.1%/°C should be added]. (Temperature ranges: −10 to 18°C and 28 to 55°C)
Power supply:	AA-size [R6/1R8] 1.5V batteries: 4 Approximately 300 hours [Operating hours of alkaline batteries when in DC voltage-mode.] Note: The battery life varies depending on the operating conditions.
Withstand voltage:	6.88Vrms AC for five seconds [across input terminals and casing]
Dimensions:	Approx. 192(L)×90(W)×49(D)mm
Weight:	Approx. 560g [including batteries]
Applicable standards:	IEC61010-1 CAT IV 600V, CAT III 1000V Pollution degree 2, IEC61010-031, IEC61326-1
Accessories included:	Batteries : 4, Test leads: 1set (7220A), Fuse [included]: 440mA/1000V (8926), 10A/1000V (8927), Instruction manual: 1, Calibration Certificate

DC Current Measurement (≡)(A)			
Range	Accuracy	Voltage Drop	Overload Protection
600.0μA	0.2+2	<0.12mV/μA	440mA Protected by a 440mA/1000V fuse.
6000μA		<3.3mV/mA	
60.00mA			
440.0mA		<0.1V/A	10A Protected by A 10A/1000V fuse.
6.000A	0.5+5	<0.1V/A	10A Protected by A 10A/1000V fuse.
10.00A			

Response time: 1 sec. max.

AC Current Measurement[RMS](∼A)				
Range		Accuracy	Voltage Drop	Overload Protection
		50/60Hz	40Hz∼1kHz	
600.0μA	0.75+5	1.5+5	<0.12mV/μA	440mA Protected by a 440mA/1000V fuse.
6000μA			<3.3mV/mA	
60.00mA			<0.1V/A	
440.0mA			10A Protected by A 10A/1000V fuse.	
6.000A	10.00A		<0.1V/A	10A Protected by A 10A/1000V fuse.
10.00A				

Accuracy: At 5 to 100% of range, 10A range is 2 to 10A and 440mA range is 30 to 440mA.

※2: At 10 to 100% of range

Crest factor <1.5V at 1000V range; Crest factor <3 at other range

CMRR: 80dB or more DC to 60Hz (Rs=1kΩ) 4 counts or less is corrected to 0, Response time: 3 sec. max.

Diode Test(⚡)				
Range	Accuracy	Measuring Current(I _h 0.8V)	Open Circuit Voltage	Overload Protection
2.000V	1+2	Approx. 0.5mA	<3.5V	1000V rms

Temperature Measurement(TEMP)				
Range	Accuracy	Overload Protection	Capacitor Measurement(⚡)	
−50.0∼600.0°C	2+2	1000V rms	Range	Accuracy
			10.00nF	2+10
			100.0nF	1000V rms
			1.000μF	
			10.00μF	
			100.0μF	
			1000μF	3+5

Frequency Measurement(Hz) AC Coupling, Maximum Reading 9999
Accuracy is specified after zero adjustment at 10nF to 1μF [Capacitance]

Top-Class Digital Multimeters KEW 1061/1062

●General Specifications

Measurement function:	DC Voltage, AC Voltage, DC Current, AC Current, Resistance, Frequency, Temperature, Capacitor, Duty cycle ratio, Decibel [dB, dBm], Continuity Check, Diode Test Low power-Ω*, Effective value [root mean square value] detection [RMS] and mean value detection [MEAN] can be switched during AC voltage or AC current measurement [KEW1062 only]. The low-pass filter can be switched on/off during AC voltage or AC current measurement [KEW1062 only].
Other functions:	Data Hold [D-H], Auto Hold [A-H], Peak Hold* [P-H], Range Hold [R-H], Maximum value [MAX], Minimum value [MIN], Average value [AVG], Zero Adjustment [Capacitor, Resistance], Relative values, Save to Memory, Auto Power Off [Approx. 20 minutes], LCD backlight. *: For model KEW1062 only 5-digit [LCD].....7-segment Main-display.....50000 counts Sub-display.....50000 counts Bar graph indicator.....51-segment Polarity Indicator.....“-” Appears automatically when the polarity is negative. Overrange Indicator.....“ OL ” Low-battery Indicator.....“  ” Appears when the batteries become low.
Display:	

●Specifications

Test conditions: Temperature and humidity: 23±5°C at 80%RH or less Accuracy: ± [% of reading + digit] Note: Each response time is a value to rated accuracy within selected range.

DC Voltage Measurement(≡V)			
Range	Accuracy 1061,1062	Input Impedance	Overload Protection
50.000mV	0.05+10	Approx. 100MΩ	1000V DC 1000V rms AC
500.00μA	0.02+2		
2400.0mV	0.025+5		
5.0000V	0.03+2		
50.000V	0.03+2	10MΩ	1000V DC 1000V rms AC
500.00V			
1000.0V			

NMRR: 80dB or more 50/60Hz ±0.1% (70dB or more 50/60Hz ±0.1% when 50mV Range)

CMRR: 100dB or more 50/60Hz (Rs=1kΩ) Response time: 0.3 sec. max.

AC Voltage Measurement [RMS](~V)					AC Coupling, RMS value detection, sine wave		
Range	Upper:1061, Lower:~V2, ~ Not Specified			Input Impedance	Overload Protection		
	10~20Hz	20Hz~1kHz	1kHz~10kHz			10k~20kHz	20k~50kHz
50.000mV	2+80 ^{※1}	0.4+40 ^{※2}	5+40 ^{※2}	5.5+40 ^{※2}	15+40 ^{※2}	11MΩ<50pF	1000V rms AC 1000V DC
500.00mV	1.5+30 ^{※1}	0.7+30 ^{※1}	2+50 ^{※2}	1+40 ^{※1}	5+200 ^{※2}		
5.0000V							
50.000V							
500.0V	※2	※2	3+30 ^{※2}	—	—	10MΩ<50pF	
1000.0V							

※1: At 5 to 100% of range

※2: At 10 to 100% of range

Crest factor <1.5V at 1000V range; Crest factor <3 at other range

CMRR: 80dB or more DC to 60Hz (Rs=1kΩ) Response time: 1 sec. max.

AC Voltage Measurement [MEAN](∼V) ※1062 only					
Range		Accuracy [Upper:1061, Lower:1062; —Not Specified]	Accuracy	Input Impedance	Overload Protection
		10∼20Hz	20∼500Hz	500∼1kHz	
50.000mV	2+80 ^{※2}	1.5+30 ^{※2}	5+30 ^{※2}	11MΩ<50pF	1000V rms AC 1000V DC
500.00μA					
5.0000V					
50.000V					
500.00V	※2	※2	3+30 ^{※2}	10MΩ<50pF	1000V rms AC 1000V DC
1000.0V					

※1: At 5 to 100% of range

※2: At 10 to 100% of range

Crest factor <1.5V at 1000V range; Crest factor <3 at other range

CMRR: 80dB or more DC to 60Hz (Rs=1kΩ) Response time: 1 sec. max.

DCV+ACV(≡+~)						AC Coupling, RMS value detection, sine wave	
Range	Accuracy [Upper:1061, Lower:1062; —Not Specified]				Input Impedance	Overload Protection	
	DC,10~20Hz ~1kHz	DC,20Hz ~1kHz	DC,10k~ ~20kHz	DC,20k~ 50kHz			DC,50k~ ~1MHz
5.0000V	1.5+10 ^{※1}	1+10 ^{※1}	2+10 ^{※2}	—	11MΩ<50pF	1000V rms AC 1000V DC	
50.000V	1.5+10 ^{※1}	0.5+10 ^{※1}	1+10 ^{※1}	2+10 ^{※2}			
500.00V	※2	※2	3+30 ^{※2}	10MΩ<50pF			
1000.0V	※2	※2	—	—			

High Accuracy, High Performance and Reliable Measurements

■Top Accuracy

- 0.02% basic DC accuracy for KEW 1061/1062.
- 0.09% basic DC accuracy for KEW 1051/1052.

■Dual Display

- KEW 1061/1062 : 50,000 counts, Bar graph with 51 segments. White back light display.
- KEW 1051/1052 : 6,000 counts, Bar graph with 31 segments. White back light display.

■Wide AC Frequency Bandwidth

※only for 1061, 1062

- KEW 1062 : ACV frequency bandwidth from 10Hz to 100kHz.
- KEW 1061 : ACV frequency bandwidth from 10Hz to 20kHz.

Advanced Functions

■User calibration function

- Calibration and adjustment are possible by simple operation of DMM keys.
- New technology enables the adjustment for the frequency bandwidth characteristic. ※only for 1061, 1062
※A calibrator is necessary for calibration.

■Low-pass Filter

※except for 1061

- AC measurement can be limited to low frequency, helping for instance voltage measurements in the presence of variable speed motor drivers or inverters.
- The Low-pass filter can be switched ON/OFF.

■LowPower-Ω measurement

※only for 1062

- This function uses a test voltage which is lower than 0.7V (that is the typical junction voltage drop of semi-conductors) thus it allows testing of resistors on a circuit board without unsoldering them.

■Selection of the reading mode

※only for 1052, 1062

- Selectable TRMS or MEAN measurement. The presence of distortion in an AC signal can be confirmed, if the measured TRMS and MEAN values are different.

■Sensor mode

※only for 1051, 1052

- The DMM measures the output voltage of an external sensor (e.g. clamp sensor, light sensor, temperature sensor, etc.) in the secondary display, while the primary display can be set to show the unit of the measured parameter (e.g. A, mA, Lux, °C) according to the conversion ratio chosen.

■Peak Hold function

※only for 1062

- Response time : 250μs

- The instantaneous peak values can be easily captured where normally it is impossible by MIN/MAX/AVG function.

■Auto Hold function

- The measured value is held on the display just by removing the test leads from the circuit under test. Users can remain safely concentrated on the measuring point without the need to press the Hold key.

■Relative and Percentage calculation

- Can calculate and display Relative values or Percentage (%) against the reference measurement values.


■TRMS Measurement

- Ensures accurate readings, avoiding errors (of up to 50%) which can occur when non-sinusoidal waveforms, created by common non linear loads such PCs, Inverters, switch-mode power supplies, etc, are measured.

■DC+AC TRMS Measurement

※only for 1061, 1062

- Accurate AC TRMS measurements also in the presence of superimposed DC component.
- AC and DC values are displayed simultaneously via dual display.

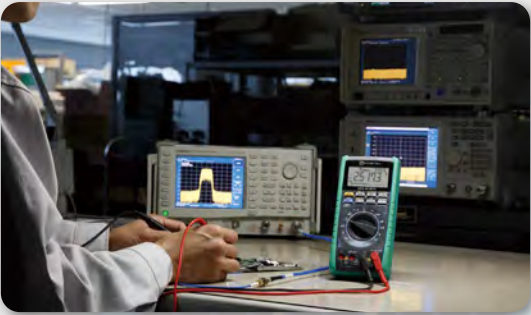

■Minimum / Maximum / Average function

※except for 1051

- Can record the MIN/MAX/AVG values during the measurement process displaying the data and the elapsed time.
※The average value is shown by dividing the integrated record data by the number of recording time.

■Duty cycle ratio measurement

※only for 1061, 1062

- The duty cycle ratio is displayed in percentage (%).

■Decibel dBV, dBm calculation

※only for 1061, 1062

- Can perform logarithmic calculations on AC voltage.
※Reference resistance value:
4/8/16/32/50/75/93/110/125/135/150/200/250/300/500/600/800/900/1000/1200Ω

Versatile Digital Multimeters KEW 1051/1052

●General Specifications

Measurement function:	DC Voltage, AC Voltage, DC Current, AC Current, Resistance, Frequency, Temperature, Capacitor, Continuity Check, Diode Test Effective value [root mean square value] detection [RMS] and mean value detection [MEAN] can be switched during AC voltage measurement (KEW1052 only). The low-pass filter can be switched on/off during AC voltage or AC current measurement.
Other functions:	Data Hold [D-H], Auto Hold [A-H], Range Hold [R-H], Maximum value* [MAX], Minimum value* [MIN], Average value* [AVG], Zero Adjustment [Capacitor, Resistance], Relative values, Save to Memory*, Auto Power Off [Approx. 20 minutes], LCD backlight. *: For model KEW1052 only 4-digit [LCD].....7-segment Main-display.....6000 counts Sub-display.....6000 counts Bar graph indicator.....31-segment Polarity Indicator.....“-” Appears automatically when the polarity is negative. Overrange Indicator.....“ OL ” Low-battery Indicator.....“  ” Appears when the batteries become low.
Display:	

●Specifications

Test conditions: Temperature and humidity: 23±5°C at 80%RH or less Accuracy: ± [% of reading + digit] Note: Each response time is a value to rated accuracy within selected range.

DC Voltage Measurement(≡V)			
Range	Accuracy	Input Impedance	Overload Protection
600.0mV	0.09+2	10MΩ	1000V DC 1000V rms AC
6.000V		11MΩ	
60.00V		10MΩ	
600.0V			
1000V	0.15+2		

NMRR: 60dB or more 50/60Hz ±0.1% CMRR: 120dB or more 50/60Hz (Rs=1kΩ)

Response time: 1 sec. max.

AC Voltage Measurement(∼V)					
Range		Accuracy		Input Impedance	Overload Protection
		50/60Hz	40∼500Hz		
600.0mV	0.5+5	1+5	1.5+5	10MΩ<200pF	1000V rms AC 1000V DC
6.000V				11MΩ<50pF	
60.00V				10MΩ<50pF	
600.0V					
1000V					

Accuracy: At 5 to 100% of range and 1000V range is 200 to 1000V, less than 1500V peak for non-sinusoidal waveforms, add ±[2% + 2% of full scale], for Crest factor<3.
CMRR: 60dB or more DC to 60Hz (Rs=1kΩ) 4 counts or less is corrected to 0, Response time: 2 sec. max.

Resistance Measurement(Ω)				
Range	Accuracy	Maximum Measuring Current	Open Circuit Voltage	Overload Protection
600.0Ω	0.4+1	<1.2mA	<3.5V	1000V rms
6.000kΩ		<110μA		
60.00kΩ		<13μA		
600.0kΩ		<1.3μA		
6.000MΩ	0.5+1	<130nA	<1.3V	1000V rms
60.00MΩ				

Accuracy is specified after zero adjustment at 600Ω to 6kΩ (Resistance)

Response time: 2 sec. max. at 600Ω to 600kΩ, 10 sec. max. at 6M to 60MΩ

Continuity Check(⦿)				
Range	Range of Operation	Measuring Current	Open Circuit Voltage	Overload Protection
600.0Ω	Buzzer sounds at lower than 50±30Ω	Approx.<1.2mA	<3.5V	1000V rms

Selection Guide

Model	1051	1052	1061	1062
Display				
Detection method	RMS	RMS/MEAN	RMS	RMS/MEAN
Maximum count display	6000	6000	50000	50000
Dual display	●	●	●	●
Bar graph	31-segment	31-segment	51-segment	51-segment
Back light	White LED	White LED	White LED	White LED
Function				
Auto hold	●	●	●	●
Peak hold	—	—	—	●
Max/Min/Ave	—	●	●	●
REL	●	●	●	●
Manual memory	—	●	●	●
Logging memory	—	●	●	●
Communication	—	●	●	●
Frequency response	40Hz∼1kHz	40Hz∼1kHz	10Hz∼20kHz	10Hz∼100kHz
Operating temperature	−10°C∼55°C	−10°C∼55°C	−20°C∼55°C	−20°C∼55°C
Safety standard	CAT III 1000V CAT IV 600V	CAT III 1000V CAT IV 600V	CAT III 1000V CAT IV 600V	CAT III 1000V CAT IV 600V

Measurement cycle:	5 times per second [except frequency measurement : one time per second, Resistance measurement (6MΩ/60MΩ) : 2.5 times per second, capacitor measurement (1000pF) : max.0.14 time per second] Bar graph display approx 25 times per second (at AC, Ω)
Operating temperature and humidity ranges:	−10 to 55°C, 80%RH or less [no condensation] 70%RH or less at 40 to 55°C.
Storage temperature and humidity ranges:	−30 to 70°C, 70%RH or less [no condensation]
Temperature coefficient:	[Accuracy at 23±5°C×0.1%/°C should be added]. (Temperature ranges: −10 to 18°C and 28 to 55°C)
Power supply:	AA-size [R6/1R8] 1.5V batteries: 4 Approximately 300 hours [Operating hours of alkaline batteries when in DC voltage-mode.] Note: The battery life varies depending on the operating conditions. 6.88Vrms AC for five seconds [across input terminals and casing]
Withstand voltage:	Approx. 192[L]×90[W]×49[D]mm
Dimensions:	Approx. 560g [including batteries]
Weight:	Approx. 560g [including batteries]
Applicable standards:	IEC61010-1 CAT IV 600V, CAT III 1000V Pollution degree 2, IEC61010-031, IEC61326-1
Accessories included:	Batteries : 4, Test leads: 1set (7220A), Fuse [included]: 440mA/1000V (8926), 10A/1000V (8927), Instruction manual: 1, Calibration Certificate

DC Current Measurement (≡)(A)			
Range	Accuracy	Voltage Drop	Overload Protection
600.0μA	0.2+2	<0.12mV/μA	440mA Protected by a 440mA/1000V fuse.
6000μA		<3.3mV/mA	
60.00mA			
440.0mA			
6.000A	0.5+5	<0.1V/A	10A Protected by A 10A/1000V fuse.
10.00A			

Response time: 1 sec. max.

AC Current Measurement[RMS](∼A)				
Range		Accuracy		Voltage Drop
		50/60Hz	40Hz∼1kHz	
600.0μA	0.75+5	1.5+5	<0.12mV/μA	440mA Protected by a 440mA/1000V fuse.
6000μA				
60.00mA				
440.0mA				
6.000A	10.00A	<0.1V/A	10A Protected by a 10A/1000V fuse.	
10.00A				

Accuracy: At 5 to 100% of range, 10A range is 2 to 10A and 440mA range is 30 to 440mA.

※2: At 10 to 100% of range

Crest factor <1.5V at 1000V range; Crest factor <3 at other range

CMRR: 80dB or more DC to 60Hz (Rs=1kΩ) 4 counts or less is corrected to 0, Response time: 3 sec. max.

Diode Test(⚡)				
Range	Accuracy	Measuring Current(I _h 0.8V)	Open Circuit Voltage	Overload Protection
2.000V	1+2	Approx. 0.5mA	<3.5V	1000V rms

Temperature Measurement(TEMP)				
Range	Accuracy	Overload Protection	Capacitor Measurement(⚡)	
−50.0∼600.0°C	2+2°C	1000V rms	Range	Accuracy
			10.00nF	2+10
			100.0nF	1000V rms
			1.000μF	
			10.00μF	
			100.0μF	
			1000μF	3+5

Frequency Measurement(Hz) AC Coupling, Maximum Reading 9999

Range	Accuracy	Input Voltage
10.00∼99.99Hz	0.02+1	0.2∼600Vrms
90.0∼999.9Hz		
0.900∼9.999kHz		
9.00∼99.9kHz		
900∼999kHz		

Accuracy is specified after zero adjustment at 10nF to 1μF [Capacitance]

Top-Class Digital Multimeters KEW 1061/1062

●General Specifications

Measurement function:	DC Voltage, AC Voltage, DC Current, AC Current, Resistance, Frequency, Temperature, Capacitor, Duty cycle ratio, Decibel [dB, dBm], Continuity Check, Diode Test Low power: Ω*, Effective value [root mean square value] detection [RMS] and mean value detection [MEAN] can be switched during AC voltage or AC current measurement [KEW1062 only]. The low-pass filter can be switched on/off during AC voltage or AC current measurement [KEW1062 only].
Other functions:	Data Hold [D-H], Auto Hold [A-H], Peak Hold* [P-H], Range Hold [R-H], Maximum value [MAX], Minimum value [MIN], Average value [AVG], Zero Adjustment [Capacitor, Resistance], Relative values, Save to Memory, Auto Power Off [Approx. 20 minutes], LCD backlight. *: For model KEW1062 only 5-digit [LCD].....7-segment Main-display.....50000 counts Sub-display.....50000 counts Bar graph indicator.....51-segment Polarity Indicator.....“-” Appears automatically when the polarity is negative. Overrange Indicator.....“ OL ” Low-battery Indicator.....“  ” Appears when the batteries become low.
Display:	

●Specifications

Test conditions: Temperature and humidity: 23±5°C at 80%RH or less Accuracy: ± [% of reading + digit] Note: Each response time is a value to rated accuracy within selected range.

DC Voltage Measurement(≡V)			
Range	Accuracy 1061,1062	Input Impedance	Overload Protection
50.000mV	0.05+10	Approx. 100MΩ	1000V DC 1000V rms AC
500.00μA	0.02+2		
2400.0mV	0.025+5		
5.0000V			
50.000V	0.03+2	10MΩ	
500.00V			
1000.0V			

NMRR: 80dB or more 50/60Hz ±0.1% (70dB or more 50/60Hz ±0.1% when 50mV Range)

CMRR: 100dB or more 50/60Hz (Rs=1kΩ) Response time: 0.3 sec. max.

AC Voltage Measurement [RMS](∼V)					
Range		Accuracy		Input Impedance	Overload Protection
		Upper:1061, Lower:1062; —Not Specified	20∼500Hz		
50.000mV	2+80 ^{※1}	0.4+40 ^{※2}	5+40 ^{※2}	15+40 ^{※2}	11MΩ<50pF
500.00μA					
5.0000V	1.5+30 ^{※1}	0.7+30 ^{※1}	2+50 ^{※2}	1+40 ^{※1}	
50.000V	1+30 ^{※1}	0.4+30 ^{※1}	2+70 ^{※2}	5+200 ^{※2}	
500.00V	※2	※2	3+30 ^{※2}	—	10MΩ<50pF
1000.0V					

※1: At 5 to 100% of range

※2: At 10 to 100% of range

Crest factor <1.5V at 1000V range; Crest factor <3 at other range

CMRR: 80dB or more DC to 60Hz (Rs=1kΩ) Response time: 1 sec. max.

AC Voltage Measurement [MEAN](∼V) ※1062 only					
Range		Accuracy		Input Impedance	Overload Protection
		10∼20Hz	20∼500Hz		
50.000mV	2+80 ^{※2}	1.5+30 ^{※2}	5+30 ^{※2}	11MΩ<50pF	1000V rms AC 1000V DC
500.00μA					
5.0000V					
50.000V					
500.00V	※2	※2	3+30 ^{※2}	10MΩ<50pF	
1000.0V					

※1: At 5 to 100% of range

※2: At 10 to 100% of range

Crest factor <1.5V at 1000V range; Crest factor <3 at other range

CMRR: 80dB or more DC to 60Hz (Rs=1kΩ) Response time: 1 sec. max.

DCV+ACV(≡+∼)						AC Coupling, RMS value detection, sine wave	
Range	Accuracy				Input Impedance	Overload Protection	
	Upper:1061; Lower:1062; —Not Specified						
	DC,10~20Hz	DC,20Hz~1kHz	DC,1k~10kHz	DC,10k~20k~50kHz	DC,50k~100kHz		
5.0000V	1.5+10 ^{※1}	1.0+10 ^{※1}	2+10 ^{※2}	—	—	11MΩ<50pF	
50.000V	1.5+10 ^{※1}	0.5+10 ^{※1}	2+10 ^{※1}	2+10 ^{※2}	5+20 ^{※2}		
500.00V	※2	※2	—	—	—		
1000.0V	※2	※2	—	—	—	10MΩ<50pF	
						1000V rms	
						1000V DC	

Safe and Durable Design. Wide Operating Temperature.

■Complies with IEC 61010-1, CAT IV 600V, CAT III 1000V

■Safety shutters to prevent incorrect test leads' insertion in current terminals

- Terminal shutters are opening or closing being linked with the rotation of the function switch.

Operation of the Safety Shutters

Safety shutters are open or closed when the appropriate function is selected because they are linked with the rotation of the function switch.



If the DMM has the function switch in position 1 (V, Ω, TEMP, etc) the safety shutters close the input terminals for the current measurements (μA, mA, A) and then the test leads cannot be plugged-in.

If the DMM has the function switch in position 2 (current measurements) then the safety shutters automatically open making it possible to plug-in the test leads in the input terminals for the current measurements (μA, mA, A).

■Very wide operating temperature range

- From -20°C to +55°C for KEW 1061/1062
- From -10°C to +55°C for KEW 1051/1052

■High specs UL standard fuses for extra safety

- Fuses rated at 1000V with 30kA of breaking capacity.

■Over molding case

- Made by "Elastomer", a superior shock sustainable material. Perfectly fits to hand.

Reliable support for data management

■Large internal memory to store test data

- KEW1062: 10,000 data in Logging mode, 100 data manually saved.
- KEW1061: 1,000 data in Logging mode, 100 data manually saved.
- KEW1052: 1,600 data in Logging mode, 100 data manually saved.
- Logging interval can set from 1 sec. to 30 min.

■Test data can be transferred to a PC or directly to a Printer*


- Real-time data can be transferred and shown on a PC.
- Real-time transferring permits the saving of a considerable amount of data on a PC.
- Stored data of internal memory can be monitored by PC.

■Data management with the software DMM Application*

- List of measured data can be converted into Graph.
- Data can be transferred to Excel** and saved as CSV file.

*Optional accessories are required, refer to last page.

**Excel is a registered trademark of Microsoft in the USA.

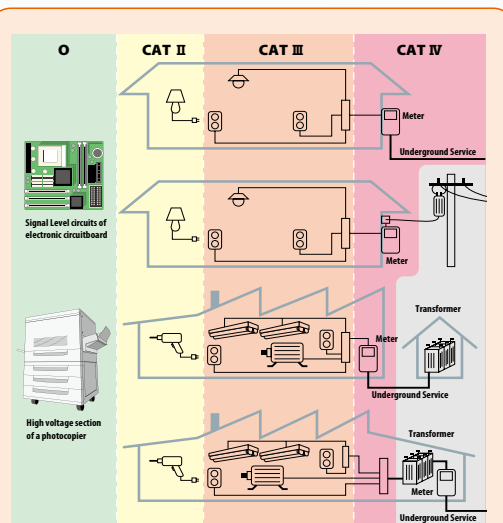

To protect us against overvoltage spikes, we must use instruments that meet the requirements for high protection standards.

The IEC (International Electrotechnical Commission) has prepared an International and European safety standard named IEC 61010-1 with the aim of defining the safety requirements for measuring instruments.

In particular IEC 61010-1 standard defines also the safety Measurement areas called Categories, shortly indicated with the abbreviation "CAT".

These Categories start from O to CAT IV and the most dangerous one is the CAT IV. The figure above shows some area examples of Measurement Categories.

Measurement category	Description	Examples
O	For measurements performed on circuits not directly connected to MAINS.	Signal level circuits of electronic PCBs, etc.
CAT II	For measurements performed on circuits directly connected to the low voltage installation.	Appliances, portable equipment, ect.
CAT III	For measurements performed in the building installation.	Distribution board, circuit breaker, ect.
CAT IV	For measurements performed all the source of the low-voltage installation.	Overhead wire, cable systems, ect.


Printer output

L0000 N+12.539 VDC
L0001 N+12.532 VDC
L0002 N+12.532 VDC
L0003 N+12.529 VDC
L0004 N+12.532 VDC
L0005 N+12.538 VDC
L0006 N+12.541 VDC
L0007 N+12.546 VDC
L0008 N+12.552 VDC
L0009 N+12.557 VDC
L0010 N+12.555 VDC
L0011 N+12.554 VDC
L0012 N+12.553 VDC
L0013 N+12.553 VDC


Printed items (from the left)

- L: Logging memory
- 4 digit numbers: Data number
- N: Normal measurement (C: at "OL" display)
- (B: at "Battery warning" display)
- 5 digit numbers: Measurement
- VDC: Unit (VDC is DC Voltage)

Data analysis with Excel

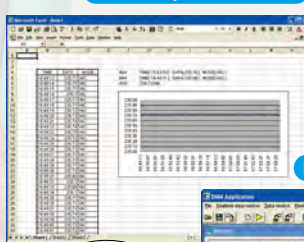

DMM Application software

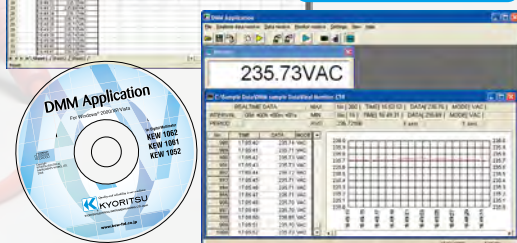

● Included Accessories


Description	MODEL	Contents
Test leads	7220A	CAT IV 600V, CAT III 1000V 1set
	8926	440mA/1000V×1
Fuse	8927	10A/1000V×1

● Optional Accessories

Description	MODEL	Contents
Alligator Clip	7234	CAT IV 600V, CAT III 1000V 1set
USB Communication set	8241	USB adaptor+USB cable+DMM Software
	8405	Max. 500°C (Surface type, Point material: Ceramic)
	8406	Max. 500°C (Surface type)
Thermocouple Type K	8407	Max. 700°C (Liquid, Semi-solid)
	8408	Max. 600°C (Air, Gas)
	8121	AC 100A
	8122	AC 500A
Clamp sensor	8123	AC 1000A
	8146	AC 30A
	8147	AC 70A
	8148	AC 100A
Banana Ø4mm Adjuster Plug	7146	length :190mm
Carrying case	9154	Soft case(for the main unit with test leads and communication cable)




Test leads (7220A)

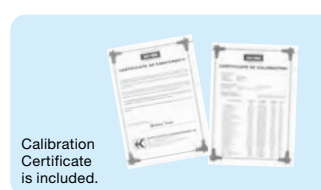

Calibration Certificate is included.



Alligator Clip (7234)

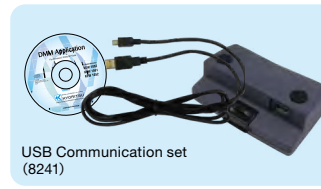

USB Communication set (8241)



Carrying case (9154)



Banana Ø4mm adjuster plug (7146)

● Clamp sensor Specification

	AC/DC current sensor	8115	8121	8122	8123	8146	8147	8148
Conductor size	φ12	φ24	φ40	φ55	φ24	φ40	φ40	φ68
Rated current	AC 130A / DC 180A	AC 100A	AC 500A	AC 1000A	AC 30A	AC 70A	AC 70A	AC 100A
Output voltage	AC/DC 10mV/A	AC 500mV/100A	AC 500mV/500A	AC 500mV/1000A	AC 1500mV/30A	AC 3500mV/70A	AC 3500mV/70A	AC 5000mV/100A
Accuracy (50/60Hz)	AC ±1.0%rdg±0.4mV DC ±1.0%rdg±0.4mV (This accuracy is defined after a zero-adjustment)		±2.0%rdg±0.3mV		0~15A ±1.0%rdg±0.1mV 15~30A ±5.0%rdg	0~40A ±1.0%rdg±0.1mV 40~70A ±5.0%rdg	0~40A ±1.0%rdg±0.1mV 40~70A ±5.0%rdg	0~80A ±1.0%rdg±0.1mV 80~100A ±5.0%rdg
Frequency range				40Hz~1kHz				
Dimensions	127[L]×42[W]×22[D]mm	97[L]×59[W]×26[D]mm	128[L]×81[W]×36[D]mm	170[L]×105[W]×48[D]mm	100[L]×60[W]×26[D]mm	128[L]×81[W]×36[D]mm	128[L]×81[W]×36[D]mm	186[L]×129[W]×53[D]mm
Weight	approx. 160g	approx. 150g	approx. 260g	approx. 360g	approx. 150g	approx. 240g	approx. 240g	approx. 510g

※ Other Kyoritsu clamp sensors can be used with these DMMs, please check our website for more info. ※ Banana Ø4 mm adjuster plug (7146) is required to use these sensors with the DMMs, with the exception for the 8115.

● Thermocouple Type K Specification


Model	Usage	Measurement temperature	Tolerance (t: measurement temperature)	Response speed
8405	(Surface type, Point material: Ceramic)	Max. 500°C	±2.5°C/t=-40°C~333°C, ±0.0075× t °C/t=333°C~500°C	approx. 1.8 Sec.
8406	Surface type			approx. 1.0 Sec.
8407	(Liquid, Semi-solid)	Max. 700°C	±2.5°C/t=-40°C~333°C, ±0.0075× t °C/t=333°C~700°C	1 Sec. or less
8408	(Air, Gas)	Max. 600°C	±2.5°C/t=-40°C~333°C, ±0.0075× t °C/t=333°C~600°C	0.4 Sec.




MODEL 8405



MODEL 8406

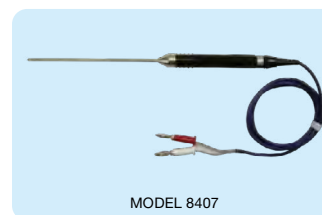

MODEL 8407

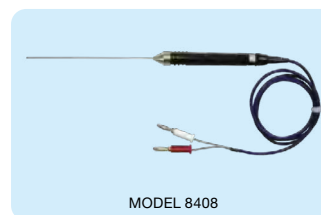

MODEL 8408



Safety Warnings :

Please read the "Safety Warnings" in the instruction manual supplied with the instrument thoroughly and completely for correct use. Failure to follow the safety rules can cause fire, trouble, electrical shock, etc. Therefore, make sure to operate the instrument on a correct power supply and voltage rating marked on each instrument.

■For inquires or orders :



**KYORITSU ELECTRICAL
INSTRUMENTS
WORKS, LTD.**

2-5-20, Nakane, Meguro-ku, Tokyo, 152-0031 Japan

Phone:+81-3-3723-0131

Fax:+81-3-3723-0152

E-mail:info-eng@kew-ltd.co.jp

www.kew-ltd.co.jp



The Best of Reliable Multimeters with Terminal Safety Shutters

Versatile Multimeters

For Electrical and Electronic
Troubleshooting

KEW 1051/1052

Top Class Multimeters

For Laboratory and
Industrial Use

KEW 1061/1062



High Accuracy, Performance and safe design

KEW 1051

KEW 1052

KEW 1061

KEW 1062



KYORITSU ELECTRICAL INSTRUMENTS WORKS, LTD.

www.kew-ltd.co.jp

X-ON Electronics

Largest Supplier of Electrical and Electronic Components

Click to view similar products for [Digital Multimeters](#) category:

Click to view products by [Kyoritsu](#) manufacturer:

Other Similar products are found below :

[6111-517](#) [FS881](#) [40705X](#) [C.A 6133 LAUNCH KIT](#) [P 1020 A](#) [P 3340](#) [SEFRAM7303](#) [BS K-CLIP](#) [19290](#) [IBT6K](#) [1000-219](#) [1001-613](#) [1006-969](#) [1008-221](#) [1012-597](#) [1013-099](#) [30XR](#) [34XR](#) [35XP](#) [TESTO 745](#) [0590 7450](#) [TESTO 760-2](#) [0590 7602](#) [TESTO 760-3](#) [0590 7603](#) [440012](#) [AX-155](#) [AX-174](#) [AX-178](#) [AX-18B](#) [AX-190A](#) [AX-503](#) [AX-507B](#) [AX-594](#) [AX-LCR42A](#) [AX-MS811](#) [AX-MS8250](#) [AX-PDM01](#) [AX-T520](#) [AX-T901](#) [AX-T903](#) [BAT-250-EUR](#) [BM525S](#) [BM805S](#) [BM807S](#) [BM817S](#) [BM827S](#) [BM829S](#) [BM857S](#) [BM859S](#) [BM867S](#) [BM907S](#) [33XR](#)