Total solder points: 198 Difficulty level: beginner 1 ☑ 2 ☐ 3 ☐ 4 ☐ 5 ☐ advanced



DUAL ELECTRONIC DICE




K3400

Cheating is no longer possible!

ILLUSTRATED ASSEMBLY MANUAL

H3400IP-1





Features:

- ☑ Two independent dice.
 ☑ Use a single or both dice at the same time.
 ☑ Display auto shut-off saves battery power.
 ☑ Low power consumption.

Specifications:

- Power supply: 8-12VDC or 6VAC.
 Idle power consumption: 1mA.
 Power consumption both dice on: 60mA.
 PCB dimensions: 76 x 70mm (3.0" x 2.8")



1. Assembly (Skipping this can lead to troubles!)
Ok, so we have your attention. These hints will help you to make this project successful. Read them carefully.

1.1 Make sure you have the right tools:

- A good quality soldering iron (25-40W) with a small tip.
- Wipe it often on a wet sponge or cloth, to keep it clean; then apply solder to the tip, to give it a wet look. This is called 'thinning' and will protect the tip, and enables you to make good connections. When solder rolls off the tip, it needs cleaning.
- Thin raisin-core solder. Do not use any flux or grease.
- A diagonal cutter to trim excess wires. To avoid injury when cutting excess leads, hold the lead so they cannot fly towards the eyes.
- Needle nose pliers, for bending leads, or to hold components in place.
- Small blade and Phillips screwdrivers. A basic range is fine.


For some projects, a basic multi-meter is required, or might be handy

- 1.2 Assembly Hints : \Rightarrow Make sure the skill level matches your experience, to avoid disappointments.
- \Rightarrow Follow the instructions carefully. Read and understand the entire step before you perform each operation.
- \Rightarrow Perform the assembly in the correct order as stated in this manual
- ⇒ Position all parts on the PCB (Printed Circuit Board) as shown on the drawings.
- \Rightarrow Values on the circuit diagram are subject to changes.
- Values in this assembly guide are correct*
- ⇒ Use the check-boxes to mark your progress.
- ⇒ Please read the included information on safety and customer service
- * Typographical inaccuracies excluded. Always look for possible last minute manual updates, indicated as 'NOTE' on a separate leaflet.



1.3 Soldering Hints :

1- Mount the component against the PCB surface and carefully solder the leads



- 2- Make sure the solder joints are cone-shaped and shiny
- 3- Trim excess leads as close as possible to the solder joint






REMOVE THEM FROM THE TAPE ONE AT A TIME!






✓ You will find the colour code for the resistances and the LEDs in the HALG (general manual) and on our website: http://www.velleman.be/common/service.aspx




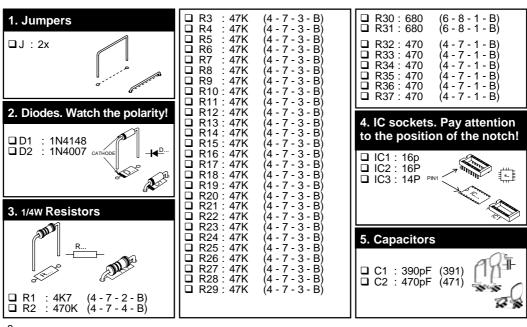


6



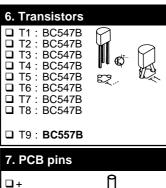


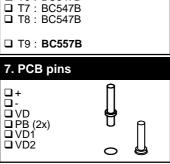



□ C3: 100μF □ C4: 100μF -∏<u>-</u>C... **3**

9. LED's. Watch the polarity!

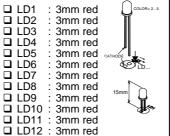

- □ LD13 : 3mm red □ LD14 : 3mm red
- Pay attention to the polarity! As to the height of the leds, take into account the housing that will be used.
- Mount them high enough anyway to make them overtop all other components. The leds must all stand upright and be at the same height.

10. IC's. Pay attention to the notch!

☐ IC1 : 4022 ☐ IC2 : 4022 ☐ IC3 : 4093



Pay attention to the position of the notch!



11. Connection & test

The push button (single pole normally open contact) has to be connected to the points PB. Display selection is done by connecting VD1 respectively VD2 to VD.

You can make these connections permanent, or use a bipolar three position slide switch as shown in the connections diagram. In this case the slide switch functions as selector and on/off- switch at the same time. The power supply has to be connected to the points + and -. At choice you can use a 9V battery, a 8 to 12V power supply, or a 6V transformer.

For testing you select both displays.


Push the button. As long as you push, the leds all burn feebly. This is because the dice are 'rolling'. Cheating is out of the question, thanks to the very high and different speeds of both dice.

The result appears as soon as you release the button.

After about half a minute displays are switched off, so that current consumption is reduced to less than 1mA.




12. Connection example

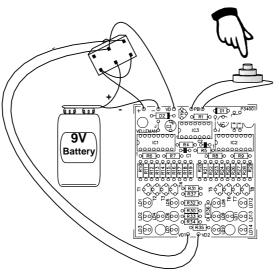


USE A SLIDE SWITCH (ON OFF ON)



13. Schematic diagram.

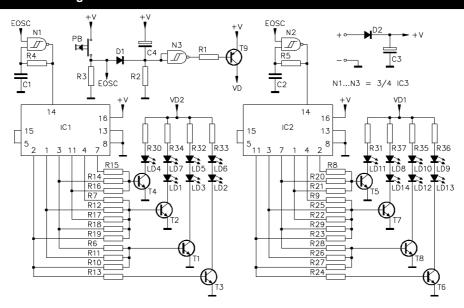

14. PCB

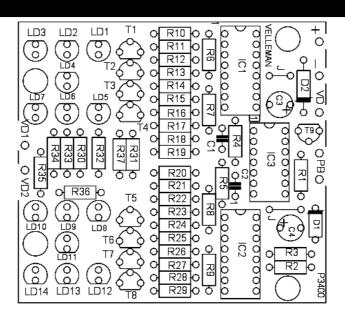



Modifications and typographical errors reserved © Velleman Components nv. H3400IP - 2004 - ED1



X-ON Electronics

Largest Supplier of Electrical and Electronic Components

Click to view similar products for Velleman manufacturer:

Other Similar products are found below:

MK137 MK106 K/TRANS1 K/RES-E3 K/TF300 MK108 K2634 MK152 MK123 K8086 MK149 VM100 MK144 MK190 K1803 MK134 K/CAP1 MK111 OMSB36 MK103 K/DIODE1 MK109 MK135 MK150 MK112 MK120 K/RES-E12 VTHH6