

SA1E-L

Miniature Photoelectric Switches (Built-in Amplifier) Laser






Easy Installation

Because the optical axis can be positioned quickly, the photoelectric switch can be installed on a machine or system easily, even in applications requiring a long sensing range or detection of small objects.

IDEC's Unique Optical Lens Mechanism

Parallel beam to the housing axis makes installation of the photoelectric switch easy. (fixed in the housing)

Optical Lens (positioned to make the beam parallel to the housing axis) Housing Optical Lens (fixed in the housing)




Light ON/Dark ON











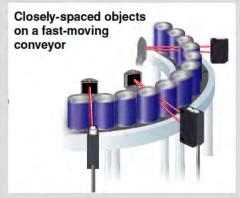


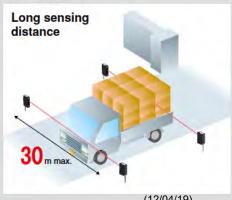

(12/04/19)

fast response speed, and high precision sensing. Through-beam **Polarized Retroreflective Background Suppression (BGS) Detects fast-moving** Fast objects 250 µs The 250 µs response speed is the fastest in its class. Closely-spaced objects on a fast-moving conveyor can be detected reliably. Small red laser beam Because the visible red laser Red is easy to see in both short (20 mm) and long (30 m) distances, aser the detecting position and optical axis can be found quickly. The small beam can detect small objects, and it also enables easy positioning of the sensor in applications where the beam has to pass through narrow spaces. All models are Class 1 laser compliant (JIS, IEC, FDA). Dust and water resistant IP67 structure can be used in environments exposed to dust or water vapor.

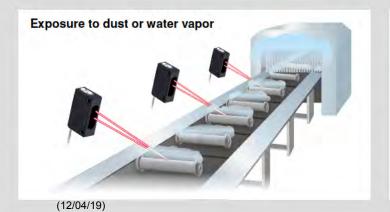

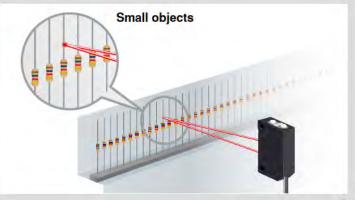

SA1E-L


Miniature Laser Photoelectric Switches (Built-in Amplifier)

Class 1 laser.

Fastest response in its class. Reliably detects fast-moving objects.

- Light source is a red laser (Class 1 by IEC60825-1, 2007).
- Laser beams with high degree of straightness achieve a long sensing range (30 m maximum).
- Response speed of 250 µs is the fastest in its class. Reliably detects fastmoving small objects.
- The visible beam ensures easy and reliable positioning.
- IP67 structure can be used in environments exposed to dust or water. Operating temperature: 55°C maximum.
- Aligning the optical axis is easy because the lens unit is fixed on the housing (through-beam/polarized retroreflective).
- Light ON/Dark ON mode is selectable.
- Cable (1m, 2m, 5m cable) or M8 connector.
- •CE marked.
- Compliant with Class 1 of FDA regulations (according to Laser Notice No. 50).



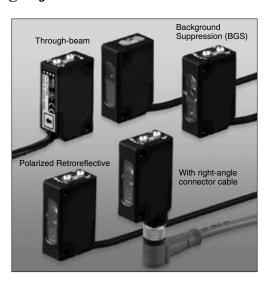

Package Quantity: 1

	Sensing Method	Consing Pange	Connection	Cable	Part No.	
	Sensing Method	Sensing Range	Connection	Length	NPN Output	PNP Output
				1 m	SA1E-LTN3	SA1E-LTP3
n-beam		∬ 30m	Cable	2 m	SA1E-LTN3-2M	SA1E-LTP3-2M
Through-beam				5 m	SA1E-LTN3-5M	SA1E-LTP3-5M
		See the characteristics on page 11.	Connector	_	SA1E-LTN3C	SA1E-LTP3C
ctive	tive	10m (300 mm) When using IAC-R5/R8 10m (300 mm) When using IAC-R9 (Note) See the characteristics on page 11.		1 m	SA1E-LPN3	SA1E-LPP3
trorefle	~		Cable	2 m	SA1E-LPN3-2M	SA1E-LPP3-2M
Polarized Retroreflective	(Note)			5 m	SA1E-LPN3-5M	SA1E-LPP3-5M
Pola			Connector	_	SA1E-LPN3C	SA1E-LPP3C
ssion				1 m	SA1E-LBN3	SA1E-LBP3
Suppres		20 to 300 mm	Cable	2 m	SA1E-LBN3-2M	SA1E-LBP3-2M
Background Suppression		Adjustable Sensing Range 40 to 300 mm		5 m	SA1E-LBN3-5M	SA1E-LBP3-5M
Back		See the characteristics on page 12.	Connector	_	SA1E-LBN3C	SA1E-LBP3C

Note: Maintain at least the distance shown in the () between the SA1E-L photoelectric switch and reflector. Reflectors are not supplied and must be ordered separately. See page 5.

Accessories (optional)

Sensor Mounting Brackets

	Item	Part No.	Package Quantity
	Vertical Mounting	SA9Z-K01	
Sensor	Horizontal Mounting	SA9Z-K02	
Mounting Brackets	Cover Type	SA9Z-K03	'
	Back Mounting	SA9Z-K04	

- See page 8 for dimensions.
- Two mounting screws (M3 x 12 mm sems screws) are supplied with the SA9Z-K01 and SA9Z-K02.
- Two mounting screws (M3 x 14 mm sems screws) are supplied with the SA9Z-K03.
- The through-beam type requires two mounting brackets, one each for the projector and the receiver.
- The SA9Z-K02 cannot be used for the connector models.
- Contact IDEC about mounting brackets for the connector models.

Slits (for through-beam)

Item	Slit Size	Part No.	Ordering No.	Package
Itom	Ont Oizo	T dit 140.	Ordering No.	Quantity
	ø0.5 mm	SA9Z-S12	SA9Z-S12PN02	
Round Slit	ø1.0 mm	SA9Z-S13	SA9Z-S13PN02	2
	ø2.0 mm	SA9Z-S14	SA9Z-S14PN02	

[•] See page 6 for dimensions.

Reflectors

Item	Part No.	Package Quantity
	IAC-R5	
Reflector	IAC-R8	1
	IAC-R9	

[•] See page 9 for dimensions.

Connector Cable (for connector models)

	· · · · · · · · · · · · · · · · · · ·	· · · · · · · · · · · · · · · · · · ·	
Number of Core Wires	Style & Length	Part No.	Package Quantity
	Straight, 2m	SA9Z-CM8K-4S2	
4	Straight, 5m	SA9Z-CM8K-4S5	4
4	Right angle, 2m	SA9Z-CM8K-4L2	'
	Right angle, 5m	SA9Z-CM8K-4L5	

- See page 10 for dimensions.
- Contact IDEC for UL approved cables.

Sensitivity Control Screwdriver

Item	Part No.	Package Quantity
Sensitivity Control Screwdriver		
•	SA9Z-AD01	1

Reflector Mounting Brackets

Item		Part No.	Package Quantity
Reflector	For IAC-R5	IAC-L2 (Note 1)	
Mounting	For IAC-R9	IAC-L3 (Note 2)	1
Bracket	For IAC-R8	IAC-L5 (Note 3)	

- See page 10 for dimensions.
- Note 1: The IAC-L2 is not supplied with M4 mounting screws and nuts.
- Note 2: The IAC-L3 is supplied with two M3 mounting screws (M3 \times 8 mm sems screws).
- Note 3: The IAC-L5 is supplied with two M4 mounting screws $(M4 \times 10 \text{ mm sems screws})$.

Air Blower Mounting Block

Item	Part No.	Package Quantity
Air Blower Mounting Block	SA9Z-A02	1

- See page 10 for dimensions.
- Two mounting screws (M3 × 20 mm sems screws), one M5 × 6 mm screw for plugging the air supply port, and one gasket (0.5 mm thick) are supplied.
- The air tube fitting and mounting bracket are not supplied and must be ordered separately (recommended mounting bracket: SA9Z-K01).
- Material: Anodized aluminum surface

Specifications

Part No.			Through-beam	Polarized Retroreflective	Background Suppression (BGS)		
Equipped with reverse-polarity protection Projector 15 mA maximum Receiver: 30 mA maximum Receiver: 30 mA maximum 35 mA maximum 35 mA maximum 35 mA maximum 30 m 0.3 to 10m (IAC-RS/R8/R9) 20 to 300 mm (using 100 × 100 mm white matte paper) 40 to 300 mm 40 to 300 mm	Part No.		SA1E-LT	SA1E-LP	SA1E-LB		
Sensing Range 30m 0.3 to 10m (IAC-RS/R8/R9) 20 to 300 mm (using 100 x 100 mm white matte paper) Adjustable Sensing Range — 40 to 300 mm Detectable Object Size (typical) of 6 mm minimum (opaque, at 3 m) 0.2 mm minimum (copper wire) (at 170 mm) Detectable Object Size (typical) of 6 mm minimum (opaque, at 3 m) 0.2 mm minimum (copper wire) (at 170 mm) Detectable Object Opaque	Power Volta	ge					
Sensing Range Som Som	Current Draw		, ,	35 mA maximum			
Detectable Object Size (typical) a6 mm minimum (opaque, at 3 m) a0.2 mm minimum (copper wire) (at 170 mm) ac 170 mm ac 170 mm) ac 170 mm ac 170 mm) ac 170 mm	Sensing Rar	nge	30m	0.3 to 10m (IAC-R5/R8/R9)	(using 100 × 100 mm white matte		
Detectable Object Opaque	Adjustable S	ensing Range	-	_	40 to 300 mm		
Hysteresis	Detectable C	Object Size (typical)	ø6 mm minimum (opaque, at 3 m)				
Seponse Time 250 μs maximum Sensitivity Adjustment Adjustable using a potentiometer — Geturn control knob	Detectable C	Object	Opaque				
Sensitivity Adjustment Sensing Range Adjustment Sensing Range Adjustment Light Source Element Operation Mode Light ON/Dark ON (selectable) NPN open collector or PNP open collector (30V DC, 100 mA maximum, short-circuit protection) Voltage drop: 1.5V maximum Operation LED: Yellow Stable LED: Green Power LED: Green (Through-beam type projector) Interference Prevention Degree of Protection Extraneous Light Immunity Sunlight: 10,000 lux maximum, Incandescent lamp: 5,000 lux maximum (at receiver) Operating Temperature -10 to +55°C (no freezing) Operating Humidity 35 to 85% RH (no condensation) Storage Temperature -25 to +70°C (no freezing) Storage Humidity 35 to 85% RH (no condensation) Storage Humidity Storage Humidity 35 to 85% RH (no condensation) Storage Humidity 10 setween live part and mounting bracket: 20 MΩ minimum (500V DC megger) Cable models: 1,000V AC, 50/66 Hz, 1 minute (between live part and mounting bracket) Connector models when connected with connector cable: 500V AC, 50/66 Hz, 1 minute (between live part and clamp ring) Vibration Resistance 10 to 55 Hz, amplitude 1.5 mm, 20 cycles in each of 3 axes Shock Resistance 500 m/s², 3 shocks in each of 3 axes Material Housing: PBT, Lens: PMMA, Indicator cover: PC, knob; POM Weight (approx.) Cable Model 20g Connector Model Cable Model 63.5 mm, 3-core, 0.2 mm², vinyl cabtyre cable	Hysteresis		_	_	10% maximum		
Sensing Range Adjustment Light Source Element Red laser diode (emission wavelength: 650 nm) (IEC/JIS/FDA Class 1) (Note) Departion Mode Light ON/Dark ON (selectable) NPN open collector or PNP open collector (30V DC, 100 mA maximum, short-circuit protection) Voltage drop: 1.5V maximum Operation LED: Yellow Stable LED: Green (Through-beam type projector) Interference Prevention Degree of Protection IP67 (IEC 60529) Extraneous Light Immunity Sunlight: 10,000 lux maximum, Incandescent lamp: 5,000 lux maximum (at receiver) Operating Temperature -10 to +55°C (no freezing) Operating Humidity 35 to 85% RH (no condensation) Storage Temperature -25 to +70°C (no freezing) Storage Temperature Dielectric Strength Cable models: 1,000V AC, 50/60 Hz, 1 minute (between live part and mounting bracket) Connector models when connected with connector cable: 500V AC, 50/60 Hz, 1 minute (between live part and mounting bracket) Shock Resistance 10 to 55 Hz, amplitude 1.5 mm, 20 cycles in each of 3 axes Shock Resistance 500 m/s², 3 shocks in each of 3 axes Housing: PBT, Lens: PMMA, Indicator cover: PC, knob; POM Weight Cable Model Connector Model Connector Model Cable Model 03.5 mm, 3-core, 0.2 mm², vinyl cabtyre cable	Response T	ime	250 μs maximum				
Light Source Element Red laser diode (emission wavelength: 650 nm) (IEC/JIS/FDA Class 1) (Note) Light ON/Dark ON (selectable) NPN open collector or PNP open collector (300 DC, 100 mA maximum, short-circuit protection) Voltage drop: 1.5V maximum Operation LED: Yellow Stable LED: Green Power LED: Green (Through-beam type projector) Interference Prevention — Two units can be mounted in close proximity. Degree of Protection IP67 (IEC 60529) Extraneous Light Immunity Sunlight: 10,000 lux maximum, Incandescent lamp: 5,000 lux maximum (at receiver) Operating Temperature —10 to +55°C (no freezing) Storage Temperature —25 to +70°C (no freezing) Storage Temperature —25 to +70°C (no freezing) Storage Humidity 35 to 85% RH (no condensation) Insulation Resistance Between live part and mounting bracket: 20 MΩ minimum (500V DC megger) Cable models: 1,000V AC, 50/60 Hz, 1 minute (between live part and mounting bracket) Connector models when connected with connector cable: 500V AC, 50/60 Hz, 1 minute (between live part and mounting bracket) Connector models when connected with connector cable: 500V AC, 50/60 Hz, 1 minute (between live part and clamp ring) Vibration Resistance 10 to 55 Hz, amplitude 1.5 mm, 20 cycles in each of 3 axes Shock Resistance Shock Resistance 500 m/s², 3 shocks in each of 3 axes Housing: PBT, Lens: PMMA, Indicator cover: PC, knob; POM Weight (approx.) Cable Model Oahle Model	Sensitivity A	djustment	Adjustable using a potentiometer		_		
Operation Mode Light ON/Dark ON (selectable) NPN open collector or PNP open collector (30V DC, 100 mA maximum, short-circuit protection) Voltage drop: 1.5V maximum Operation LED: Yellow Stable LED: Green Power LED: Green (Through-beam type projector) Interference Prevention Degree of Protection IP67 (IEC 60529) Extraneous Light Immunity Operating Temperature -10 to +55°C (no freezing) Operating Humidity 35 to 85% RH (no condensation) Storage Temperature -25 to +70°C (no freezing) Storage Humidity 35 to 85% RH (no condensation) Insulation Resistance Between live part and mounting bracket: 20 MΩ minimum (500V DC megger) Cable models: 1,000V AC, 50/60 Hz, 1 minute (between live part and mounting bracket) Connector models when connected with connector cable: 500V AC, 50/60 Hz, 1 minute (between live part and clamp ring) Vibration Resistance 10 to 55 Hz, amplitude 1.5 mm, 20 cycles in each of 3 axes Shock Resistance 500 m/s², 3 shocks in each of 3 axes Housing: PBT, Lens: PMMA, Indicator cover: PC, knob; POM Weight (approx.) Cable Model 63.5 mm, 3-core, 0.2 mm², vinyl cabtyre cable	Sensing Rar	nge Adjustment	_	_	6-turn control knob		
NPN open collector or PNP open collector (30V DC, 100 mA maximum, short-circuit protection) Voltage drop: 1.5V maximum Operation LED: Yellow Stable LED: Green Power LED: Green (Through-beam type projector) Interference Prevention Degree of Protection IP67 (IEC 60529) Extraneous Light Immunity Sunlight: 10,000 lux maximum, Incandescent lamp: 5,000 lux maximum (at receiver) Operating Temperature -10 to +55°C (no freezing) Operating Humidity 35 to 85% RH (no condensation) Storage Temperature -25 to +70°C (no freezing) Storage Humidity 35 to 85% RH (no condensation) Insulation Resistance Between live part and mounting bracket: 20 MΩ minimum (500V DC megger) Cable models: 1,000V AC, 50/60 Hz, 1 minute (between live part and mounting bracket) Connector models when connected with connector cable: 500V AC, 50/60 Hz, 1 minute (between live part and clamp ring) Vibration Resistance 10 to 55 Hz, amplitude 1.5 mm, 20 cycles in each of 3 axes Shock Resistance Material Housing: PBT, Lens: PMMA, Indicator cover: PC, knob; POM Weight (approx.) Cable Model 93.5 mm, 3-core, 0.2 mm², vinyl cabtyre cable	Light Source	Element	Red laser diode (emission wavelengt	h: 650 nm) (IEC/JIS/FDA Class 1) (No	te)		
Control Output (30V DC, 100 mA maximum, short-circuit protection) Voltage drop: 1.5V maximum Operation LED: Yellow Stable LED: Green Power LED: Green (Through-beam type projector) Interference Prevention Degree of Protection Extraneous Light Immunity Operating Temperature -10 to +55°C (no freezing) Operating Humidity 35 to 85% RH (no condensation) Storage Temperature -25 to +70°C (no freezing) Storage Humidity 35 to 85% RH (no condensation) Insulation Resistance Between live part and mounting bracket: 20 MΩ minimum (500V DC megger) Cable models: 1,000V AC, 50/60 Hz, 1 minute (between live part and mounting bracket) Connector models when connected with connector cable: 500V AC, 50/60 Hz, 1 minute (between live part and clamp ring) Vibration Resistance Material Veight (approx.) Cable Model Ø3.5 mm, 3-core, 0.2 mm², vinyl cabtyre cable	Operation M	ode	Light ON/Dark ON (selectable)				
Stable LED:	Control Outp	put	(30V DC, 100 mA maximum, short-circuit protection)				
Degree of ProtectionIP67 (IEC 60529)Extraneous Light ImmunitySunlight: 10,000 lux maximum, Incandescent lamp: 5,000 lux maximum (at receiver)Operating Temperature-10 to +55°C (no freezing)Operating Humidity35 to 85% RH (no condensation)Storage Temperature-25 to +70°C (no freezing)Storage Humidity35 to 85% RH (no condensation)Insulation ResistanceBetween live part and mounting bracket: 20 MΩ minimum (500V DC megger)Cable models: 1,000V AC, 50/60 Hz, 1 minute (between live part and mounting bracket) Connector models when connected with connector cable: 500V AC, 50/60 Hz, 1 minute (between live part and clamp ring)Vibration Resistance10 to 55 Hz, amplitude 1.5 mm, 20 cycles in each of 3 axesShock Resistance500 m/s², 3 shocks in each of 3 axesMaterialHousing: PBT, Lens: PMMA, Indicator cover: PC, knob; POMWeight (approx.)Cable Model35g (1 m cable), 55g (2 m cable), 120g (5 m cable)ConnectionCable Model43.5 mm, 3-core, 0.2 mm², vinyl cabtyre cable	LED Indicate	ors	Stable LED: Green				
Extraneous Light ImmunitySunlight: 10,000 lux maximum, Incandescent lamp: 5,000 lux maximum (at receiver)Operating Temperature-10 to +55°C (no freezing)Operating Humidity35 to 85% RH (no condensation)Storage Temperature-25 to +70°C (no freezing)Storage Humidity35 to 85% RH (no condensation)Insulation ResistanceBetween live part and mounting bracket: 20 MΩ minimum (500V DC megger)Cable models: 1,000V AC, 50/60 Hz, 1 minute (between live part and mounting bracket) Connector models when connected with connector cable: 500V AC, 50/60 Hz, 1 minute (between live part and clamp ring)Vibration Resistance10 to 55 Hz, amplitude 1.5 mm, 20 cycles in each of 3 axesShock Resistance500 m/s², 3 shocks in each of 3 axesMaterialHousing: PBT, Lens: PMMA, Indicator cover: PC, knob; POMWeight (approx.)Cable Model35g (1 m cable), 55g (2 m cable), 120g (5 m cable)ConnectionCable Model43.5 mm, 3-core, 0.2 mm², vinyl cabtyre cable	Interference	Prevention	_	Two units can be mounted in close proximity.			
Operating Temperature-10 to +55°C (no freezing)Operating Humidity35 to 85% RH (no condensation)Storage Temperature-25 to +70°C (no freezing)Storage Humidity35 to 85% RH (no condensation)Insulation ResistanceBetween live part and mounting bracket: 20 MΩ minimum (500V DC megger)Cable models: 1,000V AC, 50/60 Hz, 1 minute (between live part and mounting bracket) Connector models when connected with connector cable: 500V AC, 50/60 Hz, 1 minute (between live part and clamp ring)Vibration Resistance10 to 55 Hz, amplitude 1.5 mm, 20 cycles in each of 3 axesShock Resistance500 m/s², 3 shocks in each of 3 axesMaterialHousing: PBT, Lens: PMMA, Indicator cover: PC, knob; POMWeight (approx.)Cable Model35g (1 m cable), 55g (2 m cable), 120g (5 m cable)ConnectionCable ModelØ3.5 mm, 3-core, 0.2 mm², vinyl cabtyre cable	Degree of P	rotection	IP67 (IEC 60529)				
Operating Humidity35 to 85% RH (no condensation)Storage Temperature-25 to +70°C (no freezing)Storage Humidity35 to 85% RH (no condensation)Insulation ResistanceBetween live part and mounting bracket: 20 MΩ minimum (500V DC megger)Cable models: 1,000V AC, 50/60 Hz, 1 minute (between live part and mounting bracket)Connector models when connected with connector cable: 500V AC, 50/60 Hz, 1 minute (between live part and clamp ring)Vibration Resistance10 to 55 Hz, amplitude 1.5 mm, 20 cycles in each of 3 axesShock Resistance500 m/s², 3 shocks in each of 3 axesMaterialHousing: PBT, Lens: PMMA, Indicator cover: PC, knob; POMWeight (approx.)Cable Model35g (1 m cable), 55g (2 m cable), 120g (5 m cable)ConnectionCable ModelØ3.5 mm, 3-core, 0.2 mm², vinyl cabtyre cable	Extraneous	Light Immunity	Sunlight: 10,000 lux maximum, Incandescent lamp: 5,000 lux maximum (at receiver)				
Storage Temperature	Operating Te	emperature	-10 to +55°C (no freezing)				
Storage Humidity Insulation Resistance Between live part and mounting bracket: 20 MΩ minimum (500V DC megger) Cable models: 1,000V AC, 50/60 Hz, 1 minute (between live part and mounting bracket) Connector models when connected with connector cable: 500V AC, 50/60 Hz, 1 minute (between live part and mounting bracket) Connector models when connected with connector cable: 500V AC, 50/60 Hz, 1 minute (between live part and clamp ring) Vibration Resistance 10 to 55 Hz, amplitude 1.5 mm, 20 cycles in each of 3 axes Shock Resistance 500 m/s², 3 shocks in each of 3 axes Material Housing: PBT, Lens: PMMA, Indicator cover: PC, knob; POM Weight (approx.) Cable Model 20g Connection Cable Model Ø3.5 mm, 3-core, 0.2 mm², vinyl cabtyre cable	Operating H	umidity	35 to 85% RH (no condensation)				
Insulation ResistanceBetween live part and mounting bracket: 20 MΩ minimum (500V DC megger)Dielectric StrengthCable models: 1,000V AC, 50/60 Hz, 1 minute (between live part and mounting bracket) Connector models when connected with connector cable: 500V AC, 50/60 Hz, 1 minute (between live part and clamp ring)Vibration Resistance10 to 55 Hz, amplitude 1.5 mm, 20 cycles in each of 3 axesShock Resistance500 m/s², 3 shocks in each of 3 axesMaterialHousing: PBT, Lens: PMMA, Indicator cover: PC, knob; POMWeight (approx.)Cable Model35g (1 m cable), 55g (2 m cable), 120g (5 m cable)ConnectionCable ModelØ3.5 mm, 3-core, 0.2 mm², vinyl cabtyre cable	Storage Ten	perature	−25 to +70°C (no freezing)				
Cable models: 1,000V AC, 50/60 Hz, 1 minute (between live part and mounting bracket) Connector models when connected with connector cable: 500V AC, 50/60 Hz, 1 minute (between live part and clamp ring) Vibration Resistance 10 to 55 Hz, amplitude 1.5 mm, 20 cycles in each of 3 axes Shock Resistance 500 m/s², 3 shocks in each of 3 axes Material Housing: PBT, Lens: PMMA, Indicator cover: PC, knob; POM Weight (approx.) Cable Model 20g Connection Cable Model Ø3.5 mm, 3-core, 0.2 mm², vinyl cabtyre cable	Storage Hun	nidity	35 to 85% RH (no condensation)				
Dielectric Strength Connector models when connected with connector cable: 500V AC, 50/60 Hz, 1 minute (between live part and clamp ring) Vibration Resistance 10 to 55 Hz, amplitude 1.5 mm, 20 cycles in each of 3 axes Shock Resistance 500 m/s², 3 shocks in each of 3 axes Material Housing: PBT, Lens: PMMA, Indicator cover: PC, knob; POM Weight (approx.) Cable Model 20g Connection Cable Model Ø3.5 mm, 3-core, 0.2 mm², vinyl cabtyre cable	Insulation Re	esistance	Between live part and mounting bracket: 20 MΩ minimum (500V DC megger)				
Shock Resistance 500 m/s², 3 shocks in each of 3 axes Material Housing: PBT, Lens: PMMA, Indicator cover: PC, knob; POM Weight (approx.) Cable Model 20g Connection Cable Model Ø3.5 mm, 3-core, 0.2 mm², vinyl cabtyre cable	Dielectric Strength		Connector models when connected with connector cable: 500V AC, 50/60 Hz, 1 minute (between live part and clamp				
Material Housing: PBT, Lens: PMMA, Indicator cover: PC, knob; POM Weight (approx.) Cable Model 35g (1 m cable), 55g (2 m cable), 120g (5 m cable) Connector Model 20g Connection Cable Model Ø3.5 mm, 3-core, 0.2 mm², vinyl cabtyre cable	Vibration Resistance		10 to 55 Hz, amplitude 1.5 mm, 20 cycles in each of 3 axes				
Weight (approx.) Cable Model 35g (1 m cable), 55g (2 m cable), 120g (5 m cable) Connector Model 20g Connection Cable Model Ø3.5 mm, 3-core, 0.2 mm², vinyl cabtyre cable	Shock Resistance		500 m/s², 3 shocks in each of 3 axes				
(approx.) Connector Model 20g Connection Cable Model Ø3.5 mm, 3-core, 0.2 mm², vinyl cabtyre cable	Material	aterial Housing: PBT, Lens: PMMA, Indicator cover: PC, knob; POM					
Connection Cable Model Ø3.5 mm, 3-core, 0.2 mm², vinyl cabtyre cable	Weight	Cable Model	35g (1 m cable), 55g (2 m cable), 120	Og (5 m cable)			
Odinicalidi , , , , , , , , , , , , , , , , , ,	(approx.)	Connector Model	20g				
Method Connector Model M8 connector (4-pin)	Connection	Cable Model	ø3.5 mm, 3-core, 0.2 mm², vinyl cabt	yre cable			
	Method	Connector Model	M8 connector (4-pin)				


Note: Compliant with Class 1 of FDA regulations (21 CFR 1040.10 and 21 CFR 1040.11 according to Laser Notice No. 50).

Slit and Sensing Range (typical) [Through-beam SA1E-LT□]


Slit		Sensing Range (m)	Minimum Detectable Object Width (mm)	
Part No.	Slit Width: A	Used on receiver		
SA9Z-S12	0.5 mm	6	1.1	
SA9Z-S13	1.0 mm	10	1.6	
SA9Z-S14	2.0 mm	22	2.5	

[•] Minimum detectable object width (mm): when the object is at the intermediate point between the projector and receiver.

The slit can be pressed to snap onto the front easily.



Dimensions





Material: Stainless Steel All dimensions in mm.


Dimensions

Cable Model

- Through-beam
- Polarized Retroreflective
- Background Suppression (BGS)

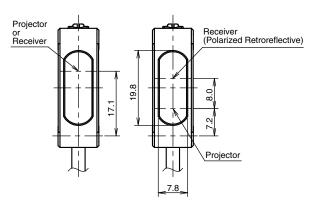


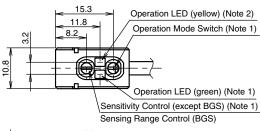


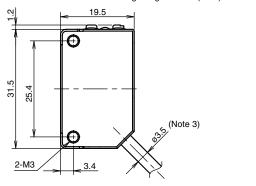


Connector Model

- Through-beam
- Polarized Retroreflective
- Background Suppression (BGS)

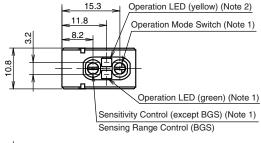

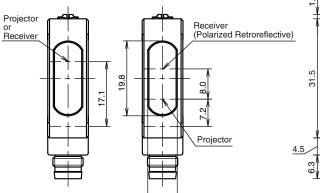

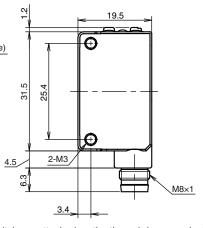




- Note 1: No stable LED, sensitivity control, and operation mode switch are attached on the through-beam projector.
- Note 2: Power ON LED (green) for through-beam projector.
- Note 3: Cable length depends on models.
- Note 4: The connector length is 18 mm when a right-angle connector cable (SA9Z-CM8K-4L*) is attached.


In the photo, the right-angle connector cable is attached.

Output Circuit & Wiring Diagram







(Connector Pin Assignment)




PNP Output



(Connector Pin Assignment)



Through-beam Type Projector




(Connector Pin Assignment)



19.5

Dimensions


Mounting Brackets

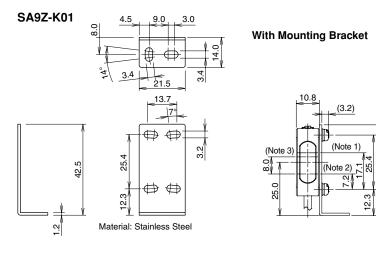


Note 1: Projector (through-beam)

Receiver (through-beam) Note 2: Projector (polarized retroreflective, background suppression)

Note 3: Receiver (polarized retroreflective)

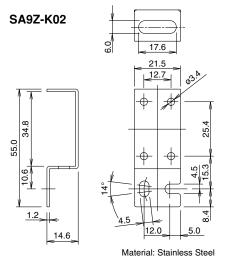

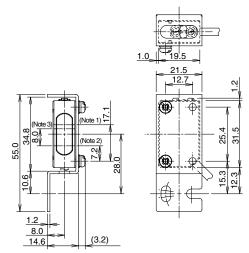


Note 1: Projector (through-beam) Receiver (through-beam)

Note 2: Projector (polarized retroreflective,

background suppression)


Note 3: Receiver (polarized retroreflective)

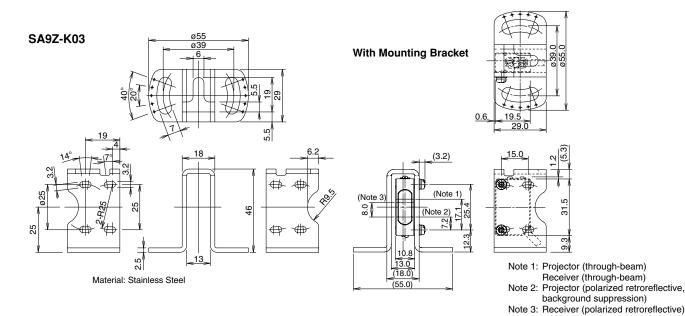

All dimensions in mm.


SA9Z-K04 With Mounting Bracket 1.6 19.5 10.8 13.4 10.8 10.8

Reflector

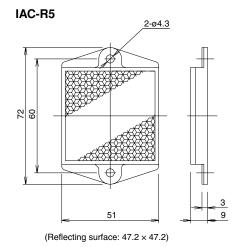


Material: Stainless Steel

IAC-R8

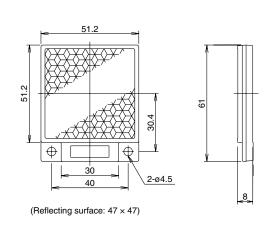


IAC-R9

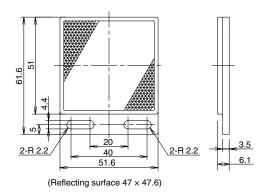


All dimensions in mm.

Dimensions

Reflector Mounting Brackets

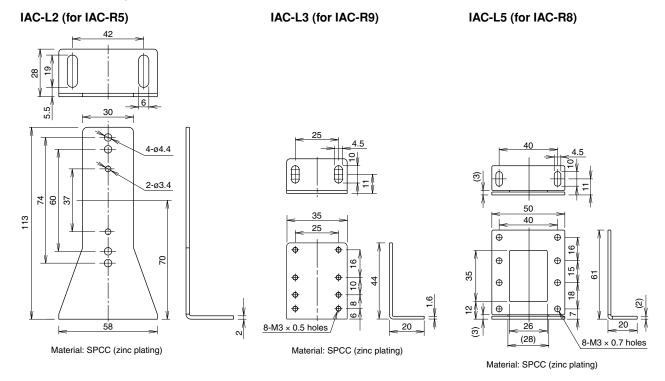


Connector Cable (connector on one end)

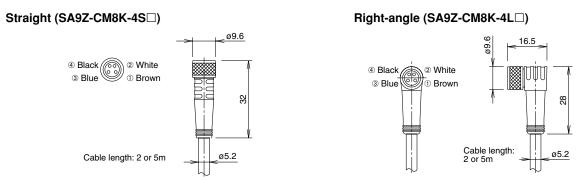

• Dielectric strength when installed on the SA1E-L: 1000V AC (between live part and mounting bracket, except between live part and tightening ring)

Air Blower Mounting Block

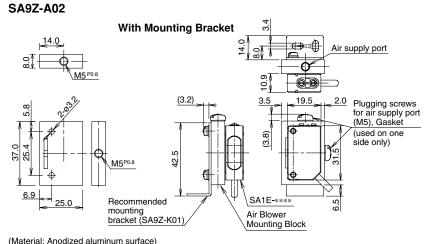



- The SA9Z-A02 air blower mounting block is supplied with two mounting screws (M3 × 20 mm sems screws), one screw for plugging the air supply port (M5 × 6 mm), and one gasket (1 mm thick) for plugging the air supply port.
- An air tube fitting can be installed to either the top or side. Tighten the fitting to a torque of 0.5 N·m maximum.
- The air tube fitting and mounting bracket are not supplied and must be ordered separately (recommended mounting bracket: SA9Z-K01).


All dimensions in mm.


Characteristics (Typical)


1. Through-beam SA1E-LT

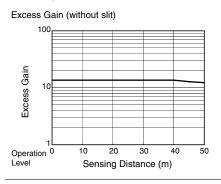

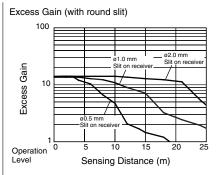

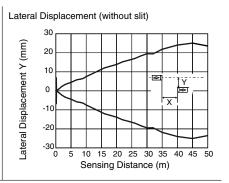


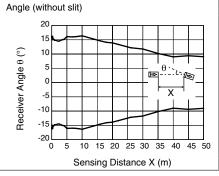


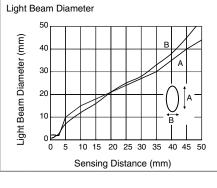


(Light beam diameter)
Sensing distance below 3 m:
Defined as 1/e² (13.5%) of the center intensity
Sensing distance over 3 m:
Reference value (visual inspection)


2. Polarized Retroreflective SA1E-LP

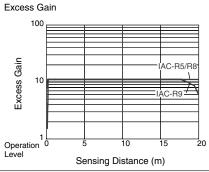

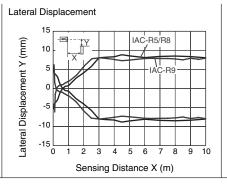

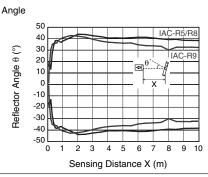


Light Beam Diameter

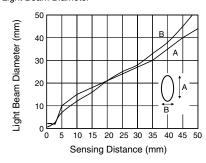

(Light beam diameter)
Sensing distance below 3 m:
Defined as 1/e² (13.5%) of the center intensity
Sensing distance over 3 m:
Reference value (visual inspection)


Characteristics (Typical)

3. Background Suppression (BGS) SA1E-LB

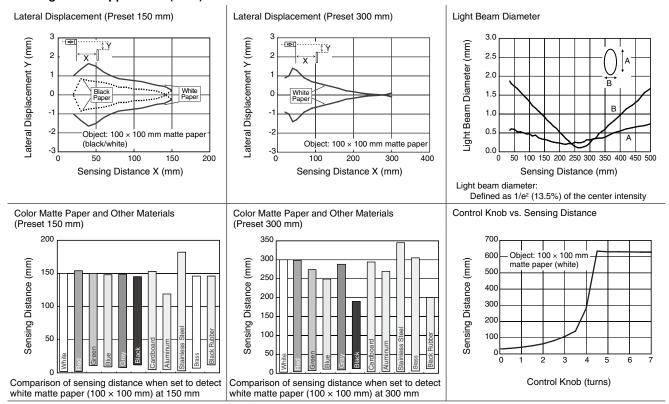

Instructions

Indicator and Output Operation (Through-beam/Polarized Retroreflective)



- The operation LED turns on (yellow) when the control output is on.
- The stable LED turns on (green) either at stable incident or stable interruption. Make sure to use the photoelectric switch after the stable operation is ensured.
- In the light ON operation, the output turns on when the receiving light intensity level is 1.0 or over as shown below.
- In the dark-ON operation, the output turns on when the receiving light intensity level is 1.0 or less as shown below.

Receiving Light Intensity Level		Light Receiving	Stable LED	Operation LED (yellow)/ Control Output		
intensity	Level	Status	(green)	Light ON	Dark ON	
	1.3 and over	Stable Incident	ON	ON	OFF	
Operation	1.0	Unstable Incident	OFF	ON	OH	
Level	1.0	Unstable Interruption	OFF	OFF	ON	
	0.7 and below	Stable Interruption	ON	OFF	ON	

Optical Axis Alignment (Light ON)

Through-beam

Fasten the receiver temporarily. Place the projector to face the receiver. Move the projector up, down, right and left to find the range where the operation LED turns on. Fasten the projector in the middle of the range. Next, move the receiver up, down, right and left in the same manner and fasten in the middle of the range where the operation LED turns on. Make sure that stable LED turns on at stable incident and stable interruption.

Polarized Retroreflective

Install the reflector perpendicularly to the optical axis. Move the SA1E-L photoelectric switch up, down, right and left to find the range where the operation LED turns on. Fasten the switch in the middle of the range. Make sure that stable LED turns on at stable incident and stable interruption. When installing the reflector near the photoelectric switch, adjust the angle and positions of photoelectric switch and reflector so that sensing objects can be detected reliably.

Background Suppression (BGS)

Place the SA1E-L photoelectric switch where the switch can detect the object. Move the switch up, down, right and left to find the range where the operation LED tuns on. Fasten the switch in the middle of the range. Make sure that stable LED turns on at stable incident and stable interruption.

Sensitivity Adjustment (Through-beam/Polarized Retroreflective)

Referring to the table below, adjust the sensitivity of the SA1E-L photoelectric switch when necessary, in such cases as the through-beam is used to detect small or translucent objects. The table explains the status of operation LED when the operation mode is set to light ON.

mode is set to light ON.					
Step	Photoelectric Switch Status	Sensitivity Control	Adjusting Procedure		
1	Receiving light Through-beam, polarized retroreflective: No object detected	Min. Max.	Turn the control counter- clockwise to the mini- mum. Then turn clockwise until the operation LED turns on (turns off with dark ON type) (point A).		
2	Light is interrupted • Through-beam, polarized retroreflective: Object detected	A B B Max.	At interruption status, turn the control clockwise from point A, until the operation LED turns on (turns off with dark ON type) (point B). If the operation LED does not turn on (turn off with dark ON type) even though the control has reached the maximum, set the maximum position as point B.		
3	_	Min. Max.	Set the middle point between point A and B as point C.		

- After adjusting the sensitivity, make sure that stable LED turns on at stable incident and stable interruption. For detecting objects too small to turn on the stable LED, use an optional slit.
- Sensitivity is set to the maximum at the factory before shipment. When adjusting the sensitivity, use the screwdriver supplied with the SA1E-L photoelectric switch to turn the control as shown below, to a torque of 0.05 N·m maximum.

Adjustment of Sensing Range for Background Suppression (BGS)


• When adjusting the sensing range, follow the instruction below.

Step	Distance Control	Adjusting Procedure	
1		Install the photoelectric switch and the object firmly. Turn the control counterclockwise until the operation LED turns off (turns on with dark ON type). From this point, turn the control clockwise until the operation LED turns on (turns off with dark ON type) (point A).	
2	B T A	Remove the object, and confirm that the operation LED turns off (turns on with dark ON type). Turn the control clockwise until the operation LED turns on (detecting the background) (turns off with dark ON type) (point B) (Note 1)	
3	B T A	Set the middle point between point A and B as point C. (Note 2)	

Note 1: When the background is far off and not detected, turn the control 360°, and set the point as point C.

Note 2: Because the control is multi-turn, it may take more than one turn to move from point A to point B.

Turning the control clockwise lengthens the sensing distance.



Power Supply and Wiring

- Do not use the SA1E-L photoelectric switch in the transient status immediately after turning on the power (approx. 100 ms). When the load and switch use different power supplies, make sure to power up the switch first.
- Use a power supply with little noise and inrush current, and use the photoelectric switch within the rated voltage range. Make sure that the ripple is within the allowable limit. Do not apply AC voltage, otherwise the switch may blow out or burn.
- When using a switching power supply, make sure to ground the FG (frame ground) terminal, otherwise high-frequency noise may affect the photoelectric switch.
- Turn power off before inserting/removing the connector on photoelectric switch. Make sure that excessive mechanical force is not applied to the connector. Connect the connector cable to a tightening torque of 0.5 N·m maximum.
- To ensure the degree of protection, use the applicable connector cable for the connector type. Connector cables are ordered separately (see page 5).
- Avoid parallel wiring with high-voltage or power lines in the same conduit, otherwise noise may cause malfunction and damage.
 When wiring is long, use a separate conduit for wiring.
- Use a cable of 0.3 mm² minimum core wires, then the cable can be extended up to 100 m.

Installation

Installing the Photoelectric Switch

- Do not install the SA1E-L photoelectric switches in an area where the switches are subject to the following conditions, otherwise malfunction and damage may be caused.
- * Inductive devices or heat source
- * Extreme vibration or shock
- * Large amount of dust
- * Toxic gases
- * Water, oil, chemicals
- * Outdoors
- Make sure to prevent sunlight, fluorescent light, and especially the fluorescent light of inverters from entering the receiver of the photoelectric switch directly. Keep the through-beam type receiver away from intense extraneous light.
- Interference prevention allows two SA1E-L switches to be mounted in close proximity. However, the through-beam model is not equipped with interference prevention. Maintain appropriate distance between the switches referring to the lateral displacement characteristics.
- Because the SA1E-L photoelectric switches are IP67 waterproof, the SA1E-L can be exposed to water. However, wipe water drops and smears from the lens and slit using a soft cloth to make sure of the best detecting performance.
- Acrylic resin is used for optical elements. Do not use ammonia or caustic soda for cleaning, otherwise optical elements will be dissolved. To remove dust and moisture build-up, use soft dry cloth.
- Tighten the mounting screws (M3) to a torque of 0.4 to 0.5 N·m. Do not tighten the mounting screws excessively or hit the switch with a hammer, otherwise the protection degree cannot be maintained.

Installing the Reflector


- Use M4 mounting screws for the IAC-R5 and IAC-R8 reflectors.
 Tighten the mounting screws to a tightening torque of 0.4 to 0.5
 N·m maximum. Do not tighten the mounting screws excessively, otherwise the screw holes of the reflector will be damaged.
- While optional reflector mounting bracket IAC-L2 is not supplied with mounting screws or nuts, the IAC-L3 and IAC-L5 are supplied with mounting screws for mounting the reflector on the bracket

Installing the air blower mounting block SA9Z-A02

- When installing the SA9Z-A02 on the SA1E-L photoelectric switch, use the attached M3 mounting screws and tighten to a torque of 0.4 to 0.5 N·m maximum.
- Mounting bracket is not supplied with SA9Z-A02 and must be ordered separately. SA9Z-K01 mounting bracket can be used with SA9Z-A02. When installing the SA9Z-K01 mounting bracket on SA9Z-A02 air blower mounting block, use the M3 × 20 mounting screws supplied with SA9Z-A02. Do not use the mounting screws (M3 × 12) supplied with SA9Z-K01.
- The SA9Z-A02 cannot be used with the through-beam slits (SA9Z-S12, SA9Z-S13, and SA9Z-S14).
- The air tube fitting (M5) can be installed to either the top or side. The air tube is not supplied.
- Close the unused port using the supplied air supply port plugging screw (M5 × 6) and gasket to a tightening torque of 1 to 2 N·m maximum. The recommended air pressure is 0.1 to 0.3 MPa.

Installing the background suppression (BGS) type

 This sensor can detect objects correctly when the sensor head is installed perpendicular to the moving object. Install the sensor head as shown below to minimize sensing errors.

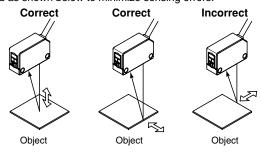

- If the SA1E-L is used in a place subject to large variations in the ambient temperature, the characteristics may change depending on the target object. Be sure to check the operation under the actual operating conditions.
- Polarized retroreflective: when the sensing objects have mirror surface, the reflected light from the mirror surface might cause false detection. Make sure that the reflected light does not enter the receiver.

Using a laser product

- The SA1E-L photoelectric switches radiate a visible laser beam.
 Do not look directly at laser beam. Also, do not look at the laser beam reflected by a mirror surface.
- IEC 60825-1 (Safety of laser products) sets safety standards of laser products. The SA1E-L photoelectric switches are classified as Class 1 product.
- The SA1E-L photoelectric switches comply with 21 CFR 1040.10 and 21 CFR 1040.11 according to Laser Notice No. 50, dated June 24, 2007, issued by the CDRH (Center for Devices and Radiological Health) under the FDA (Food and Drug Administration).

Label

According to IEC 60825-1 and FDA regulations, the SA1E-L has the warning and certification/identification labels as shown below. When installing the SA1E-L on a system/equipment used in the United States, ensure that the labels are attached to the SA1E-L.



SA1E Miniature LED Photoelectric Switches (Built-in Amplifier)





Seven sensing methods available.



All dimensions in mm.

Part No. Development



I		Т	Through-beam (Infrared LED)			
		TA	Through-beam (Red LED)			
		Р	Polarized Retroreflective (Red LED)			
I		D	Diffuse-reflective (Infrared LED)			
I	1	Ν	Small-beam Reflective (Red LED)			
I		В	Background Suppression (BGS) (Red LED)			
		G	Convergent Reflective (Infrared LED)			
		Х	Coaxial Polarized Retroreflective (Transparent Object Sensing) (Red LED)			

2	N	NPN output
	Р	PNP output
3	1	Light ON
	2	Dark ON

4	Blank	w/ Sensitivity Adjustment
	-NA	w/o Sensitivity Adjustment

5	Blank	1 m cable
	-2M	2 m cable
	-5M	5 m cable
	С	Connector

Model	Through-beam SA1E-T	Polarized Retroreflective SA1E-P	Diffuse-reflective SA1E-D	Small-beam Reflective SA1E-N
Detectable Object	Opaque	Opaque	Opaque/transparent	Opaque/transparent
Sensing Range	10 m	2.5 m	700 mm	50 to 150 mm
Current Draw	Projector: 15 mA Receiver: 20 mA	30 mA	30 mA	30 mA
Response Time	1 ms	1 ms	1 ms	1 ms

Model	Background Suppression (BGS) SA1E-B	Convergent Reflective SA1E-G	Coaxial Polarized Retroreflective SA1E-X
Detectable Object	Opaque	Opaque/transparent	Opaque/transparent/ mirror-like objects
Sensing Range	20 to 200 mm	5 to 35 mm	2 m
Current Draw	30 mA	30 mA	20 mA
Response Time	1 ms	1 ms	0.5 ms

- For details, see Cat No. EP1155-0 and EP1333-0.
- Package quantity: 1

Specifications and other descriptions in this catalog are subject to change without notice.



IDEC CORPORATION

7-31, Nishi-Miyahara 1-Chome, Yodogawa-ku, Osaka 532-8550, Japan Tel: +81-6-6398-2571, Fax: +81-6-6392-9731

IDEC CORPORATION (USA) Tel: +1-408-747-0550 / (800) 262-IDEC (4332) E-mail: opencontact@idec.com **IDEC CANADA LIMITED**

E-mail: sales@ca.idec.com IDEC AUSTRALIA PTY. LTD.

Tel: +61-3-8523-5900, Toll Free: 1800-68-4332 E-mail: sales@au.idec.com

IDEC ELECTRONICS LIMITED
Tel: +44-1256-321000 E-mail: sales@uk.idec.com IDEC ELEKTROTECHNIK GmbH Tel: +49-40-25 30 54 - 0 E-mail: service@idec.de Tel: +1-905-890-8561, Toll Free: (800) 262-IDEC (4332) IDEC (SHANGHAI) CORPORATION IDEC TAIWAN CORPORATION IDEC (BEIJING) CORPORATION

E-mail: marketing@idec.co.ip

IDEC (SHENZHEN) CORPORATION Tel: +86-755-8356-2977 IDEC IZUMI (H.K.) CO., LTD.
Tel: +852-2803-8989 E-mail: info@hk.idec.com

www.idec.com

X-ON Electronics

Largest Supplier of Electrical and Electronic Components

Click to view similar products for Photoelectric Sensors category:

Click to view products by Idec manufacturer:

Other Similar products are found below:

E3JM-DS70R4T-US E3L2DC4 E3RA-DN12 2M E3RA-DP12 2M E3S5LE4S E3S-AD38 E3S-CR11 5M E3SCT11D5M E3SCT11M1J03M E3T-SL14R E3T-SL24 5M E3T-ST12R E3X-CN02 E3X-CN11 5M E3X-CN21 10M E3ZM-B66 E3ZM-CL81H 2M E3Z-T62 2M NJL5303R-TE1 PB10CNT15PO PD60CNX20BP CX-491-P-J CX-491-Z XUM2BKCNL2T XUM2BKCNL2T XUM2BNANL2R Y92E-ES30M Y92E-GS08SS ZXTDS04T ZX-XC4A 4M E3E23Y2US E3JM-DS70S4-US E3RA-RN11 2M E3S5LE42M E3S-LS20XB4 5M E3T-FD14R E3T-SL21 5M E3T-SL21M E3T-ST11R E3T-ST12 5M E3X-DA41-S-M1J 0.3M E3X-DAB6 E3X-DAG8 E3ZM-B86 E3ZM-CR81 2M E3ZM-CR86 E3Z-T61A-L 2M ZX-XGC2R ZX-XB1A