



Series Datasheet – MK11(P) Reed Sensors

www.standexmeder.com

MK11(P) Series Reed Sensors

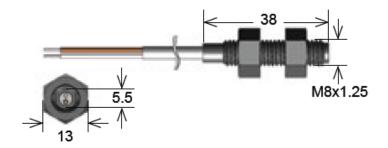

- Features: Cylindrical Reed Sensor, Choice of Cable Termination & Lengths available, Various Case Sizes
- Applications: Door & Window Contacts, Safety Control, Position Sensing
- Markets: Appliance, Industrial, Security & Others

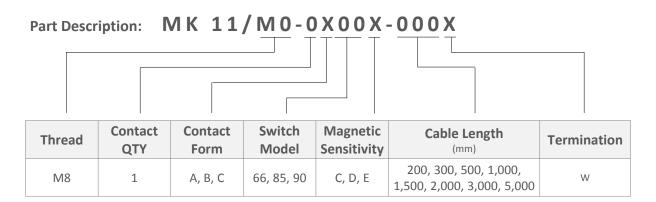

Customer Options	Switch Model			Lleit	
Contact Data	66	85	90	Unit	
Rated Power (max.) Any DC combination of V&A not to exceed their individual max.'s	10	100	10	W	
Switching Voltage (max.) DC or peak AC	200	1000	175	V	
Switching Current (max.) DC or peak AC	0.5	1	0.5	А	
Carry Current (max.) DC or peak AC	1.0	2.5	1.0	А	
Contact Resistance (max.) @ 0.5V & 50mA	150	150	150	mOhm	
Breakdown Voltage (min.) According to EN60255-5	0.25	1.5	0.2	kVDC	
Operating Time (max.) Incl. Bounce; Measured with w/ Nominal Voltage	0.7	1.1	0.7	ms	
Release Time (max.) Measured with no Coil Excitation	0.05	0.05	1.5	ms	
Insulation Resistance (typ.) Rh<45%, 100V Test Voltage	10 ¹⁰	10 ¹⁰	10 ⁹	Ohm	
Capacitance (typ.) @ 10kHz across open Switch	0.3	0.5	1.5	pF	



USA: +1.866.782.6339 Europe: +49.7731.8399.0 Asia: +86.21.37820625 | salesusa@standexmeder.com | info@standexmeder.com | salesasia@standexmeder.com



Series Datasheet - MK11(P) Reed Sensors

www.standexmeder.com

Housing and Cable Specifications				
Housing Material	Crastin			
Case Color	Black			
Sealing Compound	Polyurethan			
Cable Typ	Flat Cable/ Round Cable			
Cable Material	PVC			
Cross Section (mm²)	2 x 0.14 - 0.25 / 3 x 0.14			

Environmental Data	Unit		
Shock Resistance (max.) 1/2 sine wave duration 11ms	50	g	
Vibration Resistance (max.)	20	g	
Operating Temperature Cable not moved	-30 to 70	°C	
Operating Temperature Cable moved	-5 to 70	°C	
Storage Temperature	-30 to 70	°C	


Glossary Contact Form				
Form A	NO = Normally Open Contacts SPST = Single Pole Single Throw			
Form B NC = Normally Closed Contacts SPST = Single Pole Single Throw				
Form C	Changeover SPDT = Single Pole Double Throw			

Glossary Magnetic Sensitivity							
Sens.	А	В	С	D	Е	F	G
AT	05-10	10-15	15-20	20-25	25-30	30-35	35-40








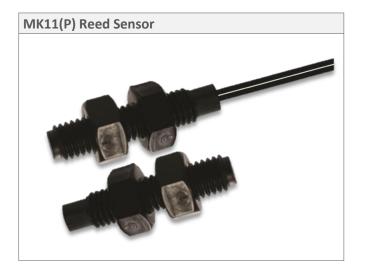

Handling & Assembly Instructions

- Max torque of nuts 1Nm
- Cable bending-radius is diameter x 15
- Min. bending distance to housing is 5mm
- > Decrease switching distance by mounting on iron
- Do not use magnetically inductive screws
- Series resistor recommended for > 5m cable length

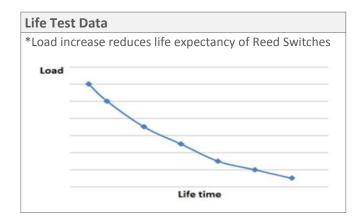

X-ON Electronics

Largest Supplier of Electrical and Electronic Components

Click to view similar products for Standexmeder manufacturer:

Other Similar products are found below:

MK21P-KIT LS04-2A66-PP-500W HE12-1A83 HM24-1A69-300 MK18-B-500W SHV12-1A85-78L4K HE06-1B83-150 MK24-B-3-OE MK21M-1A66B-500W SIL05-1A72-71QHR H24-1B83 HE05-1A83-150 BE12-2A85-BV420 LI05-1A85 KSK-1A80-1020 BE24-1A66-M KT12-1A-BV88589 HM24-1A69-20-6 HM12-1A83-06-UL MK04-1A66C-500W DIP05-1A72-11L KT12-1A-40L-THT NDFEB 8X15MM MK04-1A66B-500W MK06-4-C NDFEB 10X5X1.9MM H12-1B83 MK06-4-B LS01-1A66-PP-500W ALNICO500; 5X20MM MS05-1A87-75D HM24-1B69-06 SIL05-1A31-71L DIP12-2A72-21L MK06-8-H MS05-1A87-75DHR DIP24-1C90-51D GR560-1520 M11/M8 LS02-1A66-PA-500W FPS-B HE24-1A83 SHV12-1A85-78L3K KSK-1C90F-2025 HE24-1A69-03 LI24-1A85 M13 NDFEB 6X10MM LS02-1A66-PP-500W HE06-1A16