


# Current sensor for PW Board mounting GCBC100-2A Data sheet

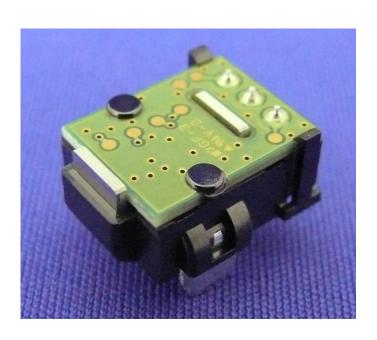

Rev.1.4 e EC 2015.06.02

# ALPS GREEN DEVICES CO., LTD.

		1	
ev1 4 e FC	2.lune 2015	Page:1/16	ALPS GREEN DEVICES COLLED



# **Table of contents**

1.	In	troduction	3
2.	Fe	eatures and Advantages	3
3.	Pr	rinciple	3
4.	ΑĮ	pplications	3
5.	В	lock Diagram and Typical Application	4
-	5.1. 5.2.		
6.	Di	imensions and Terminal Designation	7
7.	0	perating Characteristics	8
		Recommended Operating Condition  Electrical Characteristics (No Load, Vdd=5.0V, Ta=25°C)  Electrical Characteristics (RL=10kΩ, Vdd=5.0V, Ta=25°C)  Start-up timing	8 8 9 0 0
8.	CI	haracteristic Definitions1	2
9.	CI	haracteristic Data1	4
10.		Recommended Soldering Conditions 1	5
	0.1 0.2		
11.		Referential Land Pattern 1	5
12		Extras1	6

 $Attention: Modifications \ on \ specification, \ size, \ etc., \ may \ be \ carried \ out \ for \ improvement \ without \ notice.$ 



Duadinat Nama	Current Concer	Dort No.	CCDC400 0A
Product Name	Current Sensor	Part No.	GCBC100-2A

#### 1. Introduction

Current sensor GCBC series is for use on the electronic measurement of DC, AC, or pulsed currents with no contact.

# 2. Features and Advantages

- Coreless, small and lightweight(3g) design with high sensitivity magneto-resistive(MR) elements.
- Low primary-conductor resistance: 60μΩ.
- Good linearity: ±0.5%F.S.
- +5V single power supply.
- Operating temperature: -40°C~+105°C.
- DC and AC current measurement with quick response.

## 3. Principle

Current sensor detects the magnetic induction generated by the primary current to be measured. In the module, MR element with conditioning IC is located on the bus bar (path of the primary current).

The magnetic field control board is arranged around bus bar and MR element so that module output with high sensitivity can be made. On the other hand, the output error by outer magnetic field, which has no relationship to the magnetic induction of primary current, is decreased.

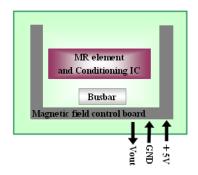


Fig.3-1 Principle of measurement




Fig.3-2 The magnetic induction generated by the primary current (simulation)

## 4. Applications

Motor drivers and general-purpose inverters, PV Inverter systems, Server power supplies, Packaged air-conditioning units, NC machine tools and other industrial and etc...

Rev14	e FC	2 June 2015	Page:3/16	ALPS GREEN DEVICES CO., LTD.



# 5. Block Diagram and Typical Application

# 5.1. Block Diagram

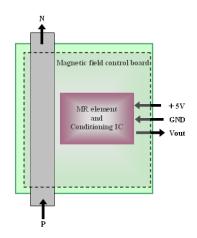


Fig.5-1 Block Diagram of the module

# 5.2. Typical Application

Refer to chapter 7.3 for the recommended operating condition of the load.

# (1) Basic connection

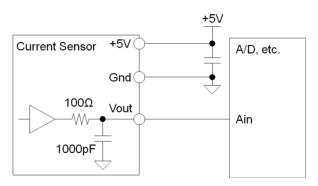


Fig.5-2 Basic connection

Rev14 e FC	2.lune 2015	Page:4/16	ALPS GREEN DEVICES COLLED

<sup>\*</sup>Current sensor has a LPF with coefficients described in above figure.

<sup>\*</sup>Refer electrical characteristics to chapter 7.4, if RL can be regarded as no-load.



## (2) 3.3V input for A/D

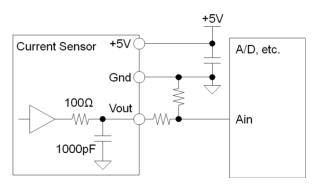


Fig.5-3 3.3V input for A/D

\*Use step down resistance to divide output voltage of the current sensor, if input voltage of A/D is 3.3V.

## (3) External filter circuit

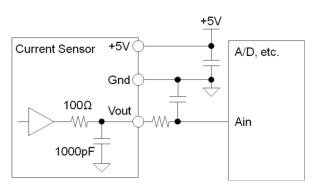


Fig.5-4 External filter circuit

- \*Mount a LPF, if necessary.
- \*Note that Two-stage LPF configuration due to connect an externally LPF, since a current sensor has a built-in LPF.

# (4) External filter circuit (in multiple)

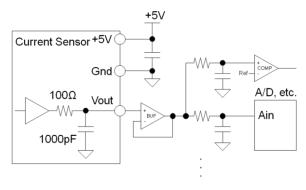


Fig.5-5 External filter circuit(in multiple)

Rev1.4 e EC	2 June. 2015	Page:5/16	ALPS GREEN DEVICES CO., LTD.
-------------	--------------	-----------	------------------------------

<sup>\*</sup>Mount an op-amp buffer, if necessary.



#### (5) Output treatment for the unknown state

Start up time is necessary for this product. During that time, output signal becomes Hi-Z. If you want to fix the output voltage during that timing, please see below as your reference.

#### • Pull-up

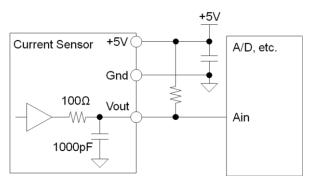


Fig.5-6 Pull-up

- \*Fix the potential to 5V in the period of the Hi-Z, if it is necessary to keep +5V during start-up or low voltage detection as an output signal.
- \*Refer to chapter 7.6 regarding start-up timing.
- \*Note that output load RL of the current sensor is not less than  $10k\Omega$ . Voltage Vout of the output is the resistance divider ratio of the  $100\Omega$  of built-in filter, if connect a pull-up resistor. Therefore, the use of precision resistors, such as 1% so that the error variation of the resistance partial pressure is not increased.

#### • Pull-down

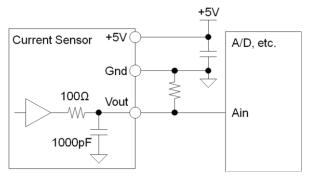


Fig.5-7 Pull-down


- \*Fix the potential to 0V in the period of the Hi-Z, if it is necessary to keep 0V during start-up or low voltage detection as an output signal.
- \*Refer to chapter 7.6 regarding start-up timing.
- \*Note that output load RL of the current sensor is not less than  $10k\Omega$ . Voltage Vout of the output is the resistance divider ratio of the  $100\Omega$  of built-in filter, if connect a pull-up resistor. Therefore, the use of precision resistors, such as 1% so that the error variation of the resistance partial pressure is not increased.
- \*Refer electrical characteristics to chapter 7.5, if RL can be regarded as  $10k\Omega$ .

Rev1 4 e FC	2 June 2015	Page:6/16	ALPS GREEN DEVICES CO., LTD.



Product Name	Current Sensor	Part No.	GCBC100-2A		

# 6. Dimensions and Terminal Designation

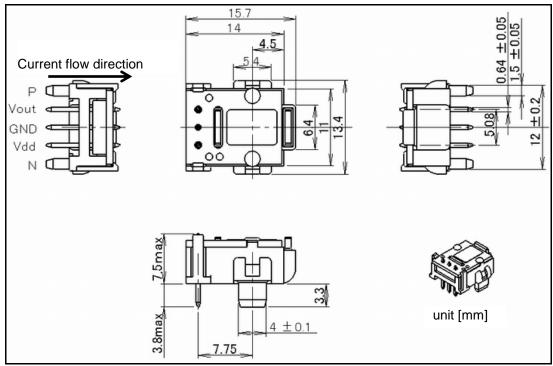

Attention: Sensor size may be changed.

Fig.6-1 Dimensions

Table6-1 Terminal list table

No.	Name	Description			
1	Vout	Signal Output			
2	GND	Ground			
3	VDD	+5V Power Supply			
4	N	Primary Current terminal (-)			
5	Р	Primary Current terminal (+)			

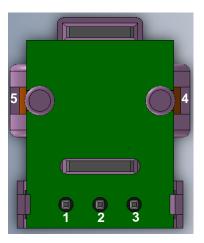


Fig.6-2 Pin assignment

Rev1.4 e EC	2 June. 2015	Page:7/16	ALPS GREEN DEVICES CO., LTD.



Duadinat Nama	Current Concer	Dort No.	CCDC400 0A
Product Name	Current Sensor	Part No.	GCBC100-2A

# 7. Operating Characteristics

# 7.1. Absolute Maximum Ratings

No	Parameter	Symbol	Min	Тур	Max	Unit	Note
1	Supply Voltage	Vdd	-0.3		5.5	V	Vdd pin
	Output Current	lout	-1.1		1.1	mΑ	Vout pin, continuously
2	(VOUTpin)	lout	-40		40	mA	Vout pin, pulse width 1µs, Period 1kHz
3	Storage temperature	Ts	-40		105	°C	T OHOU THEIL
4	Storage ambient magnetic field	Bs	-8		8	mT	
5	Maximum current (over current)	Ipoc	-110		110	Α	
6	Maximum continuous current	Irmcnt	-50		50	А	

# 7.2. Operating Condition

No	Parameter	Symbol	Min	Тур	Max	Unit	Note
1	Supply Voltage	Vdd	4.85	5.00	5.15	٧	±3%(5.0V±0.15V)
2	Primary Current Measuring Range	lr	-100		100	А	DC±100A
3	Operating Temperature	Та	-40		105	°C	

# 7.3. Recommended Operating Condition

N	Parameter	Symbol	Min	Тур	Max	Unit	Note
1	Output Current	lout	-0.5		0.5	mA	VOUT pin
2	Load capacity	CL			100	pF	VOUT pin

# 7.4. Electrical Characteristics (No Load, Vdd=5.0V, Ta=25°C)

No	Parameter	Symbol	Min	Тур	Max	Unit	Note
1	Offset Voltage (*1)	Vof		2.500		V	Vdd×1/2
2	Offset Thermal Drift	TcVof		±0.3		mV/°C	-40~+105°C
3	Sensitivity (*2)	Vo		20.0		mV/A	
4	Sensitivity Temperature Drift	TcVo		±0.02		%/°C	-40~+105°C
5	Linearity	e∟		±0.2		%FS	FS=Full Scale
6	Response Time	tr		1		μs	Input Current : di/dt=100A/µs, 80%Response
7	Current Consumption	Iddmax			18	mA	
8	Isolation Voltage	Vins	1500			٧	AC 50/60Hz,60s Sensor Unit
9	Insulation Resistance	Rins	500			ΜΩ	DC500V Signal Terminal Batch With Bus bar
10	Hysteresis Error of Vof (*3)	Voh		±3		mV	Primary Current Measuring Range
11	Primary Conductor Resistance (*3)	R <sub>1</sub>		60		μΩ	

Rev1 4 e FC	2 June 2015	Page:8/16	ALPS GREEN DEVICES CO., LTD.



Product Name	Current Sensor	Part No.	GCBC100-2A

# 7.5. Electrical Characteristics (RL=10kΩ, Vdd=5.0V, Ta=25°C)

No	Parameter	Symbol	Min	Тур	Max	Unit	Note
1	Offset Voltage (*1, *3)	Vof		2.475		V	Vdd=+5.00V
3	Sensitivity (*2, *3)	Vo		19.8		mV/A	

Note: Only characteristics No.1 and 3 are different from No-load.

- \*1 Offset voltage will change in ratiometric to supply voltage.
- \*2 Sensitivity does not change in the ratiometric to the supply voltage.
- \*3 Reference only.

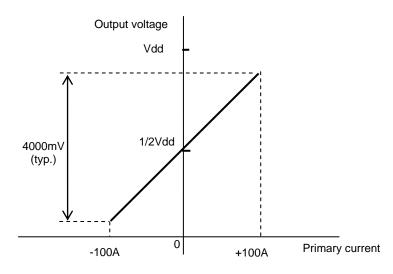


Fig.7-1 Current vs. output voltage

Rev1.4 e EC 2 Ju	ine. 2015	Page:9/16	ALPS GREEN DEVICES CO., LTD.



Duadinat Nama	Current Concer	Dort No.	CCDC400 0A
Product Name	Current Sensor	Part No.	GCBC100-2A

## 7.6. Start-up timing

#### 7.6.1. Start-up

This current sensor has a conditioning IC.

Conditioning IC will start the start up sequence under operation voltage after power supply is turned on. The transition to the normal state through the start-up time, Vout output will output a valid voltage.

#### 7.6.2. Low voltage detection

If the supply voltage drops to the operation voltage by instantaneous power failure, output signal will be stopped and become a Hi-Z by low voltage detention.

To returns from the instantaneous power failure state, conditioning IC will restart the operation with operation voltage. Transition to the normal state through the start-up time, Vout output will output a valid voltage. During transition time to the normal operation, Vout signal has some variation (flapping) as an output signal, since closed loop of magnetic equilibrium expression is controlled by feedback to be equilibrium.

Start up timing

No	Parameter	Symbol	Min	Тур	Max	Unit	Note
1	Operation start voltage	Vopu	4.05	4.4	4.75	V	
2	Operation stop voltage	Vopl	3	3.5	4.5	V	
3	Start-up time	Tstup	1		30	ms	

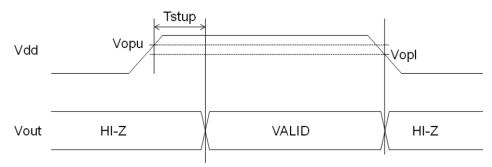


Fig.7-2 Start up timing

Rev1 4 e FC	2 June 2015	Page:10/16	ALPS GREEN DEVICES CO., LTD.



Product Name	Current Sensor	Part No.	GCBC100-2A

# 7.7. Influence from the ambient magnetic field

This current sensor uses a magnetic sensor for a current detecting. It is influenced by ambient magnetic field. Reference information to minimize the influence from the ambient magnetic are described below.

- The transformer and the inductor generate the leakage flux, It is affected by the accuracy of the current sensor by the leakage flux. It especially most affected to the magnetic flux of the X-axis direction. Please decide component location after your evaluation.
- If the current path running parallel in close to the current sensor, The accuracy of the current sensor is affected by magnetic flux from the another current path. It especially most affected to the magnetic flux of the Y-axis direction. Please decide PCB pattern design after your evaluation.

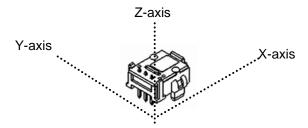


Fig.7-3 Direction of the magnetic flux

 $Attention: Modifications \ on \ specification, \ size, \ etc., \ may \ be \ carried \ out \ for \ improvement \ without \ notice.$ 

Rev1 4 e FC	2 June 2015	Page:11/16	ALPS GREEN DEVICES CO., LTD.



Product Name	Current Sensor	Part No.	GCBC100-2A

#### 8. Characteristic Definitions

The contents of the main characteristics are shown below. Standard conditions and the standard state in each item are defined below.

- Standard condition: Ambient temperature 25°C
- The state of the standard: Supply voltage (DC+5.00V) with No Load.

# (1) Offset Voltage

The output voltage when the primary current is 0A.

#### (2) Offset Thermal Drift

Change of the offset voltage within the range of the operating temperature. The value is the amount of the change per 1 degree calculated with the output at 25 degrees as the reference.

#### (3) Sensitivity

The slope of the estimated output. The least squares method from the output voltages for the primary current within rating is used.

# (4) Sensitivity Temperature Drift

Change of the gain within the operating temperature range. The value is the ratio of the change per 1 degree calculated with the gain at 25 degrees as the reference.

### (5) Linearity

The error of the output voltage between measured and estimated. The least squares method from the output voltages at rated primary current, its half current, 0A(offset voltage), is used. The value is calculated using equation;

Non Linearity = { (Measured Vout - Estimated Vout) /

(Output voltage at positive maximum current of measurement current range -

Output voltage at negative maximum current of measurement current range) } x 100(%FS)

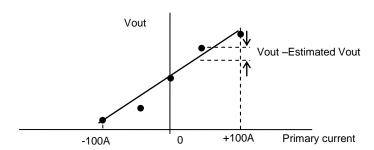


Fig.8-1 Non linearity

D. 44. FO	0.10045	D 40/40	AL DO ODEEN DEWOED OO LED
∣ Rev1 4 e FC∣	2.lune 2015	Page:12/16	ALPS GREEN DEVICES COLLID



Product Name	Current Sensor	Part No.	GCBC100-2A

#### (6) Response Time

Fig.8-2 shows the response time of output (dT) when primary current is square wave which have 100A/us rise/fall time. Response time is defined as the time between 80% change point of input wave and output.

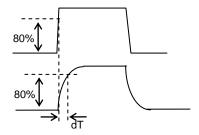


Fig.8-2 Response Time

#### (7) Current Consumption

The bus bar rating pass an electric current this current consumption measure.

#### (8) Isolation Voltage

1500V in the AC voltage, 50Hz, and 60sec are impressed to the bus bar with the control terminal batch under.

#### (9) Insulation Resistance

It measures between the control terminal batch and the bus bar with Meg ohm meter (DC500V) under the standard condition.

#### (10) Hysteresis

Absolute value of the difference of the output when the primary current is 0A between after rated positive primary current is added and negative one is added.

Rev1.4 e EC	2 June 2015	Page:13/16	ALPS GREEN DEVICES CO., LTD.



# 9. Characteristic Data

Example of typical characteristics.

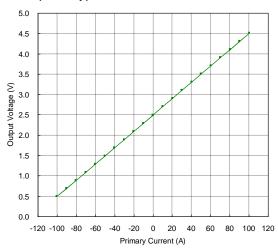


Fig.9-1 Output voltage

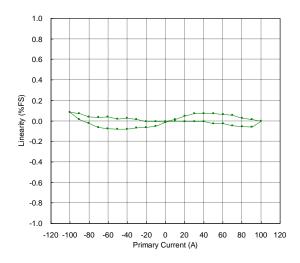


Fig.9-2 Linearity

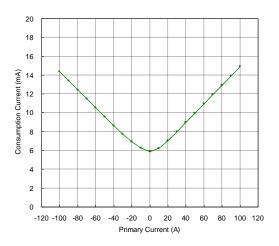


Fig.9-3 Consumption Current

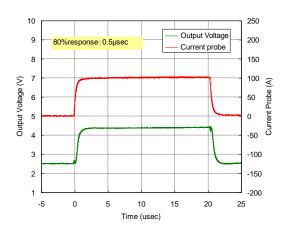


Fig.9-4 Response time

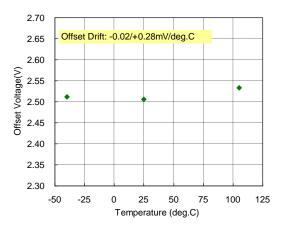


Fig.9-5 Offset voltage vs. temperature

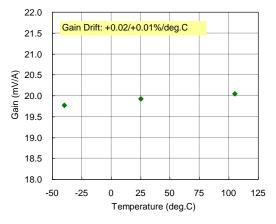


Fig.9-6 Gain vs. temperature

Rev1 4 e FC	2 June 2015	Page:14/16	ALPS GREEN DEVICES CO., LTD.



Product Name	Current Sensor	Part No.	GCBC100-2A	

# 10. Recommended Soldering Conditions

# 10.1. Manual Soldering

Temperature	350±5°C
Time	3 sec. max.
Number of Times	2 times max.

Note: The rise in heat of current sensor is influenced by the solder trowel and the mounting substrate. Please control so that the temperature of the primary current terminal does not exceed 260°C, when the above-mentioned conditions are impossible.

# 10.2. Flow Soldering

Preheating

Substrate surface temperature	120°C
Preheat time	60 sec.

Soldering

Soldering Tank Temperature	260±5°C
Soldering Portion Temperature	220°C min. 3sec. min.
Soldering Time	10sec. max.

## 11. Referential Land Pattern

Referential land pattern is shown here.

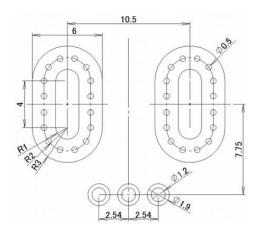


Fig.11-1 Referential Land Pattern

Unit: mm

Rev1 4 e FC	2 June 2015	Page:15/16	ALPS GREEN DEVICES CO., LTD.



Product Name	Current Sensor	Part No.	GCBC100-2A

#### 12. Extras

- All information described in this document is intended only as guidance to explain operation and how
  to use this product, and we do not warrant that this information is not infringe any intellectual property
  rights of us and any third party and other rights.
- In case of using all information described in this document, you agree that you are solely judgment and responsible for it. Therefore, you must be in any way responsible or liable for any damages, expenses or losses incurred by you or third parties arising from the use of this information.
- Absolute maximum rating is the value that should not be exceeded. When used beyond the conditions in one item, breakage or shift of the characteristics without lead to damage, may affect the reliability and life. In addition, normal operation is not guaranteed.
- Electrical characteristics may not be guaranteed, if use more than the operating conditions or the recommended operating conditions.
- The characteristics on this datasheet are the example with NO load and 10kOhm pull-down. Please note that output voltage varies depending on the load resistance.
- The primary current must be below rating. The residual output may cause when the current over rating is added.
- Do not expose the product to strong magnetic field. The residual output may cause.
- Do not use the product if it is fallen. The residual output may cause.
- Damage may occur by unusual heat when large or constant primary current is added. The amount of heat depends on the current and heat radiation.
- The control wire should be set as short as possible to avoid the outside noise.
- Before determine placement and wiring of any parts, please be fully evaluated. Magnetic flux leaking from the adjacent magnetic parts and magnetic flux generated from the pattern of the PWB which a large current flows, adversely affect the electrical characteristics.
- For the export of products which are controlled items subject to foreign and domestic export laws and regulations, you must obtain approval and/or follow the formalities of such laws and regulations.
- Products must not be used for military and/or antisocial purposes such as terrorism, and shall not be supplied to any party intending to use the products for such purposes.
- Unless provided for otherwise, the products have been designed and manufactured for application in equipment and devices which are sold to end users in the market, including audio-visual (AV) equipment, electrical home appliances, office machines, information and communication equipment, and amusement equipment. The products are not intended for use in, and must not be used for, any application for nuclear equipment, driving equipment for aerospace or any other unauthorized use.
- With the exception of the abovementioned prohibited applications, please contact an Alps sales representative and/or evaluate the total system regarding applicability for applications involving high levels of safety and liability such as medical equipment, burglar alarm equipment, disaster prevention equipment and undersea equipment. Please also incorporate fail-safe design, protection and redundant circuitry, malfunction protection, and/or fire protection into the complete system to ensure safety and reliability of the total system.
- Before using products which were not specifically designed for use in automotive applications, please contact an Alps sales representative.

Rev1 4 e FC	2 June 2015	Page:16/16	ALPS GREEN DEVICES CO., LTD.

# **X-ON Electronics**

Largest Supplier of Electrical and Electronic Components

Click to view similar products for Board Mount Current Sensors category:

Click to view products by ALPS manufacturer:

Other Similar products are found below:

CSDD1FR CSLA2ELI CSNP661-007 SCL15 10006 ACS723LLCTR-05AB-T L18P003S05 T60404-B4658-X030 LA02P021S03

LA01M041S05 LA03P054S05 CSNE151-003 SIC830AED-T1-GE3 CT-05 CT-07-100 CT-07-50 MR-1 MR-1-P5 T60404-N4646-X662

T60404-N4646-X664 DRV421RTJT CSNR161005 T60404-N4646-X651 MR-3 MR-2 MR-4 CT-06-100 CT-06-50 T60404-N4646-X410

T60404-N4646-X663 CT-06-75 CSDA1BA CSDA1BA-S CSDA1DA CSDC1DA CSDD1EC CSLA1DE CSLA1DE CSLA1DK

CSLA1EL CSLA1GE CSLA1GF CSLA2CDI CSLA2DE CSLA2DE CSLA2DH CSLA2DJ CSLA2DJI CSLA2EL CSLA2EM

CSLH3A45