80i-110s AC/DC Current Probe

The ideal current probe for Fluke ScopeMeter® Test Tools

Technical Data

Accurate current measurements become more and more critical when troubleshooting electric, electronic, and automotive circuits. The Fluke 80i-110s AC/DC Current Probe is designed to provide you with safe, high accuracy measurements for a wide range of applications.

The specially designed builtin safety features such as the 600 V rms rating at the input jaws, output cable, and BNC connector enhance work safety in industrial and commercial power distribution systems.

The probe is shielded for high noise immunity, to prevent unwanted noise when troubleshooting around noise generating devices like adjustable speed motor drives and ignition systems.

The 80i-110s accurately reproduces current waveforms as they occur. Connect the clamp to a Fluke ScopeMeter Test Tool or other waveform recording device like a Fluke Power Harmonics Analyzer, to clearly see distorted waveforms that result from non-linear loads such as computers, adjustable speed motor drives, and electronic ballasts for fluorescent lighting.

Current clamps, not specifically designed for oscilloscopes, may add distortion to the actual signal present in the system under test. This makes it difficult to get an accurate waveform measurement.

The wide measurement range from 50 milliamps to 100 Amps with a high fidelity millivolt output gives you full advantage of the high resolution oscilloscope displays. This gives you the true picture of your current situation, and allows useful measurements as low as 10 milliamps.

The broad band frequency response of the Fluke 80i–110s AC/DC Current Probe from dc to 100 kHz supports a wide range of applications where the probe can be used. The probe can be used to track down leakage currents discharging car batteries or to measure dc currents in an Uninterruptible Power


Supply (UPS), that uses a battery backup system. With its narrow jaw design.

the Fluke 80i–110s makes it easy to take measurements in tight spots.

Specifications

Electrical specifications

Current ranges: 0 to 10 A dc or ac peak 0 to 100 A dc or ac peak Output signals: 10 A range: 100 mV/A 100 A range: 10 mV/A Working voltage (clamp jaws to ground): 600 V ac rms on Installation Category II per IEC 1010-1 circuits. 300 V ac rms on Installation Category III per IEC 1010-1 circuits.

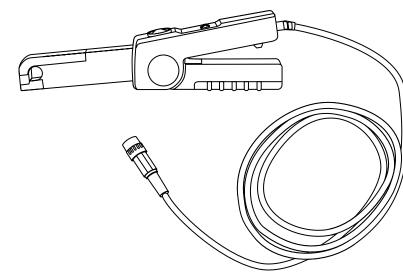



600 V ac rms on Installation Category II per IEC 1010-1 circuits. 300 V ac rms on Installation Category III per IEC 1010-1 circuits.

Basic accuracy (dc to 1 kHz)

Input current	Error (after zero check)	
dc or ac peak	100 mV/A	10 mV/A
50 mA to 10 A	< 3 % of reading + 50 mA	-
50 mA to 40 A	-	< 4 % of reading + 50 mA
40 to 80 A	_	< 12 % of reading + 50 mA
80 to 100 A	-	< 15 % of reading

Extended accuracy:

For other frequencies, refer to the appropriate input current range and add the error listed below to the "Basic Accuracy."

	Additional error	
Frequency	100 mV/A	10 mV/A
1 to 5 kHz	3 %	3 %
5 to 20 kHz	12 %	12 %
> 20 kHz	Not specified	Not specified

Phase shift, dc to 65 Hz: 10 A range < 1.5 degree 100 A range < 1 degree Input load impedance (of host instrument): > 1 M Ω in parallel with up to 100 pF Useful bandwidth (-3 dB): 0 to 100 kHz Rise or fall time: < 4 msec Output noise level: 10 mV/A typ. 480 mV pk-pk 100 mV/A typ. 2 mV str str

100 mV/A typ. 3 mV pk-pk Maximum non-destructive current:

0 to 2 kHz 140 A peak 2 to 10 kHz 110 A peak 10 to 20 kHz 70 A peak 20 to 50 kHz 30 A peak 50 to 100 kHz 20 A peak

Temperature coefficient:

2000 ppm/°C max. for temperature from 0 °C to 50 °C (32 °F to 132 °F)

All Electrical Specifications are valid at a temperature of 3 °C to 23 °C (5 °F to 73 °F)

General specifications

Dimensions:

67 x 231 x 36 mm (2.6 x 9.1 x 1.4 inches) Weight: 330 g (11.6 oz), battery included Output cable: 1.6 meters (63 inches) Maximum conductor size: 11.8 mm (.46 inch) Maximum jaw opening: 12.5 mm (.49 inch) Temperature: Operating: 0 °C to 50 °C (32 °F to 122 °F)

(32 °F to 122 °F) Non-operating: -30 °C to 70 °C (-22 °F to 158 °F)

Relative humidity (operating): 0 to 85 % (0 °C to 35 °C; 32 °F

to 95 °F)

0 to 45 % (35 °C to 50 °C; 95 °F to 122 °F)

Altitude:

Operating: 0 to 2,000 meters (0 to 6,560 feet) Non-operating: 0 to 12,000 meters (0 to 40,000 feet)

Safety specification

Designed to meet the requirements of IEC 1010 and CSA-C22.2 No. 1010.1: Installation Category II, Working Voltage 600V, Pollution Degree 2. Installation Category III, Working Voltage 300V, Pollution Degree 2.

Installation (Overvoltage) Category II refers to local level, appliances, and portable equipment.

Installation (Overvoltage) Category III refers to distribution level and fixed installation circuits inside a building electrical service entrance.

Designed to meet the requirements of UL1244, Protection Class II Double Insulation.

Battery information

Battery: 9 volt, IEC 6LR61 Consumption: 8.6 mA typical; 12 mA maximum Service life: 55 hours typical, when Alkaline IEC 6LR61 is used 40 hours minimum, when Alkaline IEC 6LR61 is used

Battery indicator (ON):

Green LED dims when battery voltage is below 6.5V **Overload indicator (OL):**

Red LED indicates that waveform or impulse is out of range

Instrument compatibility

The 80i-110s is compatible with any Fluke ScopeMeter Test Tool, Power Harmonics Analyzer, Oscilloscope, Multimeter, or other voltage measurement device that has the following features:

- BNC input connector. A BNC-to-banana adapter (order PM 9081/001 from Fluke) can also be used with standard inputs on a digital multimeter (DMM).
- Input accuracy of 2 % or better to take full advantage of the accuracy of the probe.
- Input impedance of greater than or equal to 1 MΩ in parallel with a maximum of 100 pF.
- A passband of more than four times the frequency of the waveform to be measured.

Warranty

One-year warranty

Ordering information

Model 80i-110s AC/DC Current Probe

Fluke. Keeping your world up and running.

Fluke Corporation

PO Box 9090, Everett, WA USA 98206 Fluke Europe B.V. PO Box 1186, 5602 BD

Eindhoven, The Netherlands

For more information call: In the U.S.A. [800] 443-5853 or Fax (425) 446-5116 In Europe/M-East/Africa (31 40) 2 675 200 or Fax (31 40) 2 675 222 In Canada (800)-36-FLUKE or Fax (905) 890-6866 From other countries +1 (425) 446-5500 or Fax +1 (425) 446-5116 Web access: http://www.fluke.com/

X-ON Electronics

Largest Supplier of Electrical and Electronic Components

Click to view similar products for Clamp Multimeters & Accessories category:

Click to view products by Fluke manufacturer:

Other Similar products are found below :

 FLUKE 1630-2
 ZAPDUMOD-03
 ZARKMS-01-99
 AX-3550
 AX-M266C
 BM079
 BM089
 BM162
 BM197
 KEW2210R
 FLUKE

 80I-110S
 FLUKE A3002FC
 FLUKE I200
 FLUKE I3000FLEX-24
 FLUKE I310S
 FLUKE I400
 CIE600
 TESTO 770-2
 0590
 7702
 34194A

 KEW2433R
 KEW8112
 FLUKE 772
 380976-K
 MA3110
 MA440
 MA443
 MA445
 FLUKE-374
 FLUKE-374
 CM55
 CM46
 I200

 ACD-6 PRO
 FLUKE-1630-2FC
 I410
 CM44
 CM42
 FLK-A3000 FC
 FLUKE-376 FC
 ACD-14-PRO
 MA610
 F201
 F205
 MA193 (250 MM)

 DIGIFLEX 400A 170MM
 DIGIFLEX 400A 250MM
 PAC 93
 FLUKE A3001FC
 FLUKE A3001FC