

Fluke 3000 FC Series Test Tools

Technical Data

FLUKE 3000 FC TRUE RMS

2500

Now compatible with Fluke Connect™ Mobile App

Start building tomorrow's test tool system today with the Fluke 3000 FC Digital Multimeter.

The new Fluke Connect system of test tools communicates with the new Fluke Connect mobile app on your Android™ or iOS smart device, allowing you to share live measurements, monitor readings from safe distances, and get your job done easier than ever before. The wireless digital multimeter functions as the mobile hub, displaying readings from up to three meter modules tools simultaneously from up to 20 meters away. The Fluke Connect meters also give you the flexibility to build your wireless test tool system how you want when you want.

Fluke 3000 FC Test Tools (Not compatible with Fluke CNX test tools)

- Wireless Digital Multimeter
- iFlex True-rms AC Current Clamp Meter
- True-rms AC Current Clamp Meter
- · AC Voltage Meter
- K-Type Temperature Meter
- AC/DC Current Clamp Meter Module
- 2000 A DC Current Clamp Meter
- 4-20 mA DC Current Clamp Meter
- · DC Voltage Meter
- PC Adapter

Productivity

- Communicate with your iOS (4s and later) and Android™ (4.3 and up) devices with the new Fluke Connect mobile app
- Wireless technology allows connectivity between your phone, PC, and all Fluke Connect enabled test tools
- Let your team see what you see in an instant with ShareLive™ video call
- Save money and time by taking multiple measurements simultaneously
- Isolate intermittent events or record signal fluctuations without even being there using the log function on the meters



See it. Save it. Share it. All the facts, right in the field.

Fluke Connect with ShareLive™ is the only wireless measurement system that lets you stay in contact with your entire team without leaving the field. The Fluke Connect mobile app is available for Android™ (4.3 and up) and iOS (4s and later) and works with over 20 different Fluke products—the largest suite of connected test tools in the world. And more are on the way. Go to the Fluke website to find out more.

Make the best decisions faster than ever before by viewing all temperature, mechanical, electrical and vibration measurements for each equipment asset in one place. Get started saving time and increasing your productivity.

Download the app at:







Smart phone not included with purchase.



Productivity (continued)

- · View results on your computer with the PC Adapter
- · Work with fewer interruptions by recording multiple sessions before downloading. Data is saved to a PC in .csv format (comma separated variable) file format for easy viewing at your convenience
- Capture readings at different intervals, with user-set recording intervals from one second to one hour
- · Future proof your investment by adding functionality to the 3000 FC DMM when you need it

Convenience

- · Send and communicate test data to your manager and coworkers to assess abnormal system response in seconds
- Have all asset test results at your fingertips after downloading to your PC for future asset performance tracking and reliability programs
- · See multiple measurements on one screen at one time (DMM and three meter modules, Ti200/300/400 and five meter modules)
- No more writing data down. Capture up to 65,000 sets of min/max/avg readings over single or multiple logging sessions using the recording capability. Each reading and session is time stamped

- · Avoid awkward or uncomfortable measurement positions. Set up the measurement once, step back and read it as many times as you want, when you want
- View up to 6 live readings at once on the Fluke Connect mobile app or a PC to get a complete understanding of the situation
- · Easily see backlit displays in dark or dimly lit work environments
- · Choose auto or manual ranging
- Use the optional TPak Magnetic Hanger for even more hands-free working
- · Integrated holster protects the meters, while probe holders keep accessories organized

Safety

- · Be in multiple places at once, reducing the risk of arc flash by separating yourself from hazardous measurement situations
- Fluke 3000 FC meets Measurement Category 1000 V CAT III and Category IV 600 V safety standards: AC Current Clamp Meter and AC/DC Current Clamp Meter Module 600 V CAT III; AC Voltage Meter, DC Voltage Meter, and iFlex Clamp Meters 600 V CAT IV/1000 CAT III

(RF connection time (binding time) can take up to 1 minute.)



General specifications

Fluke 3000 FC Series Wireless Multimeter

Detailed specifications (Not compatible with Fluke CNX test tools)

For all specifications: accuracy is specified for one year after calibration, at operating temperatures of 18 °C to 28 °C, with relative humidity at 0 % to 90 %. Accuracy specifications take the form of \pm ([% of Reading] + [Number of least significant digits]).

AC voltage

		Accur	acy ^{2,3,4}
Range ¹	Resolution	45 Hz to 500 Hz	500 Hz to 1 kHz
600.0 mV	0.1 mV		
6.000 V	0.001 V		
60.00 V	0.01 V	1.0 % + 3	2.0 % + 3
600.0 V	0.1 V		
1000 V	1 V		



 $^{^2}$ Crest factor of ≤ 3 at full scale up to 500 V, decreasing linearly to crest factor < 1.5 at 1000 V.

DC voltage, continuity, resistance, diode test and capacitance

Function	Range	Resolution	Accuracy	
mV	600.0 mV	0.1 mV	0.09 % + 2	
V	6.000 V	0.001 V		
	60.00 V	0.01 V	0.09 % + 2	
	600.0 V	0.1 V		
	1000 V	1 V	0.15 % + 2	
Ω	600 Ω	1 Ω	Meter beeps at $< 25 \Omega$, beeper detects opens or shorts of 250 μs or longer.	
Ω	600.0 Ω	0.1 Ω	0.5 % + 2	
	6.000 kΩ	0.001 kΩ		
	60.00 kΩ	0.01 kΩ	0.50/ . 1	
	60.00 kΩ	0.1 kΩ	0.5 % + 1	
	600.0 kΩ	0.001 ΜΩ		
	50.00 MΩ	0.01 ΜΩ	1.5 % + 3	
Diode test	2.000 V	0.001 V	1 % + 2	
μF	1000 nF	1 nF		
	10.00 μF	0.01 μF	1.2 % + 2	
	100.0 μF	0.1 μF		
	9999 μF¹	1 μF	10 % typical	

 $^{^1}$ In the 9999 μF range for measurements to 1000 μF , the measurement accuracy is 1.2 % + 2.

AC and DC current

Function	Range ¹	Resolution	Accuracy
X X C (A C II - +- 1 I-IIC)	60.00 mA	0.01 mA	1.5 % + 3
mA AC (45 Hz to 1 kHZ)	400.0 mA ³	0.1 mA	
* DG2	60.00 mA	0.01 mA	0.70% - 0
mA DC ²	400.0 mA ³	0.1 mA	0.5 % + 3

 $^{^{\}rm 1}$ All ac current ranges are specified from 5 % of range to 100 % of range.



 $^{^3}$ For non-sinusoidial waveforms, add \pm (2 % of reading + 2 % full scale) typical, for crest factor up to 3.

⁴ Do not exceed 10⁷ V-Hz.

² Input burden voltage (typical): 400 mA input 2 mV/mA.

³ 400.0 mA accuracy specified up to 600 mA overload.



Frequency

Range	Resolution	Accuracy [1]
99.99 Hz	0.01 Hz	
999.9 Hz	0.1 Hz	0.1 % + 1
9.999 kHz	0.001 kHz	0.1 % + 1
99.99 kHz	0.01 kHz	

 $^{^{\}rm 1}$ Frequency is specified up to 99.99 kHz in volts and up to 10 kHz in amps.

Input characteristics

Function	Overload Protection	Input Impedance (nominal)	Common Mode Rejection	n Ratio (1 kΩ unbalance)	Normal Mode Rejection
v	1100 V rms	> 10 MΩ < 100 pF	> 120 dB at dc	, 50 Hz or 60 Hz	> 60 dB at 50 Hz or 60 Hz
ĩ	1100 V rms	> 10 MΩ < 100 pF	> 60 dB, c	lc to 60 Hz	
<u>≃.</u> mV	1100 V rms	> 10 MΩ < 100 pF	> 120 dB at dc	, 50 Hz or 60 Hz	> 60 dB at 50 Hz or 60 Hz
Open circuit test voltage		Full scal	e voltage	Transical about singuit annuant	
		To 6 M Ω	50 ΜΩ	Typical short circuit current	
Ω/-⊬	1100 V rms	< 2.7 V dc	< 0.7 V dc	< 0.9 V dc	< 350 mA
11)))/->-	1100 V rms	< 2.7 V dc	2.000) V dc	< 1.1 mA

Function	Overload Protection	Overload
mA	Fused, 44/100 A, 1000 V FAST Fuse	600 mA overload for 2 minutes maximum, 10 minutes rest minimum

MIN/MAX recording

Function	Accuracy
DC functions	The specified accuracy of the measurement function \pm 12 counts for changes > 350 ms in duration.
AC functions	The specified accuracy of the measurement function \pm 40 counts for changes > 900 ms in duration.

General specifications (Not compatible with Fluke CNX test tools)

Maximum voltage between any terminal and earth ground	1000 V dc or ac rms
Ω fuse protection from A inputs	0.44 A (44/100 A, 440 mA), 1000 V FAST Fuse, Fluke specified part only
Display (LCD)	Update rate: 4/sec Votis, amps, ohms: 6000 counts Frequency: 10,000 counts Capacitance: 1,000 counts
Battery type	Three AA Alkaline batteries, NEDA 15A IEC LR6
Battery life	250 hours minimum
RF communications	2.4 GHZ ISM Band
RF communication range	Open air, unobstructed: Up to 20m Obstructed, sheetrock wall: Up to 6.5m Obstructed, concrete wall, or steel electrical enclosure: Up to 3.5m
Temperature	Operating: -10 °C to 50 °C Storage: -40 °C to 60 °C
Temperature coefficient	0.1 X (specified accuracy) /°C (<18 °C or >28 °C)
Relative humidity	0 % to 90 % (0 °C to 35 °C), 0 % to 75 % (35 °C to 40 °C), 0 % to 45 % (40 °C to 50 °C)
Altitude	Operating: 2,000 m Storage: 12,000 m
Electromagnetic compatibilty EMI, RFI, EMC, RF	EN 61326-1:2013, EN 61326-2-2:2013. ETSI EN 300 328 V1.7.1:2006, ETSI EN 300 489 V1.8.1:2008, FCC Part 15 Subpart C Sections 15.207, 15.209, 15.249, FCCID: FCC: T68-FDMMBLE IC: 6627A-FDMMBLE
Safety compliance	ANSI/ISA 61010-1 / (82.02.01): 3 rd edition CAN/CSA-C22.2 No 61010-1-12: 3 rd edition UL 61010-1: 3 rd edition IEC/EN 61010-1:2010
Certifications	cCSAus, FCC, CE
Ingress Protection (IP) rating	IP54
Pollution Degree	2
Size (H x W x L)	4.75 cm x 9.3 cm x 20.7 cm (1.87 in x 3.68 in x 8.14 in)
Weight	340 g (12 oz)



Fluke a3000 FC Wireless AC Current Clamp Meter

A fully functional true-rms current clamp meter that wirelessly relays measurements to other Fluke Connect™ enabled master units, listed below.

- Fluke 3000 FC DMM
- Fluke TiX560/520 Infrared Camera
- Fluke Ti200/300/400 Infrared Camera
- PC via optional pc3000 FC Adapter
- Fluke Connect Mobile app

a3000 FC main features include:

- True-rms ac clamp meter
- Measure up to 400 A ac
- Use as a standalone meter or as part of the system
- Logging function for recording and saving up to 65,000 readings
- Inrush function

a3000 FC general specifications

Range	0.5 A to 400.0 A
Resolution	0.1 A
Accuracy	400.0 A: 2 % \pm 5 digits (10 Hz to 100 Hz), 2.5 % \pm 5 digits (100 Hz to 500 Hz)
Inrush	Max displayed reading: 999.9A
Crest factor (50 Hz/60 Hz)	3 at 500 A, 2.5 at 600 A, 1.42 at 1000 A, add 2 % for C.F. > 2
LCD w/backlight	3½ digits
Log rate/interval	1 sec minimum/adjustable by PC
Battery type	2 AA, NEDA 15 A, IEC LR6
Battery life	400 hours
Memory	Record up to 65,000 readings
RF communications	2.4 GHZ ISM Band
RF communication range	Open air, unobstructed: Up to 20 m Obstructed, sheetrock wall: Up to 6.5 m Obstructed, concrete wall or steel electrical enclosure: Up to 3.5 m
Operating temperature	-10 °C to +50 °C
Storage temperature	-40 °C to +60 °C
Temperature coefficient	Add 0.1 x (specified accuracy)/°C (< 18 °C or > 28 °C)
Operating humidity	90 % at 35 °C, 75 % at 40 °C, 45 % at 50 °C
Altitude	Operating: 2,000 m Storage: 12,000 m
EMC	EN 61326-1:2013
Safety compliance	IEC 61010-1, CAT III 600 V, CAT IV 300 V, 3rd edition
Safety rating	CAT III 600 V, CAT IV 300 V
Certifications	cCSAus, CE, FCC: T68-FBLE IC: 6627A-FBLE
Ingress Protection (IP) rating	IP30
Pollution Degree	2
Jaw opening	34 mm (1.33 in)
Size (HxWxD)	20.3 cm x 7.49 cm x 3.55 cm (8 in x 2.95 in x 1.4 in)
Weight	.22 kg (8 oz)





Fluke a3001 FC Wireless iFlex AC Current Meter


A true-rms current clamp meter that wirelessly relays measurements to other Fluke Connect™ enabled master units, listed below.

- Fluke 3000 FC DMM
- Fluke TiX560/520 Infrared Camera
- Fluke Ti200/300/400 Infrared Camera
- PC via optional pc3000 FC Adapter
- Fluke Connect Mobile app


The iFlex™ Wireless Current Meter allows you to measure around awkward sized conductors or get into tight spaces and makes wire access easier.

- Contains: One true-rms flexible current meter and one iFlex i2500-10 Flexible Current Probe
- Measure up to 2500 A ac
- Use as a standalone meter or as part of the system
- Logging function for recording and saving up to 65,000 readings
- · Inrush function
- · Magnetic hanging strap



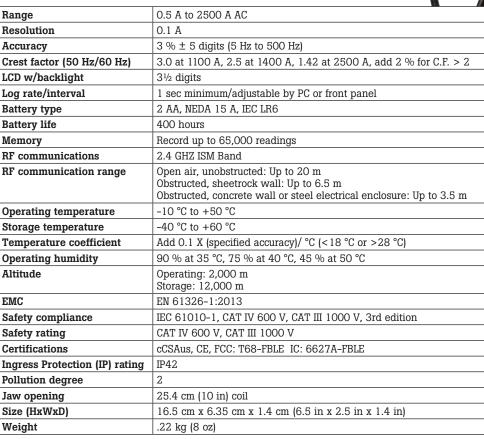



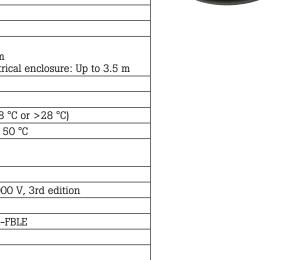



Fluke a3002 FC Wireless AC/DC Current Meter Module

Designed to be used with the i410 or i1010 ac/dc current clamps (not included with meter). AC/DC current meter that wirelessly relays measurements from the i410 or i1010 clamp accessory to other Fluke Connect^{rst} enabled master units, listed below.

- Fluke 3000 FC DMM
- Fluke TiX560/520 Infrared Camera
- Fluke Ti200/300/400 Infrared Camera
- PC via optional pc3000 FC Adapter
- Fluke Connect Mobile app

a3002 FC main features include:

- Measure up to 400 A ac or 400 A dc with i410 (sold separately)
- Measure up to 600 A ac or 1000 A dc with i1010 (sold separately)
- Use as a standalone meter or as part of the system
- Logging function for recording and saving up to 65,000 readings
- · Magnetic hanging strap

Accuracy is specified for 1 year after calibration, at operating temperatures of 18 °C to 28 °C, with relative humidity at 0 % to 90 %. Accuracy specifications take the form of \pm {[% of Reading] + [Number of least significant digits]}. Dc ranges are autoranging. Ac accuracy is specified from 1 % to 110 % of the range. dc accuracy is specified from -110 % to 110 % of range.

AC/DC current

Function	Range	Resolution	Accuracy ¹
A dc	1000 A	0.1 A	(0.5 % + 3)
A ac	600.0 A	0.1 A	(1.0 % + 3)

¹AC accuracy is specified from 45 Hz to 1000 Hz

a3002 FC general specifications

Maximum voltage between terminal and earth ground (meter)	30 V dc or ac rms
LCD w/backlight	3 ½ digits, 6000 counts, 4/sec update rate
Log rate/Interval	Adjustable by PC from 1 sec to 1 hr, default 1 min
Battery type	2 AA Alkaline batteries, NEDA 15A, IEC LR6
Battery life	400 hours minimum
Memory	Record up to 65,000 readings
RF communications	2.4 GHz ISM Band
RF communication range	Open air, unobstructed: Up to 20 m Obstructed, sheetrock wall: Up to 6.5 m Obstructed, concrete wall or steel electrical enclosure: Up to 3.5 m
Operating temperature	-10 °C to +50 °C
Storage temperature	-40 °C to +60 °C
Temperature coefficient	0.1 X (specified accuracy)/°C (< 18 °C or > 28 °C)
Relative humidity	0 % to 90 % (0 °C to 35 °C), 0 % to 75 % (35 °C to 40 °C), 0 % to 45 % (40 °C to 50 °C)
EMC	IEC 61236-1:2013
	Protected to IEC 61010-1, 3rd edition, Pollution Degree 2
Certifications	cCSAus, CE, FCC: T68-FBLE IC: 6627A-FBLE
Ingress Protection (IP) rating	IP42
Size (HxWxD)	160 mm x 66 mm x 38 mm (6.3 in x 2.6 in x 1.5 in)
Weight	0.255 kg (9 oz)





Fluke a3003 FC Wireless 2000 A DC **Current Clamp Meter**

A fully functional current clamp meter that wirelessly relays measurements to other Fluke Connect™ enabled master units, listed below.

- Fluke 3000 FC DMM
- Fluke TiX560/520 Infrared Camera
- Fluke Ti200/300/400 Infrared Camera
- PC via optional pc3000 FC Adapter
- Fluke Connect Mobile app

a3003 FC main features include:

- Measures up to 2000 A dc
- Large jaw size (64 mm) for measuring large, high current conductors
- Logging function for the recording and saving up to 65,000 measurements







a3003 FC general specifications

Range	1.0 A to 999.9 A dc, 1000 A to 2000 A dc	
Resolution	0.1 A, 1 A	
Accuracy	2 % ± 5 digits, 2.5 % ± 5 digits	
LCD w/backlight	3½ digits	
Log rate/interval	1 sec minimum/adjustable by PC or front panel	
Battery type	2 AA, NEDA 15 A, IEC LR6	
Battery life	120 hours	
Memory	Record up to 65,000 readings	
RF communications	2.4 GHZ ISM Band	
RF communication range	Open air, unobstructed (up to 20 m)	
Operating temperature	Obstructed, sheetrock wall (up to 6.5 m)	
	Obstructed, concrete wall or steel electrical enclosure (up to 3.5 m)	
	-10 °C to +50 °C	
Storage temperature -40 °C to +60 °C		
Temperature coefficient	Add 0.1 X (specified accuracy)/°C (< 18 °C or > 28 °C)	
Operating humidity	90 % at 35 °C	
	75 % at 40 °C 45 % at 50 °C	
Altitude	Operating: 2,000 m	
Attitude	Storage: 12,000 m	
EMC	EN 61326-1:2013	
Safety compliance	IEC 61010-1, CAT IV 600 V, CAT III 1000 V, 3rd edition	
Safety rating	CAT IV 600 V, CAT III 1000 V	
Certifications	cCSAus, CE, FCC: T68-FBLE IC: 6627A-FBLE	
Ingress Protection (IP) rating	IP42	
Jaw opening	64mm	
Size (HxWxD)	16.5 cm x 6.35 cm x 1.4 cm (6.5 in x 2.5 in x 1.4 in)	
Weight	.65 kg (1.75 lb)	
-		



Fluke a3004 FC Wireless DC 4-20 mA Current Meter

A fully functional current clamp meter that wirelessly relays measurements to other Fluke Connect™ enabled master units, listed below.

- Fluke 3000 FC DMM
- Fluke TiX560/520 Infrared Camera
- Fluke Ti200/300/400 Infrared Camera
- PC via optional pc3000 FC Adapter
- Fluke Connect Mobile app

a3004 FC main features include:

- Measure 4 to 20 mA signals without "breaking the loop"
- Detachable clamp with extension cable for measurements in tight
- Use as a standalone meter or as part of the system
- Logging function for the recording and saving up to 65,000 measurements



a3004 FC general specifications

Range	0.05 mA to 20.99 mA dc, 21.0 mA to 99.9 mA dc
Resolution	0.01 mA, 0.1 A
Accuracy	0.2 % ± 5 digits, 1.0 % ± 5 digits
LCD w/backlight	3½ digits
Log rate/interval	1 sec minimum/adjustable by PC or front panel
Battery type	2 AA, NEDA 15 A, IEC LR6
Battery life	45 hours
Memory	Record up to 65,000 readings
RF communications	2.4 GHZ ISM Band
RF communication range	Open air, unobstructed (up to 20 m)
Operating temperature	Obstructed, sheetrock wall (up to 6.5 m)
	Obstructed, concrete wall or steel electrical enclosure (up to 3.5 m)
	-10 °C to +50 °C
Storage temperature	-40 °C to +60 °C
Temperature coefficient	Add 0.1 X (specified accuracy)/°C (<18 °C or >28 °C)
Operating humidity	90 % at 35 °C
	75 % at 40 °C
	45 % at 50 °C
Altitude	Operating: 2,000 m
	Storage: 12,000 m
EMC	EN 61326-1:2013
Certifications	cCSAus, CE, FCC: T68-FBLE IC: 6627A-FBLE
Ingress Protection (IP) rating	IP42
Jaw opening	4.5 mm
Size (HxWxD)	16.5 cm x 6.35 cm x 1.4 cm (6.5 in x 2.5 in x 1.4 in)
Weight	.299 kg (0.8 lb)





Fluke v3000 FC Wireless True-rms AC Voltage Meter

A fully functional true-rms voltage meter that wirelessly relays ac voltage measurements to other Fluke Connect™ enabled master units, listed below.

- Fluke 3000 FC DMM
- Fluke TiX560/520 Infrared Camera
- Fluke Ti200/300/400 Infrared Camera
- PC via optional pc3000 FC Adapter
- Fluke Connect Mobile app


v3000 FC main features include:

- True-rms ac voltage meter
- Measure up to 1000 V
- Use as a standalone meter or as part of the system
- Logging function for recording and saving up to 65,000 readings
- TL224 Test Leads
- AC285 Alligator Clips
- Magnetic hanging strap

Accuracy is specified as \pm ([% of reading] + [number of least significant digits]). All ranges are autoranging. Accuracy is specified from 5 % to 100 % of the range obtained by autoranging, from 18 °C to 28 °C.

AC voltage

Range ¹	Resolution	Accuracy ^{2,3,4}	
		45 Hz to 500 Hz	500 Hz to 1 kHz
6.000 V	0.001 V		2.0 % + 3
60.00 V	0.01 V	1.0.0/- 1.2	
600.0 V	0.1 V	1.0 % + 3	2.0 % + 3
1000 V	1 V		



 $^{^2}$ Crest factor of \leq 3 at full scale up to 500 V, decreasing linearly to crest factor \leq 1.5 at 1000 V.

v3000 FC general specifications

LCD w/backlight	3½ digits, 6000 counts, updates 4/sec
Battery type	2 AA, NEDA 15 A, IEC LR6
Battery life	400 Hours
Memory	Record up to 65000 readings
RF communications	2.4 GHZ ISM Band
RF communication range	Open air, unobstructed: Up to 20 m Obstructed, sheetrock wall: Up to 6.5 m Obstructed, concrete wall or steel electrical enclosure: Up to 3.5 m
Operating temperature	-10 °C to +50 °C
Storage temperature	-40 °C to +60 °C
Temperature coefficient	0.1 X (specified accuracy)/°C (< 18 °C or > 28 °C)
Operating humidity	90 % at 35 °C, 45 % at 40 °C, 45 % at 50 °C
Altitude	Operating: 2,000 m Storage: 12,000 m
EMC	EN 61326-1:2013
Safety compliance	ANSI/ISA 61010-1/(82.02.01): 3rd edition CAN/CSA-C22.2 No 61010-1-12: 3rd edition UL 61010-1: 3rd edition IEC/EN 61010-1:2010
Safety rating	CAT IV 600 V, CAT III 1000 V
Certifications	cCSAus, CE, FCC: T68-FBLE IC: 6627A-FBLE
Ingress Protection (IP) rating	IP42
Pollution Degree	2
Size (HxWxD)	16.5 cm x 6.35 cm x 1.4 cm (6.5 in x 2.5 in x 1.4 in)
Weight	.22 kg (8 oz)



 $^{^3}$ For non-sinusoidial waveforms, add -(2%) of reading +2% full scale) typical, for crest factor up to 3.

⁴ Do not exceed 10⁶ V-Hz.



Fluke v3001 FC Wireless DC Voltage Meter

A fully functional dc voltage meter that wirelessly relays dc voltage measurements to other Fluke Connect™ enabled master units, listed below.

- Fluke 3000 FC DMM
- Fluke TiX560/520 Infrared Camera
- Fluke Ti200/300/400 Infrared Camera
- PC via optional pc3000 FC Adapter
- Fluke Connect Mobile app

v3001 FC main features include:

- Measure up to 1000 V dc
- Use as a standalone meter or as part of the system
- · Logging function for recording and saving up to 65,000 readings
- TL222 Test Leads
- AC220 Alligator Clips
- · Magnetic hanging strap

Accuracy is specified for 1 year after calibration, at operating temperatures of 18 °C to 28 °C, with relative humidity at 0 % to 90 %. Accuracy specifications take the form of \pm ([% of Reading] + [Number of least significant digits]).All ranges are autoranging. Accuracy is specified from the range obtained by autoranging, from 18 °C to 28 °C.

DC voltage			
Function	Range	Resolution	Accuracy
mV dc	600.0 mV	0.1 mV	0.09 % + 3
V dc	6.000 V	0.001 V	0.09 % + 3
	60.00 V	0.01 V	
	600.0 V	0.1 V	
	1000 V	1 V	0.15% + 2



v3001 FC general specifications

LCD w/backlight	3 ½ digits, 6000 counts, 4/sec update rate	
Battery type	2 AA Alkaline batteries, NEDA 15A, IEC LR6	
Log rate/Interval	Adjustable by PC from 1 sec to 1 hr, default 1 min	
Battery life	400 hours minimum	
Memory	Record up to 65,000 readings	
RF communications	2.4 GHz ISM Band	
RF communication range	Open air, unobstructed: Up to 20 m Obstructed, sheetrock wall: Up to 6.5 m Obstructed, concrete wall or steel electrical enclosure: Up to 3.5 m	
Operating temperature	-10 °C to +50 °C	
Storage temperature	-40 °C to +60 °C	
Temperature coefficient	0.1 X (specified accuracy)/°C (< 18 °C or > 28 °C)	
Relative humidity	0 % to 90 % (0 °C to 35 °C), 0 % to 75 % (35 °C to 40 °C), 0 % to 45 % (40 °C to 50 °C)	
EMC	IEC 61236-1:2013	
Safety Compliance	IEC 61010-1, CAT IV 600 V, CAT III 1000 V, 3rd edition Pollution Degree 2	
Certifications	cCSAus, CE, FCC: T68-FBLE IC: 6627A-FBLE	
Ingress Protection (IP) rating	IP42	
Size (HxWxD)	160 mm x 66 mm x 38 mm (6.3 in x 2.6 in x 1.5 in)	
Weight	0.255 kg (9 oz)	



Fluke t3000 FC Wireless K-Type Temperature Meter

A versatile K-type thermocouple thermometer wirelessly relays measurements to other Fluke Connect™ enabled master units, listed below.

- Fluke 3000 FC DMM
- Fluke TiX560/520 Infrared Camera
- Fluke Ti200/300/400 Infrared Camera
- PC via optional pc3000 FC Adapter
- Fluke Connect Mobile app

t3000 FC main features include:

- K-type Thermocouple Thermometer
- 80PK-1 K-type Bead Thermocouple
- Use as a standalone meter or as part of the system
- Logging function for recording and saving up to 65,000 readings
- · Magnetic hanging strap
- Other K-type temperature probes also available

t3000 FC general specifications

Range	K-type: -200 °C to 1372 °C
Resolution	0.1 °C
Accuracy	± [0.5 % + 0.5 °C] counts
Input terminals	K-type mini
LCD w/backlight	3 ½ digits
Log rate/interval	1 sec minimum/adjustable by PC
Battery type	2 AA, NEDA 15 A, IEC LR6
Battery life	400 hours
Memory	Record up to 65,000 readings
RF communications	2.4 GHZ ISM Band
RF communication range	Open air, unobstructed: Up to 20 m Obstructed, sheetrock wall: Up to 6.5 m Obstructed, concrete wall or steel electrical enclosure: Up to 3.5 m
Operating temperature	-10 °C to +50 °C
Storage temperature	-40 °C to +60 °C
Temperature coefficient	0.01 % of reading +0.03 °C per °C
Temperature scale	ITS-90
Operating humidity	90 % at 35 °C, 75 % at 40 °C, 45 % at 50 °C
Altitude	Operating: 2,000 m Storage: 12,000 m
EMC	EN 61326-1:2013
Safety compliance	IEC 61010-1, 3rd edition
Certifications	cCSAus, CE, FCC: T68-FBLE IC: 6627A-FBLE
Ingress Protection (IP) rating	IP42
Pollution Degree	2
Size (HxWxD)	16.5 cm x 6.35 cm x 1.4 cm (6.5 in x 2.5 in x 1.4 in)
Weight	.22 kg (8 oz)





Fluke pc3000 FC Adapter and Software

Fluke 3000 FC Wireless Test Tools show real-time measurements from remote meter modules up to 20 meters away on your PC

Fluke FC wireless test tools work together to help you troubleshoot faster. The pc3000 FC Adapter and Software help you understand the information you measure. When you need to get information back to a PC the pc3000 FC Adapter and Software wirelessly collects up to 65,000 sets of time stamped min/max/avg readings from FC remote meter modules. Software can display live readings from up to six meter modules simultaneously. Allows custom logging intervals and custom names for meter modules. Includes Windows SW3000 software.



Software requirements:

Fluke pc3000 must be connected to the USB port in order to enable communication between FC meter modules and software. SW3000 will support up to two pc3000 FC Adapters.

OS Compatibility:

Windows XP or later.

Not compatible with Fluke CNX test tools

RF connection time (binding time) can be up to one minute for all FC wireless tools.



Ordering information

Main units:

FLK-3000FC FC Wireless Digital Multimeter

Meter modules:

FLK-A3000FC FC Wireless AC Current Clamp Meter
FLK-A3001FC FC Wireless iFlex AC Current Meter
FLK-A3002FC FC Wireless AC/DC Current Meter Module
FLK-A3003FC FC Wireless DC Current Clamp Meter
FLK-A3004FC FC Wireless DC 4-20mA Current Meter
FLK-V3000FC FC Wireless AC Voltage Meter
FLK-V3001FC FC Wireless DC Voltage Meter

FLK-T3000FC FC Wireless K-Type Temperature Meter

FLK-PC3000FC PC Adapter and Software

Kite

FLK-3000 FC Industrial Kit Fluke 3000 FC Industrial System includes multimeter, three iFlex clamp meters, one ac voltage meter, PC adapter and desktop software, accessories

FLK-3000 FC General Maintenance Kit Fluke 3000 FC General Maintenance System includes multimeter, iFlex clamp meter, ac voltage meter, dc voltage meter, PC adapter and desktop software, accessories

FLK-3000 FC HVAC Kit Fluke 3000 FC HVAC System includes multimeter, ac current clamp meter, temperature meter, PC adapter and desktop software, accessories

FLK-T3000 FC Kit Fluke t3000 FC Kit includes multimeter, temperature meter, accessories

FLK-A3000 FC Kit Fluke a3000 FC Kit includes multimeter, ac current clamp meter, accessories

FLK-A3001 FC Kit Fluke a3001 FC Kit includes multimeter, iFlex clamp meter, accessories

FLK-V3000 FC Kit Fluke v3000 FC Kit includes multimeter, ac voltage meter, accessories

FLK-V3001 FC Kit Fluke v3001 FC Kit includes multimeter, dc voltage meter, accessories

FLK-V3003 FC Kit Fluke v3003 FC Kit includes multimeter, ac voltage meter, dc voltage meter, accessories

Fluke. Keeping your world up and running.®

Fluke Corporation

PO Box 9090, Everett, WA 98206 U.S.A.

Fluke Europe B.V.

PO Box 1186, 5602 BD Eindhoven, The Netherlands

For more information call:

In the U.S.A. (800) 443-5853 or Fax (425) 446-5116 In Europe/M-East/Africa +31 (0) 40 2675 200 or Fax +31 (0) 40 2675 222 In Canada (800)-36-FLUKE or Fax (905) 890-6866 From other countries +1 (425) 446-5500 or

Fax +1 (425) 446-5116 Web access: http://www.fluke.com

©2014-2015 Fluke Corporation. Specifications subject to change without notice. Printed in U.S.A. 4/2015 6002305c-en

Modification of this document is not permitted without written permission from Fluke Corporation.

X-ON Electronics

Largest Supplier of Electrical and Electronic Components

Click to view similar products for fluke manufacturer:

Other Similar products are found below:

FLUKE-1630-2FC 665080 677393 FLK-VT04-CHARGER FLUKE 1663 FLUKE-355 FLUKE-424D FLUKE 80PK-11 FLUKE 80PK-22

FLUKE 80PK-26 FLUKE A3002FC FLUKE C280 FLUKE I200 FLUKE I3000FLEX-24 FLUKE I400 FLUKE TLK287 FLUKE TP1 FOC
ST/FC FUSE-15A/600BLSTR DSP-SR 1633984 C28Y 2166266 RS41 2558118 STL120-III 1LAC-A FLUKE 116/323 FLUKE 52

FLUKE 54 FLUKE-789 FLUKE-805 FLUKE 80K-15 FLUKE 8808/TL FLUKE C101 FLUKE I410 FLUKE T3000FC FLUKE T5-1000
KIT FLUKE TP912 FLUKE V3000FC 2570235 2584935 2679822 3829398 4017176 4096855 4328074 4366444 TL224 3352559