



△14. PLEASE REFER TO THE PRODUCT GUIDELINE ETAD-H1016 FOR DETAIL OF CONNECTOR HANDLING.

THE POSITION BETWEEN THE CONNECTOR AND PAD

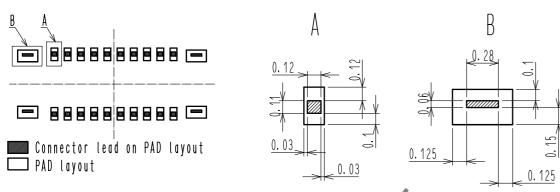

CAUTION FOR SOLDERING

THERE IS METAL EXPOSURE AREA BOTTOM OF THE CONNECTOR. TO AVOID SOLDER WICKING FROM THE BOTTOM SIDE, PLEASE DESIGN PCB PAD AND STENCIL WITH RECOMMENDED DIMENSIONS.



MATING METHOD


PLEASE MATE THE CONNECTOR BY HAND.

MATING PROCEDURE

FORM HC0011-5-8 1

(1) FIND THE ALIGNMENT AREA TO THE CONNECTOR IN THE APPROPRIATE MATING POSITION. THIS CONNECTOR HAS AN ALIGNMENT CHAMBER(GUIDANCE RIBS) ON RECEPTACLE SIDE AND 'R' ON PLUG SIDE, SO THAT THE CONNECTOR WILL BE SELF-ALIGNED.

WHEN THE CONNECTOR COMES TO THE APPROPRIATE POSITION, THE CONNECTOR GOES INTO THE ALIGNED POSITION. WHEN ALIGNED, IT CAN BE FELT BY HAND.

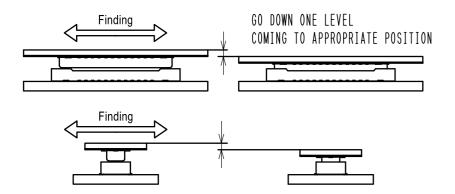

(2) WHEN GUIDING, THE CONNECTORS ARE ALIGNED PARALLEL TO EACH OTHER, WITH LONGITUDINAL AND LATERAL MOVEMENTS RESTRICTED. MATE THEM PROPERLY BY APPLYING FORCE IN THIS CONDITION.




(3) MAKE SURE THE CONNECTORS ARE MATED CORRECTLY. IF ONE SIDE IS FLOATING OR THE CONNECTORS ARE MATED IN ONE DIRECTION, UN-MATE THEM ONCE, AND THEN MATE THEM AGAIN, FOLLOWING THE PROCEDURES ABOVE FROM THE BEGINNING.


UN-MATING METHOD

PLEASE UN-MATE THE CONNECTOR BY HAND


(1) UN-MATE THE CONNECTORS PARALLEL TO EACH OTHER. HOWEVER, IF THE CONNECTORS HAVE HIGH PIN COUNTS OR THINNER FPC AND STIFFENER. IT BECOMES MORE DIFFICULT TO DO SO.

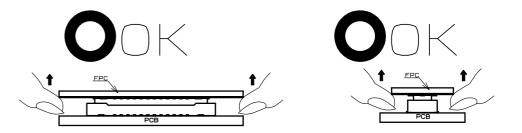

(2) IF THE CONNECTOR CANNOT BE UN-MATED PARALLEL IT CAN BE REMOVED DIAGONALLY FROM THE PITCH DIRECTION. BE CAREFUL TO DO SO SINCE THIS ACTION APPLIES STRESS ON THE CONTACT.

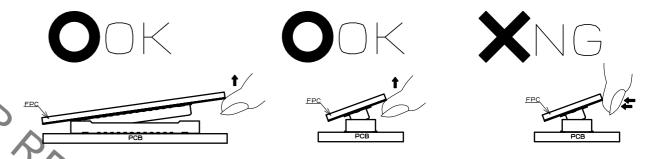

FPC IS NOT RIGID. THE CONNECTOR CAN BE BROKEN. PLEASE CHECK THE ACTION OF THE FPC TO BE USED REPEATEDLY AT THE TIME OF TRIAL PRODUCTION. BE CAREFUL TO UN-MATE THEM FROM THE PITCH DIRECTION. DM THE CORNER CAN ALSO RISK TO PUTTING STRESS ON CONTACTS.

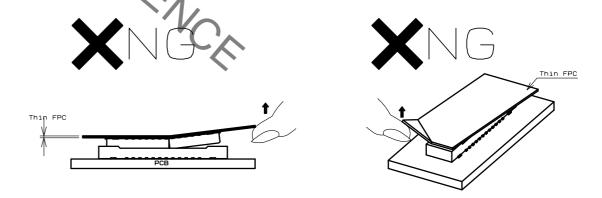

HS.	DRAWING NO.	EDC-365212-53-00
	PART NO.	BM28B0.6-20DS/2-0.35V(53)
	CODE NO.	CL0673-5040-0-53 🛕 3/3
		•

X-ON Electronics

Largest Supplier of Electrical and Electronic Components

Click to view similar products for Board to Board & Mezzanine Connectors category:

Click to view products by Hirose manufacturer:

Other Similar products are found below:

589158040000018 MDF7C-18P-2.54DSA(55) FCN-230C068-11 FCN-268F012-G/BD FCN-268F036-G/BD FCN-268M012-G/0D FCN-268M024-G/1D FCN-723J004/1 MIS-048-01-F-D-DP-K 832-10-034-10-001000 FX4C-80S-1.27DSA FCN-214Q030-G/0 FCN-234P048-G/0 FCN-235D050-G/C 210-93-314-41-105000 2-22603-0 MDF7-40DP-2.54DSA(55) AXG720047 MIT-114-03-F-D-K 55323-1519 DF33-2P-3.3DSA(24) YFT-20-05-H-03-SB-K 503308-3040 026-6203-PDB 027-6203-PDB 069159702701000 10123981-102LF 101A10019X 55650-0588-C 68682-310LF 68684-306 75140-7012 87471-650 YTW-30-07-H-Q-410-140 FCN-268F024-G0D 10124054-515LF 68685-603 8-1616154-3 MIS-019-01-F-D FCN-268M024-G/3D FCN-268M036-G/BD 20021832-06016C1LF KX15-20KLDL-E1000E AXE810124 FCN-214J100-G/0 FCN-230C068-E/S AXE812124 AXE816124 AXE720127 354184