


PCB Layout


2- ϕ 0.75 Holes

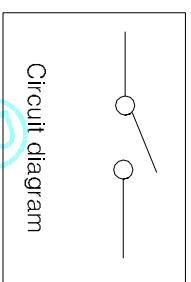




NO.1	
PART NO	H
A	2.0
B	2.5

NO.4-NO.5	
PART NO	NOTE
01-99	SERIAL NUMBER

NO.2	
PART NO	VIGOR
1	90 \pm 30
3	180 \pm 30
4	250 \pm 30

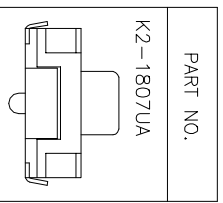

NO.3	
PART NO	MATERIAL/QTY
S	SUS/1PC
D	SUS/2PCS

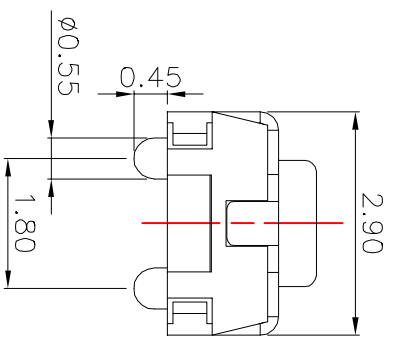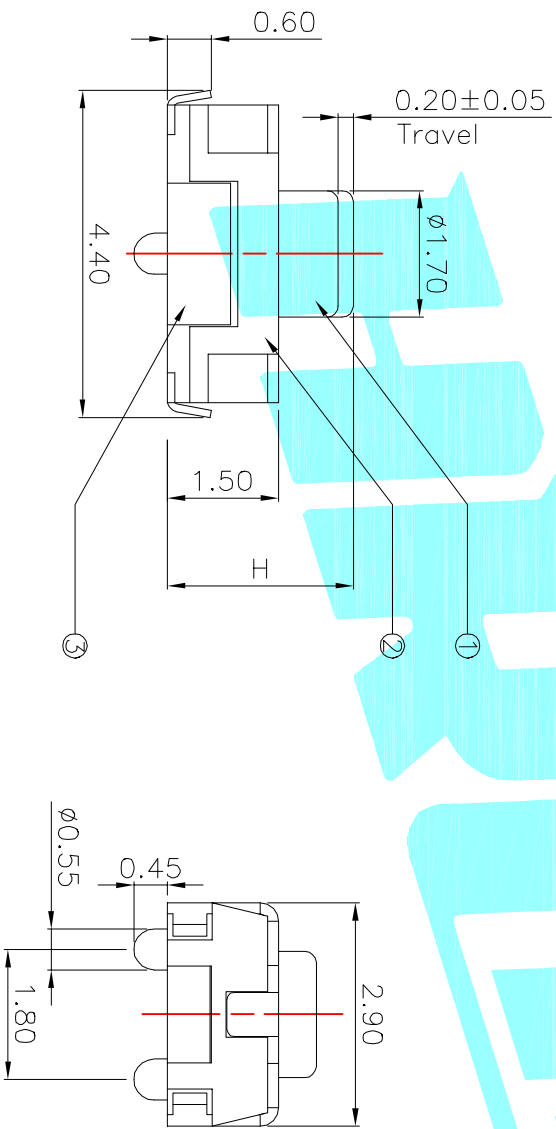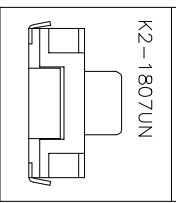

ITEM	PART NAME	TER'NO.	QTY.	MATERIAL	FINISHING	REMARK
①	Keystoke	---	1	Nylon	Natural	---
②	Cover	---	1	SUS	Black	---
③	Base	---	1	Nylon	Black	---
④	Contact	---	2	F.Ag/SUS	---	---
⑤	Terminal	---	2	Phosphor Bronze	Plating silver	---
⑥	Dust cover	---	1	KAPTON FILM	Yellow	---

APPROVALS	DATE	TITLE:
DRAWN xu qi feng	2014/10/21	TACT SWITCHS
CHECKED		
APPROVALS		

ECN NO.	REV.	DATE.	DESCRIPTION.	CHANGE.	CHECK.	APPRO.
	A		NEW			
<p style="text-align: center;">HONGJIAN ELECTRONICS CO.,LTD</p>						
TOLERANCES ARE			30 \pm 0.15	\pm 0.30	ANGLE	PART NO.
			10 \sim 30	\pm 0.20	UNIT: mm	K2-1807UD-000W-00
			5 \sim 10	\pm 0.15	SCALE: 1:1	PROJ.
			\sim 5	\pm 0.10	DRAWING NO.	SHEET 1 OF 1

X-ON Electronics

Largest Supplier of Electrical and Electronic Components

Click to view similar products for [Tactile Switches](#) category:

Click to view products by [HRO parts](#) manufacturer:

Other Similar products are found below :

[KMR633NG LFG](#) [5GTH92001](#) [5GTH9202242](#) [6426-201-11343](#) [MJ1226](#) [MJTP1109B](#) [MJTP1138EAUTR](#) [MJTP1230BL](#) [MJTPSHW](#)
[GS6.90F300QP](#) [1-1977223-0](#) [1-1977120-4](#) [ADTSA62NV](#) [ADTSA62RV](#) [ADTSA63KV](#) [ADTSA644NV](#) [ADTSM24NVTR](#) [ADTSMW66NV](#)
[ADTSMW67RV](#) [ATM533VTR](#) [1571300-3](#) [B3F-3123](#) [B3F-6055A](#) [B3F-B32-01-KIT](#) [1977177-8](#) [1977266-1](#) [2-1977223-4](#) [2-1977223-7](#)
[ADTS644KV](#) [ADTSA61RV](#) [ADTSA62KV](#) [ADTSA63NV](#) [ADTSA63RV](#) [ADTSA65NV](#) [ADTSM21NSVTR](#) [ADTSM25RVTR](#)
[ADTSM31RVTR](#) [ADTSM32NVTR](#) [ADTSM61YVTR](#) [ADTSM63SVTR](#) [ADTSM644KVTR](#) [ADTSMW64RV](#) [ADTSMW69NV](#)
[FSMRA4JHA04](#) [GS4.70F300QP](#) [D38999/20JJ37SA](#) [TL1105B](#) [TL1105J](#) [ATH447K2Q](#) [ATM534VTR](#)