# MQ-3 Semiconductor Sensor for Alcohol

Sensitive material of MQ-3 gas sensor is  $SnO_{2}$ , which with lower conductivity in clean air. When the target alcohol gas exist, The sensor's conductivity is more higher along with the gas concentration rising. Please use simple electrocircuit, Convert change of conductivity to correspond output signal of gas concentration.

MQ-3 gas sensor has high sensitity to Alcohol, and has good resistance to disturb of gasoline, smoke and vapor. The sensor could be used to detect alcohol with different concentration, it is with low cost and suitable for different application.

# **Character**

- \* Good sensitivity to alcohol gas
- \* Long life and low cost
- \* Simple drive circuit

# **Application**


- \* Vehicel alcohol detector
- \* Portable alcohol detector


# Technical Data Basic test loop

Model No.			MQ-3
Sensor Type			Semiconductor
Standard Encapsulation			Bakelite (Black Bakelite)
Detection Gas			Alcohol gas
Concentration			0.04-4mg/l alcohol
Circuit	Loop Voltage	Vc	≤24V DC
	Heater Voltage	V <sub>H</sub>	5.0V±0.2V AC or DC
	Load Resistance	$R_L$	Adjustable
Character	Heater Resistance	R <sub>H</sub>	31Ω±3Ω (Room Tem.)
	Heater consumption	P <sub>H</sub>	≤900mW
	Sensing Resistance	Rs	2KΩ-20KΩ(in 0.4mg/l alcohol )
	Sensitivity	S	Rs(in air)/Rs(0.4mg/L Alcohol)≥5
	Slope	α	≤0.6(R <sub>300ppm</sub> /R <sub>100ppm</sub> Alcohol)
Condition	Tem. Humidity		20℃±2℃; 65%±5%RH
	Standard test circuit		Vc:5.0V±0.1V;
			V <sub>H</sub> : 5.0V±0.1V
	Preheat time		Over 48 hours

# Ps=Vc<sup>2</sup>×Rs/(Rs+RL)<sup>2</sup>

# Configuration

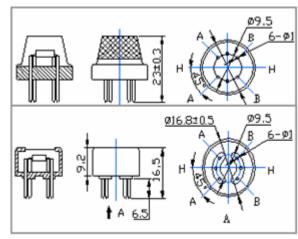

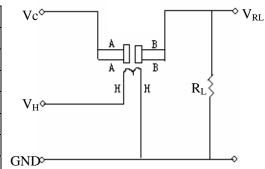


The above is basic test circuit of the sensor.

The sensor need to be put 2 voltage,
heater voltage(VH) and test voltage(VC).

VH used to supply certified working
temperature to the sensor, while VC used
to detect voltage (VRL) on load resistance
(RL) whom is in series with sensor. The
sensor has light polarity, Vc need DC
power. VC and VH could use same power
circuit with precondition to assure
performance of sensor. In order to make
the sensor with better performance,
suitable RL value is needed:
Power of Sensitivity body(Ps):

# **Sensitivity Characteristics**

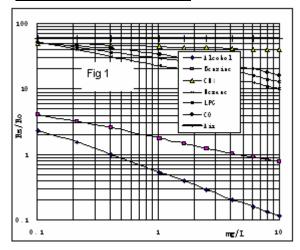

# Influence of Temperature/Humidity


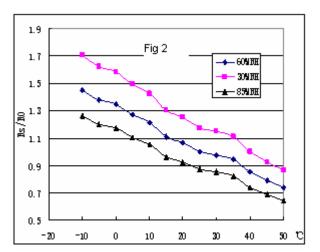


Fig.1 shows the typical sensitivity characteristics of the MQ-3, ordinate means resistance ratio of the sensor (Rs/Ro), abscissa is concentration of gases. Rs means resistance in different gases, Ro means resistance of sensor in 0. 4mg/l alcohol. All test are under standard test conditions.

P.S.: Sensitivity to smoke is ignite 10pcs cigarettes in 8m<sup>3</sup> room, and the output equals to 0.1mg/l alcohol

Fig.2 shows the typical temperature and humidity characteristics. Ordinate means resistance ratio of the sensor (Rs/Ro), Rs means resistance of sensor in 0.4mg/l alcohol under different tem. and humidity. Ro means resistance of the sensor in environment of 0.4mg/l alcohol, 20°C/65%RH

# **Structure and configuration**

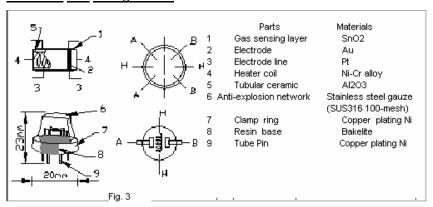

Structure and configuration of MQ-3 gas sensor is shown as Fig. 3, sensor composed by micro AL2O3 ceramic tube, Tin Dioxide (SnO2) sensitive layer, measuring electrode and heater are fixed into a crust made by plastic and stainless steel net. The heater provides necessary work conditions for work of sensitive components. The enveloped MQ-4 have 6 pin, 4 of them are used to fetch signals, and other 2 are used for providing heating current.

## **Notification**

# 1 Following conditions must be prohibited

# 1.1 Exposed to organic silicon steam

Organic silicon steam cause sensors invalid, sensors must be avoid exposing to silicon bond, fixature, silicon latex, putty or plastic contain silicon environment

# 1.2 High Corrosive gas

If the sensors exposed to high concentration corrosive gas (such as  $H_2Sz$ ,  $SO_X$ ,  $CI_2$ , HCI etc), it will not only result in corrosion of sensors structure, also it cause sincere sensitivity attenuation.

## 1.3 Alkali, Alkali metals salt, halogen pollution

The sensors performance will be changed badly if sensors be sprayed polluted by alkali metals salt especially brine, or be exposed to halogen such as fluorin.

#### 1.4 Touch water

Sensitivity of the sensors will be reduced when spattered or dipped in water.

#### 1.5 Freezing


Do avoid icing on sensor'surface, otherwise sensor would lose sensitivity.

#### 1.6 Applied voltage higher

Applied voltage on sensor should not be higher than stipulated value, otherwise it cause down-line or heater damaged, and bring on sensors' sensitivity characteristic changed badly.

## 1.7 Voltage on wrong pins

For 6 pins sensor, if apply voltage on  $1 \times 3$  pins or  $4 \times 6$  pins, it will make lead broken, and without signal when apply on  $2 \times 4$  pins



# 2 Following conditions must be avoided

# 2.1 Water Condensation

Indoor conditions, slight water condensation will effect sensors performance lightly. However, if water condensation on sensors surface and keep a certain period, sensor' sensitivity will be decreased.

### 2.2 Used in high gas concentration

No matter the sensor is electrified or not, if long time placed in high gas concentration, if will affect sensors characteristic.

#### 2.3 Long time storage

The sensors resistance produce reversible drift if it's stored for long time without electrify, this drift is related with storage conditions. Sensors should be stored in airproof without silicon gel bag with clean air. For the sensors with long time storage but no electrify, they need long aging time for stbility before using.

## 2.4 Long time exposed to adverse environment

No matter the sensors electrified or not, if exposed to adverse environment for long time, such as high humidity, high temperature, or high pollution etc, it will effect the sensors performance badly.

#### 2.5 Vibration

Continual vibration will result in sensors down-lead response then repture. In transportation or assembling line, pneumatic screwdriver/ultrasonic welding machine can lead this vibration.

#### 2.6 Concussion

If sensors meet strong concussion, it may lead its lead wire disconnected.

## 2.7 Usage

For sensor, handmade welding is optimal way. If use wave crest welding should meet the following conditions:

- 2.7.1 Soldering flux: Rosin soldering flux contains least chlorine
- 2.7.2 Speed: 1-2 Meter/ Minute
- 2.7.3 Warm-up temperature: 100±20℃
- 2.7.4 Welding temperature: 250±10°C
- 2.7.5 1 time pass wave crest welding machine

If disobey the above using terms, sensors sensitivity will be reduced.

# **X-ON Electronics**

Largest Supplier of Electrical and Electronic Components

Click to view similar products for Multiple Function Sensor Development Tools category:

Click to view products by MikroElektronika manufacturer:

Other Similar products are found below:

MAXWSNENV# STEVAL-MKIT01V1 KT-O2-25%-TB200A-E KT-TVOC-200-TB200A KT-NmHc-200-TB200A SEN0344 PIM520
PIM518 PIM519 PIM502 EVAL-AD7746HDZ AS7022-EVALKIT ALTEHTG2SMIP MAX30101WING# OB1203SD-U-EVK MIKROE4265 A000070 EV\_ICG-20660L GX-F12A-P GX-F15A GX-F6A-P GX-F8B GX-H12A-P GX-H15AI-P GX-H6A-P 1093 MIKROE-2455
MIKROE-2458 MIKROE-2507 MIKROE-2508 MIKROE-2516 MIKROE-2529 1458 MIKROE-1628 176 189 1893 2106 ATQT4-XPRO
GP30-DEMO MODULE GX-F12AI-P GX-F15A-P GX-F8A-P GX-FL15B-P GX-H15A-P GX-H6AI-P GX-H8A GX-H8AI-P GX-H8A-P
GX-F15AI-P