High Isolation Gate Drive Transformers





- Rugged design for Industrial Applications
- UL recognized, TUV approved to IEC 60950
- Up to 4250Vrms gate to drive isolation
- IEC 61558, IEC 61010 & IEC 60601 reinforced insulation compliant designs

Electrical Specifications @ 25°C – Operating Temperature –40°C to +125°C										
	Turns Ratio	ET (V * µsec MAX)	Primary Inductance (1-10) (µH MIN)	Leakage Inductance Gate to Drive (µH MAX)	DCR Drive (1-10) (mΩ ±20%)	DCR Gates (m Ω ±20%)	Hi-Pot			
Part ^{4, 5} Number							Drive-Gate (Vrms)	Gate-Gate (Vrms)		
P0584NL	1:1:1	95	450	0.5	80	72	3000	1500		
P0585NL	1:1:1:1:1	95	450	3.0	330	180	3000	1500*		
P0584ANL	1:1:1	115	686	0.8	710	710	4250	1500		
P0585ANL	1:1:1:1:1	115	686	4.6	710	710	4250	1500*		


Notes:

- 1. These gate drive transformers are meant to operate between 50 and 300 kHz with a 12V, 45% bipolar waveform.
- 2. The peak flux density should remain below 2100 Gauss to ensure that the core does not saturate. Use the following procedure to calculate the peak flux density:
 - A. Calculate the Volt-µsec product (ET):
 - ET = 10 * (Drive Voltage) * (Don) / (Frequency in kHz)
 - B. Calculate the operating flux density (B): B_{PK} (Gauss) = X * ET/Ff where:
 - Ff = 1 for unipolar drive applications and 2 for bipolar drive applications, X = 40 for -NL, 33 for -ANL
- 3. The temperature rise of the component is calculated based on the total core loss and copper loss:

- A. To calculate total copper loss (W), use the following formula: Copper Loss (W) = Irms² * (DCR_Drive + (# of Gates) * DCR_Gates)
- B. To calculate total core loss (W), use the following formula: Copper Loss (W) = 7.5E-5 * (Frequency in kHz)^{1.67} * (X * ET/1000)^{2.532} X = 20 for -NL, 16 for -ANL
- C. To calculate temperature rise, use the following formula: Temperature Rise (C) = $60.18 * (Core Loss(W) + Copper Loss(W))^{833}$
- 4. 500Vrms Hi-Pot between pins 5 & 6
- NL versions, which use triple insulated Teflon wire on the drive winding and magnetic wire on the gate windings, are TUV certified.
 ANL versions, which use triple insulated wire on both the drive and gate windings, are

compliant with IEC 61558, IEC 61010 & IEC 60601.

High Isolation Gate Drive Transformers

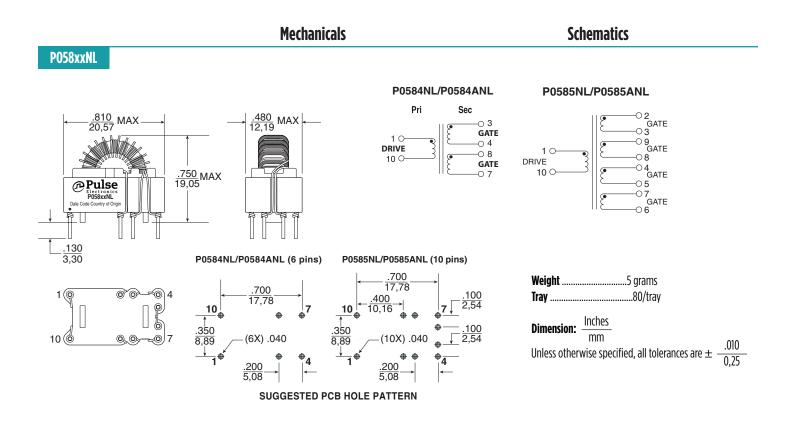

leadquarters		Pulse China Headquarters	Pulse North China	Pulse South Asia	Pulse North Asia
	Einsteinstrasse 1	B402, Shenzhen Academy of	Room 2704/2705	135 Joo Seng Road	3F, No. 198
2220 World Trade Drive	D-71083 Herren-	Aerospace Technol-	Super Ocean Finance	#03-02	Zhongyuan Road
San Diego, CA	berg	ogy Bldg.	Ctr.	PM Industrial Bldg.	Zhongli City
92128	Germany	10th Kejinan Road	2067 Yan An Road	Singapore 368363	Taoyuan County 320
J.S.A.		High-Tech Zone	West		Taiwan R. O. C.
		Nanshan District	Shanghai 200336		Tel: 886 3 4356768
		Shenzen, PR China	China	Tel: 65 6287 8998	Fax: 886 3 4356823 (Pulse)
el: 858 674 8100	Tel: 49 7032 78060	518057		Fax: 65 6287 8998	Fax: 886 3 4356820 (FRE)
ax: 858 674 8262	Fax: 49 7032 7806 135	Tel: 86 755 33966678	Tel: 86 21 62787060		,
		Fax: 86 755 33966700	Fax: 86 2162786973		

2

pulseelectronics.com

P515.C (04/15)



X-ON Electronics

Largest Supplier of Electrical and Electronic Components

Click to view similar products for Pulse Transformers category:

Click to view products by Pulse manufacturer:

Other Similar products are found below :

E4001NLT 1879401-1 IF-18-0269-N T1042NLT T1049NL PE-68023NL PH0905NL PT4163S PT5010 PA0173NLT CTX02-14608 PE-65457NLT T60403-D4721-X088 H1183NLT CTX33-18971-R HM2108NLT HM0068ANLT PG1427.001NLT 750031353 PH9400.566NLT PH9400.655ANLT PH9400.655NLT PH9385.013NLT B78307A2276A003 HX6096FNL HX6106NLT P0926NL HX6096NL PA3493NLT P0585ANL H1183NL HU4102NL PH9385.012NLT PH9400.111NLT PH9400.211NLT PH9400.233ANLT SMQC1553-6 78615/9JC-R SMQ1553-45 Q1553-45 Q1553-22 Q1553-21 PH9400.211ANLT TGMR-360V6LF P0544 PA0264NLT T60403-D4215-X014 T60403-F4185-X035 CTX02-13400 CTX02-14121