

Parallel Action Hand Tool CAT-HT-396-3232-12

Instruction Sheet

STS-M-396-3232-12

Rev. A

Date: 2/18/2015


Introduction

Parallel Action Hand Tool CAT-HT-396-3232-12 was designed to crimp CC396 (SESDT Part Series) contacts on 32 AWG Wire.

This tool should only be used for the terminals and wire gauges specified on this document. The tool is not adjustable. Variation in production batches of tools, connectors, wire stranding and insulation types may affect crimp parameters. The tool may not give a good insulation crimp support for all wire insulation sizes of the same wire gauge.

Crimping Procedure

- This tool can accept pins directly from a reel; however, if strips are preferred, Samtec recommends using ~6" length strips.
- Squeeze the handles until the tool ratchet releases, allowing the handles to fully open (Figure 1).
- 3. Slide the terminal carrier strip under the contact holder plate and align the carrier strip feed holes with the locating ball detent features. This tool is designed for a double carrier strip terminal. The top carrier strip cut-off tool separates the terminal from the strip onestrip-feed distance prior to the crimp station (Figure 2).
- Cycle the handle one or two times to ensure the top carrier strip is separated from the terminal. The terminal should now be properly positioned and ready to crimp (Figure 2)
- 5. Partially close the hand tool until you engage the first click of the ratchet.

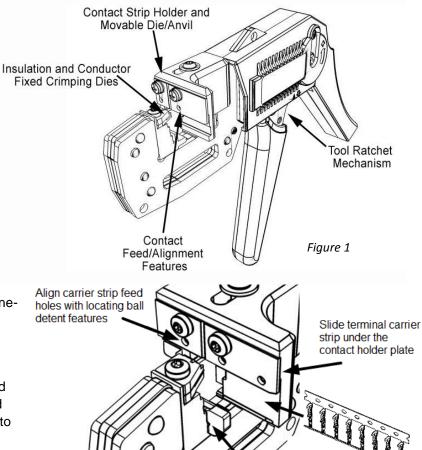

Top carrier strip cut-off

feature cuts terminal from strip one feed station prior to crimp

Figure 2



Parallel Action Hand Tool CAT-HT-396-3232-12

Instruction Sheet

STS-M-396-3232-12

Rev. A

Date: 2/18/2015

- 6. Insert a pre-stripped wire over the terminal crimp barrels; align the wire in the groove on the locator plate.
- 7. Close the handles together until the ratchet mechanism has completed the cycle and the handles release to the fully opened position.
- 8. Remove the crimped contact from the tool.
- 9. Manually feed the strip to locate the next terminal for crimping.

CAUTION: Should a terminal become stuck or jammed in a partially closed position, DO NOT use force to open or close the handles. The tool will easily open by pushing the ratchet release lever up (Figure 3).

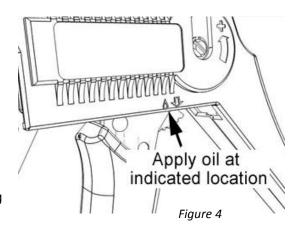


Figure 3

Tool Maintenance

It is recommended that each operator of the tool be made aware of, and be responsible for, following these maintenance steps:

- The tool was engineered for durability. However, for maximum service life and trouble free crimping, establish a good process of scheduled maintenance and lubrication.
- · Remove dust, moisture and other contaminants with a clean brush or soft, lint-free cloth ONLY.
- Make certain all pins, pivot points and bearing surfaces are protected with a thin coat of high quality machine oil. Do NOT oil excessively (Figure 4).
- Wipe excess oil from the hand tool, particularly from the crimping area.
- It is recommended to use light oil on all pivot points every 5000 crimps, or every 3 months.
- When tool is not in use, keep the handles closed to prevent objects from becoming lodged in the crimping area.
- · Store the tool in a clean dry place.





Parallel Action Hand Tool CAT-HT-396-3232-12

STS-M-396-3232-12

Date: 2/18/2015

Rev. A

Tool Dimensions (Figure 5)

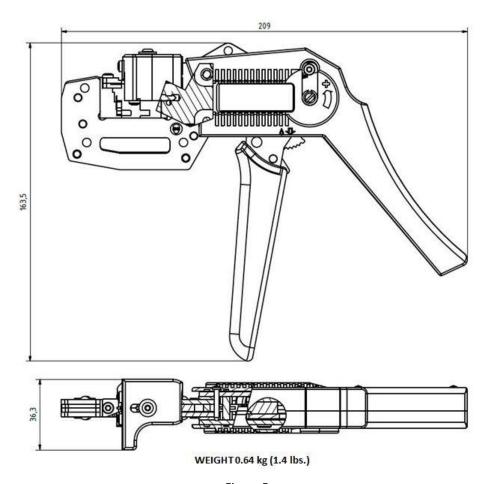


Figure 5

X-ON Electronics

Largest Supplier of Electrical and Electronic Components

Click to view similar products for Crimpers / Crimping Tools category:

Click to view products by Samtec manufacturer:

Other Similar products are found below:

010-0096 M225201-06 M225202-37 6-1579015-5 CT150-6-RH07 622-6441LF M322 6-304052-1 63456-0054 63484-3701 63800-8355 63819-1875 63819-2875 63819-4475 63823-3475 63827-5375 64001-0975 64001-4175 64005-0175 662903-2 690602-6 7-1579001-9 7-23471-1 762637-1 808714-1 811242-5 999-50-020083 1-21002-3 1-21002-7 12085270 1-21002-6 1-21113-6 1-22548-4 125442-1 DCE.91.073.BVC DCE.91.090.3MVM DCE.91.130.5MVU DCE.91.202.BVCM 1338300-1 1-354003-0 1338301-1 DF62/RE-MD 142321 1456088-1 1490794-1 1-45804-6 1490357-2 1490357-3 AX100749 1-59619-7